
ceined by Opp Po Appropriate 24:134:08 AM Office	State of New Mexico	Form C-103 <sup>1</sup> of 5
<u>District I</u> – (575) 393-6161 En 1625 N. French Dr., Hobbs, NM 88240	ergy, Minerals and Natural Resources	Revised July 18, 2013 WELL API NO.
011 5. 1 list 5t., Altesia, 141/1 00210	IL CONSERVATION DIVISION	30-025-29275 5. Indicate Type of Lease
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.	STATE FEE
<u>District IV</u> – (505) 476-3460	Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505		19520
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		7. Lease Name or Unit Agreement Name North Hobbs G/SA Unit
PROPOSALS.)  1. Type of Well: Oil Well  Gas Well  Other		8. Well Number 234
2. Name of Operator		9. OGRID Number
Occidental Permian LTD  3. Address of Operator		157984 10. Pool name or Wildcat
P.O. Box 4294 Houston, TX 77210-4294		HOBBS; GRAYBURG-SAN ANDRES
4. Well Location	-54	110000, 0101100110 0, 111711101120
	feet from the SOUTH line and	2563 feet from the WEST line
Section 33	Township 18S Range 38E	NMPM County LEA
11. Ele 3363'	evation (Show whether DR, RKB, RT, GR, etc.	.)
	riate Box to Indicate Nature of Notice,	•
TEMPORARILY ABANDON	AND ABANDON   REMEDIAL WOR	RILLING OPNS. P AND A
CLOSED-LOOP SYSTEM  OTHER:	□ OTHER:	
	E RULE 19.15.7.14 NMAC. For Multiple Co	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of
Objective: Temporarily abandon wellbore		
See planned procedure and wellbore diagra	ms attached.	
Spud Date:	Rig Release Date:	
I hereby certify that the information above is	true and complete to the best of my knowleds	ge and belief.
SIGNATURE Roni Mathew	TITLE Regulatory Advisor	DATE 11/12/2024
Type or print name Roni Mathew For State Use Only	E-mail address: roni_mathew@	@oxy.com PHONE: (713) 215-7827
APPROVED BY:Conditions of Approval (if any):	TITLE	DATE

**Objective:** Temporarily abandon wellbore


### Job Plan:

- 1. POOH & LD ESP Equipment
- 2. Set CICR @ 4000'
- 3. Sqz existing perfs w/ 500 sx cmt
- 4. Spot 35' cmt on top CICR f/ 4000'-3965'
- 5. Circulate wellbore with packer fluid
- 6. Pressure test casing to 500#
- 7. RDMO

## **Current WBD**

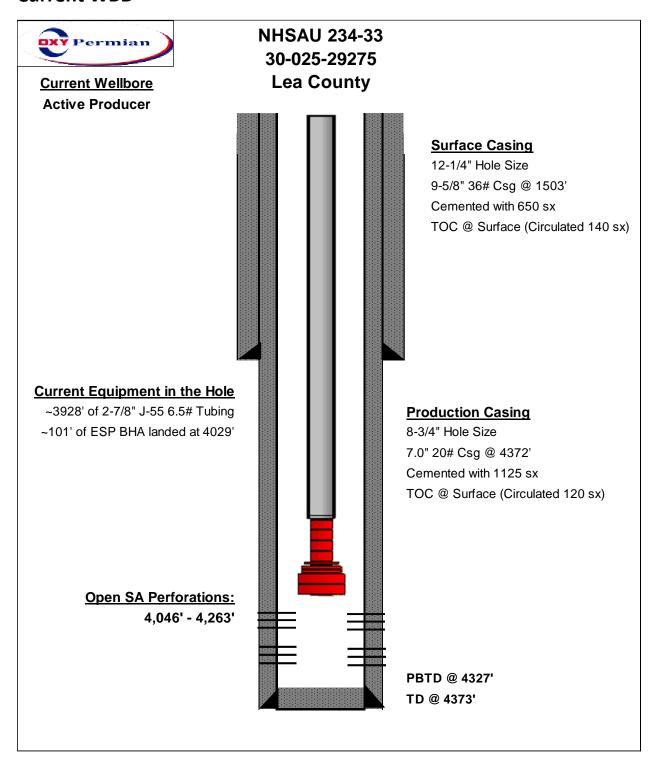

# **Proposed WBD**

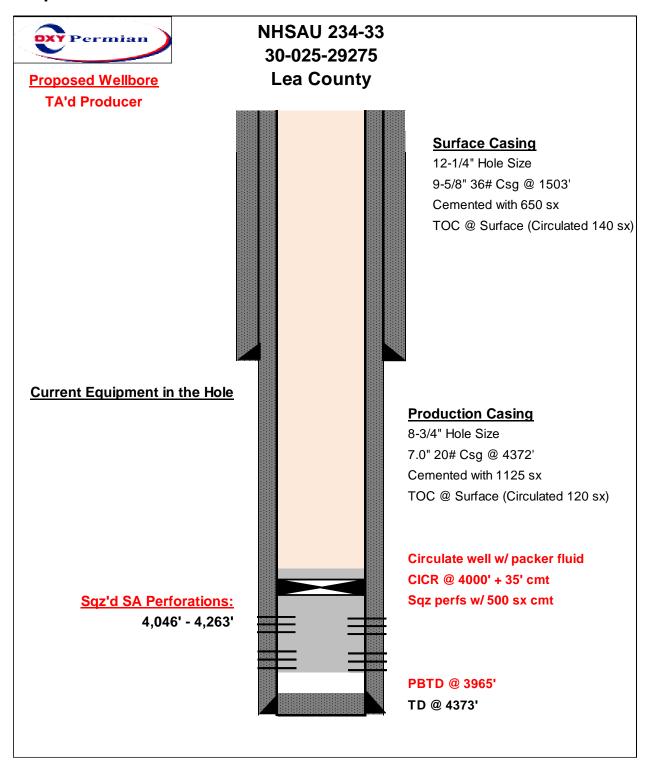

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

# State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 401448

### **CONDITIONS**

Operator:	OGRID:
OCCIDENTAL PERMIAN LTD	157984
P.O. Box 4294	Action Number:
Houston, TX 772104294	401448
	Action Type:
	[C-103] NOI Temporary Abandonment (C-103I)

### CONDITIONS

Created By	Condition	Condition Date
kfortner	Notify the OCD inspection supervisor via email 24 hours prior to beginning Temporarily Abandonment (TA) operations.	11/13/2024
kfortner	Passing MIT test in accordance with 19.15.26.11 or 19.15.25.12-14 NMAC will be required at time of work.	11/13/2024