Submit 1 Copy To Appropriate District Office <u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	State of New Mexico Energy, Minerals and Natural Resources	Form C-103 Revised July 18, 2013 WELL API NO.		
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460	OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505	30-025-21872 5. Indicate Type of Lease STATE X FEE 6. State Oil & Gas Lease No.		
1220 S. St. Francis Dr., Santa Fe, NM 87505		B1-0709-0008		
SUNDRY NOTI (DO NOT USE THIS FORM FOR PROPOS DIFFERENT RESERVOIR. USE "APPLIC PROPOSALS)	7. Lease Name or Unit Agreement Name State A-36			
PROPOSALS.) 1. Type of Well: Oil Well X	Gas Well 🔲 Other	8. Well Number 002		
2. Name of Operator Energy Acumen LLC.		9. OGRID Number		
3. Address of Operator 10103 Gutierrez Rd. NE, Albuquer	10. Pool name or Wildcat Jalmat; TAN-Yates-7 RVRS			
4. Well Location				
Unit Letter <u>E</u>	<u></u>	660_feet from the <u>West</u> line		
Section 36		36-E NMPM County: Lea		
	11. Elevation (Show whether DR, RKB, RT, GR, etc. 3278' DF			

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:			SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK [PLUG AND ABANDON	Х	REMEDIAL WORK]
TEMPORARILY ABANDON [CHANGE PLANS		COMMENCE DRILLING OPNS. P AND A	
PULL OR ALTER CASING		MULTIPLE COMPL		CASING/CEMENT JOB	
DOWNHOLE COMMINGLE					
CLOSED-LOOP SYSTEM [
OTHER:				OTHER:	

 Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Citation Oil & Gas Corp. as the lease holder of the State C 001Y well, submits the intent to plug as requested by the New Mexico State Land Office. On September 5, 2023, the NMOCD issued an authorization letter to Citation, pursuant to its authority under the Agreed Compliance Order with Energy Acumen. Please see the attached authorization letter for details. Citation plans to plug this well in accordance with the attached procedure.

Spud Date:	09/01/1966	Rig Release Date	e:			
I hereby certify that the information above is true and complete to the best of my knowledge and belief.						
SIGNATURE	Steppy Gencauces	Permitt	ing Manager	DATE 04/28/2025		
Type or print For State Use	name Steffy Goncalves	_ E-mail address:	SGoncalves@cogc.com	_ PHONE: 281-891-1213		
APPROVED Conditions of	BY: Approval (if any):	TITLE		_DATE		

Page 1 of 15

State of New Mexico Energy, Minerals and Natural Resources Department

Michelle Lujan Grisham Governor

Sarah Cottrell Propst Cabinet Secretary

Page 2 of 15

Todd E. Leahy, JD, PhD Deputy Cabinet Secretary Dylan M. Fuge, Division Director Oil Conservation Division



BY CERTIFIED AND ELECTRONIC MAIL

September 5, 2023

Sharon Ward Permitting Manager Citation Oil & Gas Corp. P.O. Box 690688 Houston, TX 77069-2212

Re: Citation Oil and Gas Corp.'s Request to Plug and Abandon Wells

Dear Ms. Ward:

The Oil Conservation Division ("OCD") received your emails of July 26 – August 8, 2023, requesting permission for Citation Oil & Gas Corp. ("Citation") to plug and abandon the following wells: State C #00Y (30-025-03500); State C #003 (30-025-03498); State C #004 (30-025-03499); State C #002Y (30-025-03507); State C Com #002 (30-025-03497); and State A-36 #002 (30-025-21872). Energy Acumen, LLC is the registered operator of these wells and Citation is the leaseholder where the wells are located. As the leaseholder, Citation may be deemed a responsible operator for purposes of plugging and remediation activities or for indemnification of costs incurred by OCD for such activities.

On March 10, 2022, Energy Acumen and OCD entered into an Agreed Compliance Order (ACOI) for Inactive Wells, setting forth certain compliance deadlines to be met by Operator ("ACOI-20194"). That ACOI is incorporated herein as though set forth in full. On March 28, 2023, OCD notified Energy Acumen that it is out of compliance with that ACOI and that pursuant to paragraph 21 of ACOI-20194, OCD is authorized to plug and abandon certain wells, including those listed above.

OCD hereby authorizes Citation to plug and abandon the above-identified wells on OCD's behalf pursuant to its authority under ACOI-20194.

Please contact Jesse Tremaine, Assistant General Counsel at (505) 231-9312 or JesseK.Tremaine@emnrd.nm.gov with questions, including the submission of plugging sundries as OCD will not be transferring operatorship to you and will need to insert the plugging sundries into the wellfiles.

Date

Regards,

Dylan M. Fuge Director 9/5/2023


Received by OCD: 4/29/2025 12:09:54 PM

cc: EMNRD-OGC

State A-36 002 API# 30-025-21872 Proposed P&A Procedure

- 1. Pull production equipment
- 2. Install CIBP 100' above top perf @ 2536'. Perfs (2636'-2772').
- 3. RIH w/ CBL. Run CBL from (2,536' Surface)
- 4. Dump bail 3 sx class "C" neat cmt on top of CIBP. Calculated TOC @ ~2516'.
- 5. Load hole w/ 9.5# MLF from (2516' 2000').
- 6. Spot 30 sx class "C" neat cmt from (2000' 1850').
- 7. Load hole w/ 9.5# MLF from (1850' 1,420').
- 8. Spot 30 sx class "C" neat from (1,420' 980').
- 9. Load Hole w/ 9.5# MLF f/ (980'-350')
- 10. Perf @ 350'. EIR into perfs @ 350'.
- 8. If injection rate is established, Sqz 95 sx class "C" neat cmt from (350' Surf').
- 9. If injection rate cannot be established, Spot 70 sx class "C" neat cmt from (350' Surf').
- 10. Well will be reclaimed as per NMOCD and SLO guidelines.

General Purpose Worksheet Subject # 2 Page No. State A-36 File JALMAT Field Drill + compl. 9-66 Dete - 4-20-88 8y T. DAY JAC 12-13-99 PRESENT STATUS DF + GL = 9'171/2 hole 13 318" 54.5 # csq @ 112' wi 100 sx cmt Circ'd. 11" CALC' TOC behind 41/2" csg. @ 900' USING 75% EXCESS hole 8518" 24 # csq @ 1200' w1 650 sx cmt Circ'd. Completion Assembly Red DETAil 6 3/4 " 77 hole TANSIL pERTS 2636 - 2656' (16 shots) 6-85 tag fill @ 5-91_ 2760 YAtES PERTS 2681 - 2772' (26 shots) PBD 2775 CIBP @ 2784' 4'12" 10.5 # csg @ 2800' wi 300 sx cmt . 3718" YAtes OH 2800-2867' hole TD 2867'

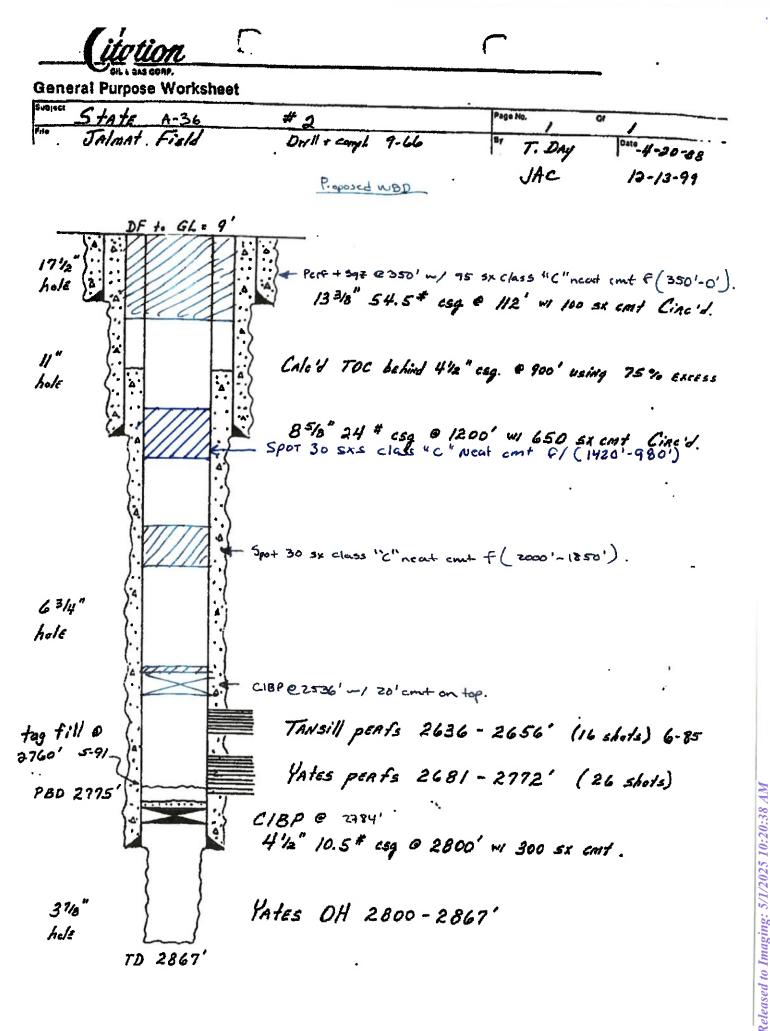

State of New Mexico Energy, Minerals and Natural Resources Department Oil Conservation Division Standard Plugging Conditions



This document provides OCD's general plugging conditions of approval. It should be noted that the list below may not cover special plugging programs in unique and unusual cases, and OCD expressly reserves the right to impose additional requirements to the extent dictated by project conditions. The OCD also reserves the right to approve deviations from the below conditions if field conditions warrant a change. A C-103F NOI to P&A must be approved prior to plugging operations. Failure to comply with the conditions attached to a plugging approval may result in a violation of 19.15.5.11 NMAC, which may result in enforcement actions, including but not limited to penalties and a requirement that the well be re-plugged as necessary.

- 1. Notify OCD office at least 24 hours before beginning work and seek prior approval to implementing any changes to the C-103 NOI to PA.
 - North Contact, Monica Kuehling, 505-320-0243, monica.kuehling@emnrd.nm.gov
 - South Contact, Gilbert Cordero, 575-626-0830, gilbert.cordero@emnrd.nm.gov
- 2. A Cement Bond Log is required to ensure strata isolation of producing formations, protection of water and correlative rights. A CBL must be run or be on file that can be used to properly evaluate the cement behind the casing.

Note: Logs must be submitted to OCD via OCD permitting. A copy of the log may be emailed to OCD inspector for faster review times, but emailing does not relieve the operators obligation to submit through OCD permitting.

- 3. Once Plugging operations have commenced, the rig must not rig down until the well is fully plugged without OCD approval. If gap in plugging operations exceeds 30 days, the Operator must file a subsequent sundry of work performed and revised NOI for approval on work remaining. At no time shall the rig be removed from location if it will result in waste or contamination of fresh water.
- 4. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 5. Fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
 - North, water or mud laden fluids
 - South, mud laden fluids
- 6. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to an OCD permitted disposal facility.

7. Class of cement shall be used in accordance with the below table for depth allowed.

Class	TVD Lower Limit (feet)
Class A/B	6,000
Class I/II	6,000
Class C or III	6,000
Class G and H	8,000
Class D	10,000
Class E	14,000
Class F	16,000

- 8. After cutting the well head any "top off cement jobs" must remain static for 30 minutes. Any gas bubbles or flow during this 30 minutes shall be reported to the OCD for approval of next steps.
- 9. Trucking companies being used to haul oilfield waste fluids (Commercial or Private) to a disposal facility shall have an approved OCD C-133 permit.
 - A copy of this permit shall be available in each truck used to haul waste products.
 - It is the responsibility of the Operator and Contractor to verify that this permit is in place prior to performing work.
 - Drivers shall be able to produce a copy upon request of an OCD Compliance Officer.
- 10. Filing a [C-103] Sub. Plugging (C-103P) will serve as notification that the well has been plugged.
- 11. A [C-103] Sub. Release After P&A (C-103Q) shall be filed no later than a year after plugging and a site inspection by OCD Compliance officer to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to meet OCD standards before bonding can be released.
- 12. Produced water or brine-based fluids may not be used during any part of plugging operations without prior OCD approval.
- 13. Cementing;
 - All cement plugs will be neat cement and a minimum of 100' in length. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
 - If cement does not exist between or behind the casing strings at recommended formation depths, the casing perforations will be shot at 50' below the formation top and the cement retainer shall be set no more than 50' from the perforations.
 - WOC (Wait on Cement) time will be:
 - 4 hours for accelerated (calcium chloride) cement.
 - 6 hours on regular cement.
 - Operator must tag all cement plugs unless it meets the below condition.
 - The operator has a passing pressure test for the casing annulus and the plug is only an inside plug.
 - If perforations are made operator must tag all plugs using the work string to tag unless given approval to tag with wireline by the correct contact from COA #1 of this document.
 - This includes plugs pumped underneath a cement retainer to ensure retainer seats properly after cement is pumped.
 - Cement can only be bull-headed with specific prior approval.
 - Squeeze pressures are not to exceed the exposed formations frac gradient or the burst pressure of the casing.

- 14. A cement plug is required to be set from 50' below to 50' above (straddling) formation tops, casing shoes, casing stubs, any attempted casing cut offs, anywhere the casing is perforated, DV tools.
 - Perforation/Formation top plug. (When there is less than 100ft between the top perforation to the formation top.) These plugs are required to be started no greater than 50ft from the top perforation. However, the plug should be set below the formation top or as close to the formation top as possible for the maximum isolation between the formations. The plug is required to be a 100ft cement plug plus excess.
 - Perforation Plug when a formation top is not included. These plugs are required to be started within 50ft of the top perforation. The plug is required to be a 100ft cement plug plus excess.
 - Cement caps on top of bridge plugs or cement retainers for perforation plugs, that are not straddling a formation top, may be set using a bailer with a minimum of 35' of cement in lieu of the 100' plug. The bridge plug or retainer must be set within 50ft of the perforations.
 - Perforations are required below the surface casing shoe if cement does not exist behind the casing, a 30-minute minimum wait time will be required immediately after perforating to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. If gas is detected contact the OCD office for directions.
- 15. No more than 3000 feet is allowed between cement plugs in cased hole and no more than 2000 feet is allowed in open hole.
- 16. Formation Tops to be isolated with cement plugs, but not limited to are:
 - Northwest See Figure A
 - South (Artesia) See Figure B
 - Potash See Figure C
 - In the R-111-P (Or as subsequently revised) Area a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
 - South (Hobbs) See Figure D1 and D2
 - Areas not provided above will need to be reviewed with the OCD on a case by case basis.
- 17. Markers
 - Dry hole marker requirements 19.15.25.10.
 - The operator shall mark the exact location of plugged and abandoned wells with a steel marker not less than four inches in diameter set in cement and extending at least four feet above mean ground level. The marker must include the below information:
 - 1. Operator name
 - 2. Lease name and well number
 - 3. API number
 - 4. Unit letter
 - 5. Section, Township and Range

• AGRICULTURE (Below grade markers)

In Agricultural areas a request can be made for a below ground marker. For a below ground marker the operator must file their request on a C-103 notice of intent, and it must include the following;

- A) Aerial photo showing the agricultural area
- B) Request from the landowner for the below ground marker.

C) Subsequent plugging report for a well using a below ground marker must have an updated C-102 signed by a certified surveyor for SHL.

Note: A below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to OCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to OCD. OCD requires a current survey to verify the location of the below ground marker, however OCD will accept a GPS coordinate that were taken with a GPS that has an accuracy of within 15 feet.

18. If work has not commenced within 1 year of the approval of this procedure, the approval is automatically expired. After 1 year a new [C-103] NOI Plugging (C-103F) must be submitted and approved prior to work.

Figure A

North Formations to be isolated with cement plugs are:

- San Jose
- Nacimiento
- Ojo Alamo
- Kirtland
- Fruitland
- Picture Cliffs
- Chacra (if below the Chacra Line)
- Mesa Verde Group
- Mancos
- Gallup
- Basin Dakota (plugged at the top of the Graneros)
- Deeper formations will be reviewed on a case-by-case basis

Figure B

South (Artesia) Formations to be isolated with cement plugs are:

- Fusselman
- Montoya
- Devonian
- Morrow
- Strawn
- Atoka
- Permo-Penn
- Wolfcamp
- Bone Springs
- Delaware , in certain areas where the Delaware is subdivided into;
 - 1. Bell Canyon
 - 2. Cherry Canyon
 - 3. Brushy Canyon
 - Any salt sections
- Abo

•

- Yeso
- Glorieta
- San Andres
- Greyburg
- Queen
- Yates

Figure C

Potash Area R-111-P

T 18S - R 30E Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C T 19S – R 29E Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A- F. Sec 27 Unit A,B,C,F,G,H. T 19S – R 30E Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P. T 19S – R 31E Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O.P. T 20S – R 29E Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G. T 20S – R 30E Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 20 – 29. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36. T 20S – R 31E Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36. T 21S – R 29E Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F - P.T 21S – R 30E Sec 1 - Sec 36

T 21S – R 31E Sec 1 – Sec 36 T 22S – R 28E Sec 36 Unit A,H,I,P. T 22S – R 29E Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36 T 22S – R 30E Sec 1 – Sec 36 T 22S – R 31E Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34. T 23S – R 28E Sec 1 Unit A T 23S – R 29E Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L. T 23S – R 30E Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36. T 23S – R 31E Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E. T 24S – R 29E Sec 2 Unit A, B, C, D. Sec 3 Unit A T 24S – R 30E Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.

```
T 24S – R 31E
Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G,
K – N. Sec
35 Unit E – P. Sec 36 Unit E,K,L,M,N.
```

T 25S – R 31E Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

Figure D1 and D2

South (Hobbs) Formations to be isolated with cement plugs are:

The plugging requirements in the Hobbs Area are based on the well location within specific areas of the Area (See Figure D1). The Formations in the Hobbs Area to be isolated with cement plugs are (see Figure D2)

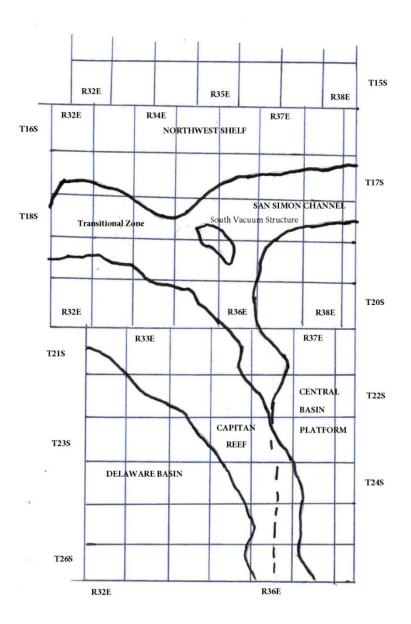


Figure D1 Map

Page 14 of 15

.

Figure D2 Formation Table

	100'	P'lug to isolate upper a	nd lower fresh water	zones (typiailly 2.50' to	350')	
ND!rthwest Shelf	C;iptan Reef Are <a< th=""><th>Trani5ition Zone</th><th>San Simon Oh.annel</th><th>South \lacJUUm Structure</th><th>Delaware Basin</th><th>Ce<n,tiral basin="" platform<="" th=""></n,tiral></th></a<>	Trani5ition Zone	San Simon Oh.annel	South \lacJUUm Structure	Delaware Basin	Ce <n,tiral basin="" platform<="" th=""></n,tiral>
Granit \./ash (Detrital basement material and fractured pre-Cambrian basement rock)	Siluro-Devonian	Morrow	Siluro-Devonian	Ellenburger	Siluro-Devonian	Granit \./ash (Detrital basement material, fractured pre-Cambrian basement rock and fracture Mafic Volcanic intrusives).
Montoya	Mississippian	Atoka	Morrow	Mckee	Morrow	Ellenburger
Fusselman	Morrow	Strawn	\./olfcamp	Siluro-Devonian	Atoka	Connell
Woodford	Atoka	Cisco	Abo Reef	Woodford	Strawn	Waddell
Siluro-Devonian	Strawn	Pennsylvanian	Bone Spring	Mississippian	Pennsylvanian	Mckee
Chester	Pennsylvanian	\./olfcamp	Delaware	Barnett Shale	Low er \./olfcamp	Simpson Group
Austin	\./olfcamp	Bone Spring	San Andres	Morrow	Upper \./olfcamp	Montoya
Mississippian	Abo Reef, if present	Delaware	Queen	Atoka	\./olfcamp	Fusselman
Morrow	Abo, if present	San Andres	Yates	Strawn	Third Bone Spring Sand (Top of \./olfbone)	Silurian
Atoka	Queen, if present	Grayburg-San Andres	Base of Salt	Canyon	First Bone Spring Sand (Top of Lower Bone Spring)	Devonian
Lower Pennsylvanian	Bone Spring	Queen	Rustler	Pennsylvanian	Bone Spring	Strawn
Cisco-Canyon	Delaware	Seven Rivers		Blinebry	Brushy Canyon	Pennsylvanian
Pennsylvanian	Base Capitan Reef	Yates		Bone Spring	Delaw are (Base of Salt)	\./olfcamp
Bough	Seven Rivers	Base of Salt		San Andres	Rustler	Abo
\./olfcamp	Yates	Rustler		Queen		Abo Reef
Abo	Top Capitan Reef			Base of Salt		Drinkard
Abo Reef, if present	Base of Salt			Rustler		Tubb
Yeso (Township 15 South to Township 17 South)	Rustler					Blinebry
Drinkard or Low er Y eso (Township 15 South to Township 17 South)						Paddock
Tubb (Township 15 South to Township 17 South)						Glorieta
Blinebry (Township 15 South to Township 17 South)						San Andres
Pad dock (Township 15 South to Township 17 South)						Grayburg
Glorieta						Grayburg-San Andres
San Andres		Į				Queen
Queen (Township 15 South to Township 17 South)						Seven Rivers
Seven Rivers (Township 15 South to Township 17 South)						Yates
Yates (Township 15 South to Township 17 South)						Base of Salt
Base of Salt						Rustler
Rustler						

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:	
CITATION OIL & GAS CORP	4537	
P.O. Box 690688	Action Number:	
Houston, TX 770692212	456750	
	Action Type:	
	[C-103] NOI Plug & Abandon (C-103F)	

CONDITIONS

Created By	Condition	Condition Date
loren.diede	Notify the OCD inspection supervisor via email 24 hours prior to beginning Plug & Abandon (P&A) operations.	5/1/2025
loren.diede	Submit the CBL tif file to NMOCD for upload into the Well Log File.	5/1/2025
loren.diede	This well is not within the LPCH restricted area and an above gfrounf P&A marker is required.	5/1/2025
loren.diede	Submit a photo and the GPS coordinates of the P&A marker with the subsequent P&A report.	5/1/2025

CONDITIONS

Page 15 of 15

Action 456750