

Santa Fe Main Office
Phone: (505) 476-3441
General Information
Phone: (505) 629-6116

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

Online Phone Directory Visit:
<https://www.emnrd.nm.gov/ocd/contact-us/>

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-20215
1. Type of Well: Oil Well ☐ Gas Well ☐ Other Injection		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Sandlott Energy (Jackie Brewer DBA)		6. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 711 Lovington, NM 88260		7. Lease Name or Unit Agreement Name Resler Yates State
4. Well Location Unit Letter H: 2310 feet from the North line and 990 feet from the East line Section 32 Township 18S Range 28E NMPM Eddy County		8. Well Number #380
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number 154329
10. Pool name or Wildcat (3230) Artesia; Queen-Grayburg-San Andres		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐ DOWNHOLE COMMINGLE ☐ CLOSED-LOOP SYSTEM ☐ OTHER: ☐		SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS. ☐ P AND A ☐ CASING/CEMENT JOB ☐ OTHER: ☐	
--	--	--	--

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Please see attached procedure & wellbore schematics

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE _____ TITLE _____ DATE _____

Type or print name _____ E-mail address: _____ PHONE: _____

For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____

Conditions of Approval (if any):

*Mewbourne Oil Company***Plug and Abandon**

Submitted By:

Wellname: Resler Yates State #380**Location:** 2130' FNL & 990' FEL; Sec 32, T18S, R28E; Eddy Co., NM**Date:** August 8, 2025**API #:** 30-015-20215**Surf Csg:** 8 5/8" 28# H-40**Prod Csg:** 5 1/2" 14# J-55**Surf Set :** 532'**Prod Set:** 2080'**Perfs:** 2036'-2046' (20 shots)**Tbg:** 2 3/8# 4.7# N-80**Tbg Set:** 1957'

Well is to be plugged & abandoned.


Procedure:

1. MIRU plugging crew.
2. ND WH, NU BOP.
3. Release packer and POOH w/ 1957' of 2 3/8" tbg.
4. MIRU WL.
5. RIH w/ WL, CBL, 5 1/2" CIBP & set @ 2020'. (Top perf @ 2036')
6. Run CBL while POOH w/ WL.
7. RIH w/ pipe and tag CIBP.
8. Circulate 50bbbls 9.0# MLF.
9. Test csg to 500# for 30 minutes.
10. Spot 55 sks Class C neat cmt (537'±) on top of CIBP. (Grayburg @ 2022' & Queen @ 1575')
11. POOH w/ pipe to 500'.
12. WOC 4 hrs & tag plug w/ tubing @ 1525' or higher.
13. LD pipe.
14. RIH w/ WL gun string. Perf interval of 570'-585' and POOH w/ gun string.
15. Pump 35bbbls of 9.0# MLF.
16. Circulate approximately 240sks of Class C neat cmt to surface.
17. WOC & confirm that wellbore remains full.
18. Cut off WH & install dry hole marker. Cut off anchors & clean location.

Mewbourne Oil Company


Plug and Abandon

Vertical schematic (actual)

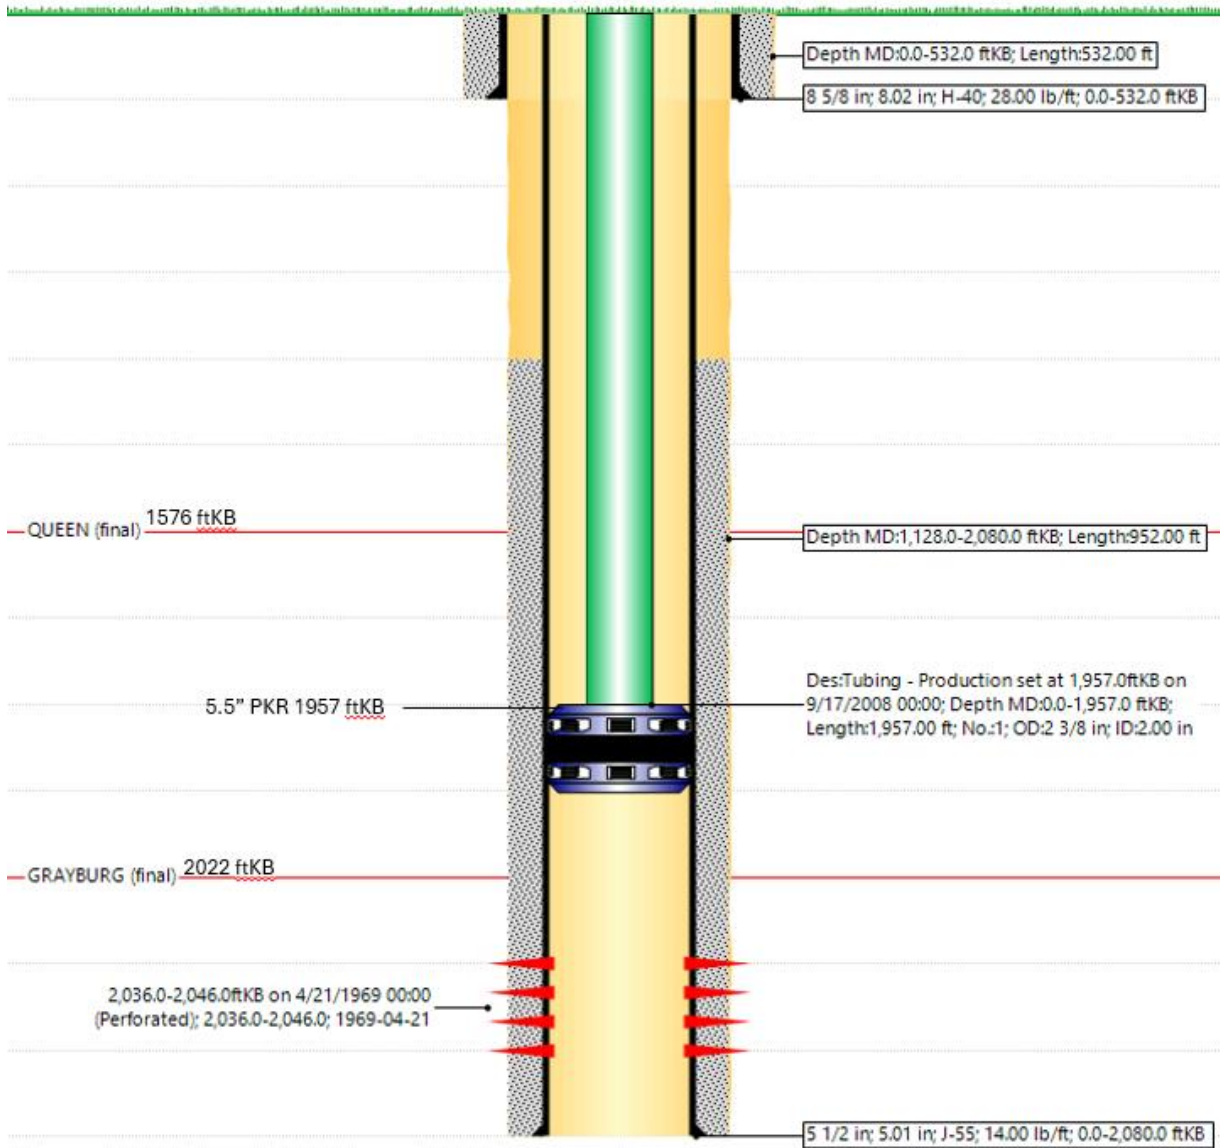

Mewbourne Oil Company

Plug and Abandon

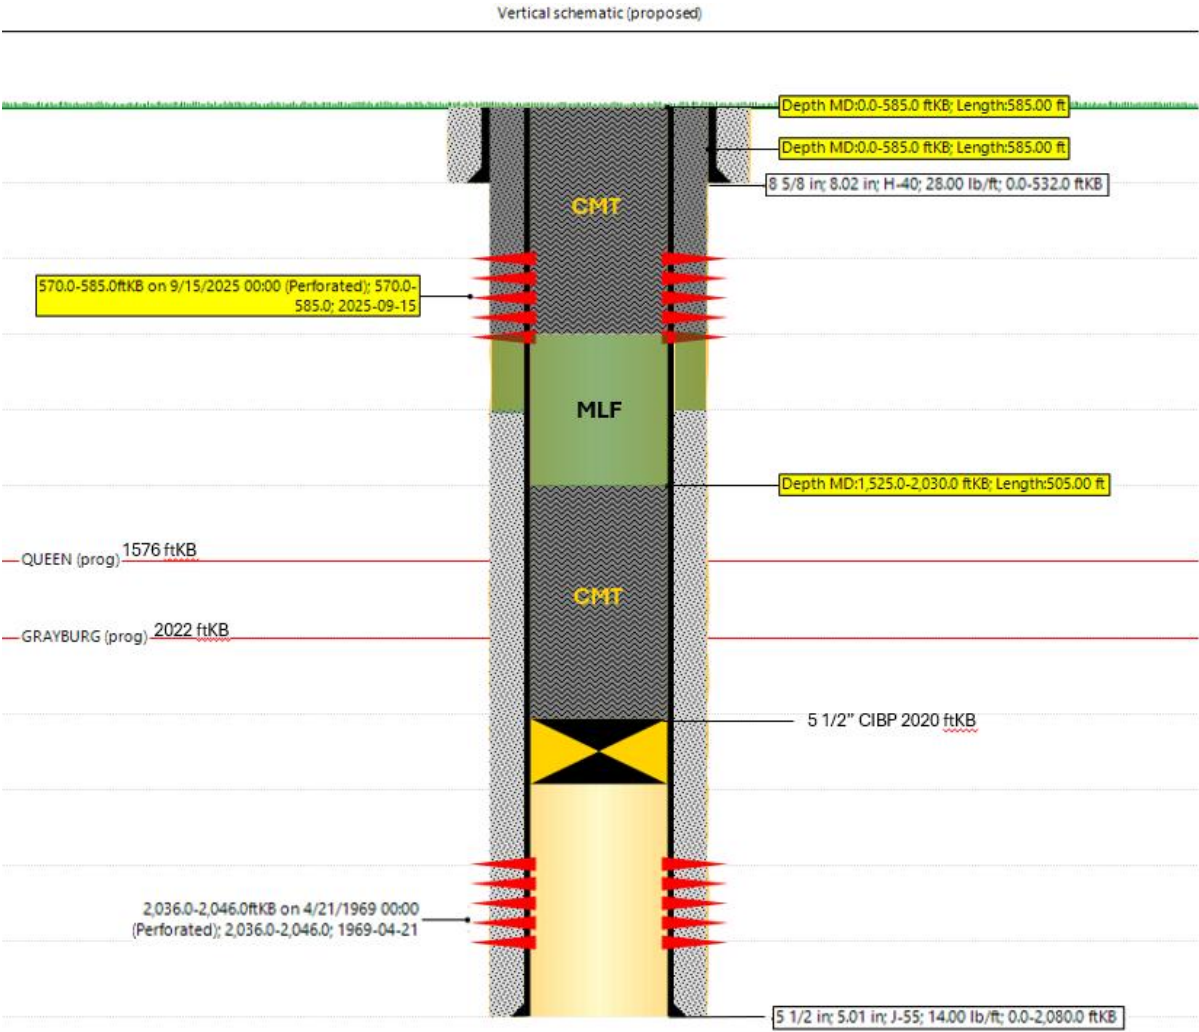

CMT to Surface Plug & Squeeze	
Class C Yield	1.34
240	sks
321.6	ft^3
57.28	bbls
614.43	ft

Mud	
129.37	ft^3
23.04	bbls
940	ft

CMT Plug	
Class C Yield	1.34
55	sks
73.7	ft^3
13.13	bbls
537.92	ft

Santa Fe Main Office
Phone: (505) 476-3441
General Information
Phone: (505) 629-6116

Online Phone Directory Visit:

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised July 18, 2013

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-2-215
1. Type of Well: Oil Well ☐ Gas Well ☐ Other Injection ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Sandlott Energy (Jackie Brewer DBA)		6. State Oil & Gas Lease No.
3. Address of Operator P O Box 711 Lovington, NM 88260		7. Lease Name or Unit Agreement Name Resler Yates State
4. Well Location Unit Letter <u>H</u> : <u>2310</u> feet from the <u>North</u> line and <u>290</u> feet from the <u>East</u> line Section <u>32</u> Township <u>18S</u> Range <u>28E</u> NMPM <u>1</u> ddy County		8. Well Number <u>#381</u>
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number <u>134329</u>
10. Pool name or Wildcat (3230) Artesia, Queen-Grayburg-San Andres		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
 TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
 PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
 DOWNHOLE COMMINGLE ☐
 CLOSED-LOOP SYSTEM ☐
 OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
 COMMENCE DRILLING OPNS ☐ P AND A ☐
 CASING/CEMENT JOB ☐
 OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Please see attached procedure & wellbore schematics

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

[Signature]

TITLE

DATE

9/25/2025

Type or print name

E-mail address:

PHONE:

For State Use Only

APPROVED BY:

TITLE

DATE

Conditions of Approval (if any):

Plug and Abandon

Submitted By:

Wellname: Resler Yates State #380**Location:** 2130' FNL & 990' FEL; Sec 32, T18S, R28E; Eddy Co., NM**Date:** August 8, 2025**API #:** 30-015-20215**Surf Csg:** 8 5/8" 28# H-40**Prod Csg:** 5 1/2" 14# J-55**Surf Set :** 532'**Prod Set:** 2080'**Perfs:** 2036'-2046' (20 shots)**Tbg:** 2 3/8# 4.7# N-80**Tbg Set:** 1957'


Well is to be plugged & abandoned.

Procedure:


1. MIRU plugging crew.
2. ND WH, NU BOP.
3. Release packer and POOH w/ 1957' of 2 3/8" tbg.
4. MIRU WL.
5. RIH w/ WL, CBL, 5 1/2" CIBP & set @ 2020'. (Top perf @ 2036')
6. Run CBL while POOH w/ WL.
7. RIH w/ pipe and tag CIBP.
8. Circulate 50bbls 9.0# MLF.
9. Test csg to 500# for 30 minutes.
10. Spot 55 sks Class C neat cmt (537'±) on top of CIBP. (Grayburg @ 2022' & Queen @ 1575')
11. POOH w/ pipe to 500'.
12. WOC 4 hrs & tag plug w/ tubing @ 1525' or higher.
13. LD pipe.
14. RIH w/ WL gun string. Perf interval of 570'-585' and POOH w/ gun string.
15. Pump 35bbls of 9.0# MLF.
16. Circulate approximately 240sks of Class C neat cmt to surface.
17. WOC & confirm that wellbore remains full.
18. Cut off WH & install dry hole marker. Cut off anchors & clean location.

Plug and Abandon

Vertical schematic actual

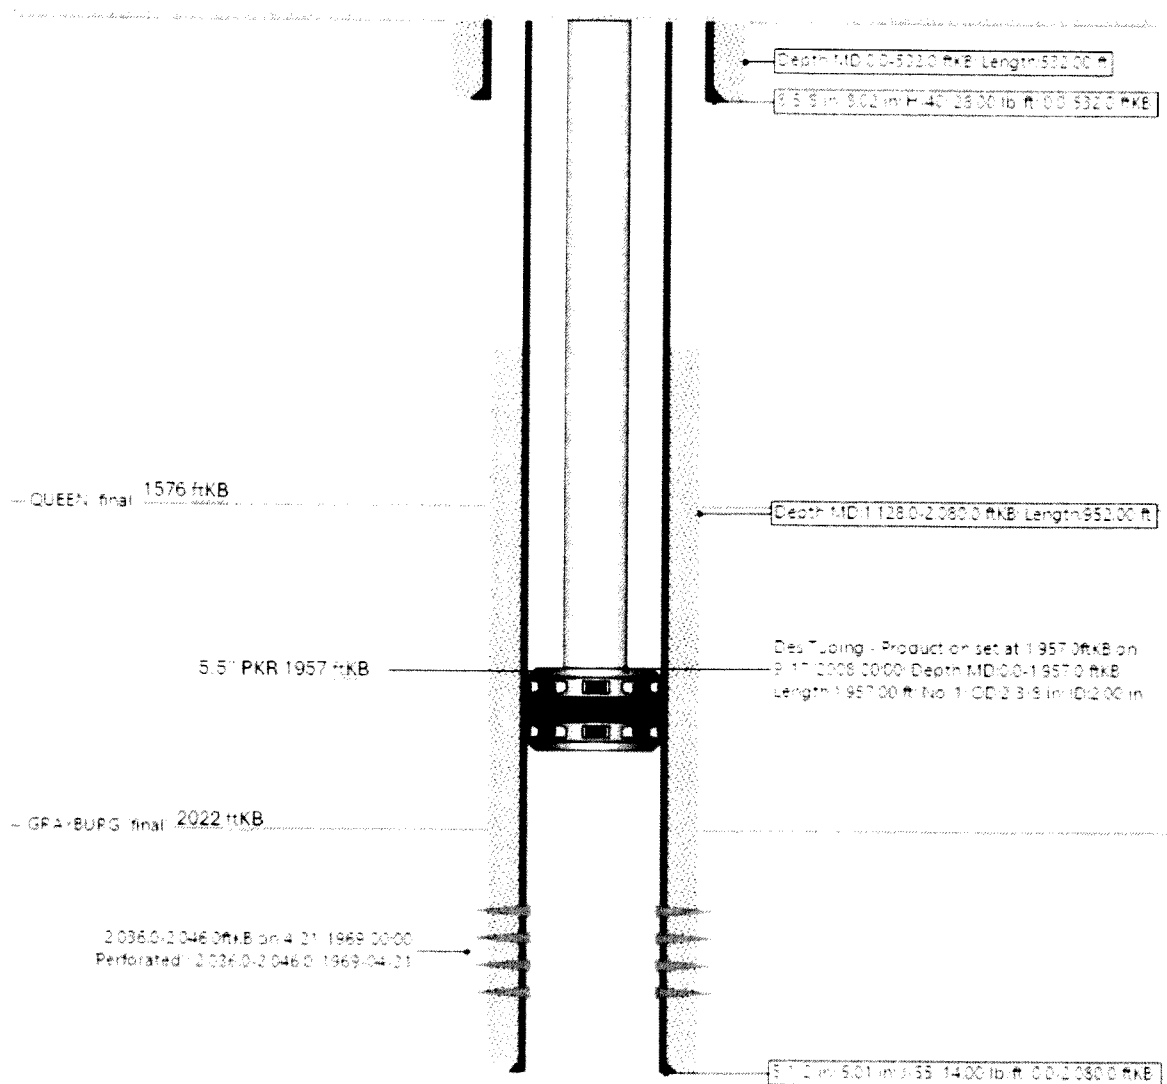

Plug and Abandon

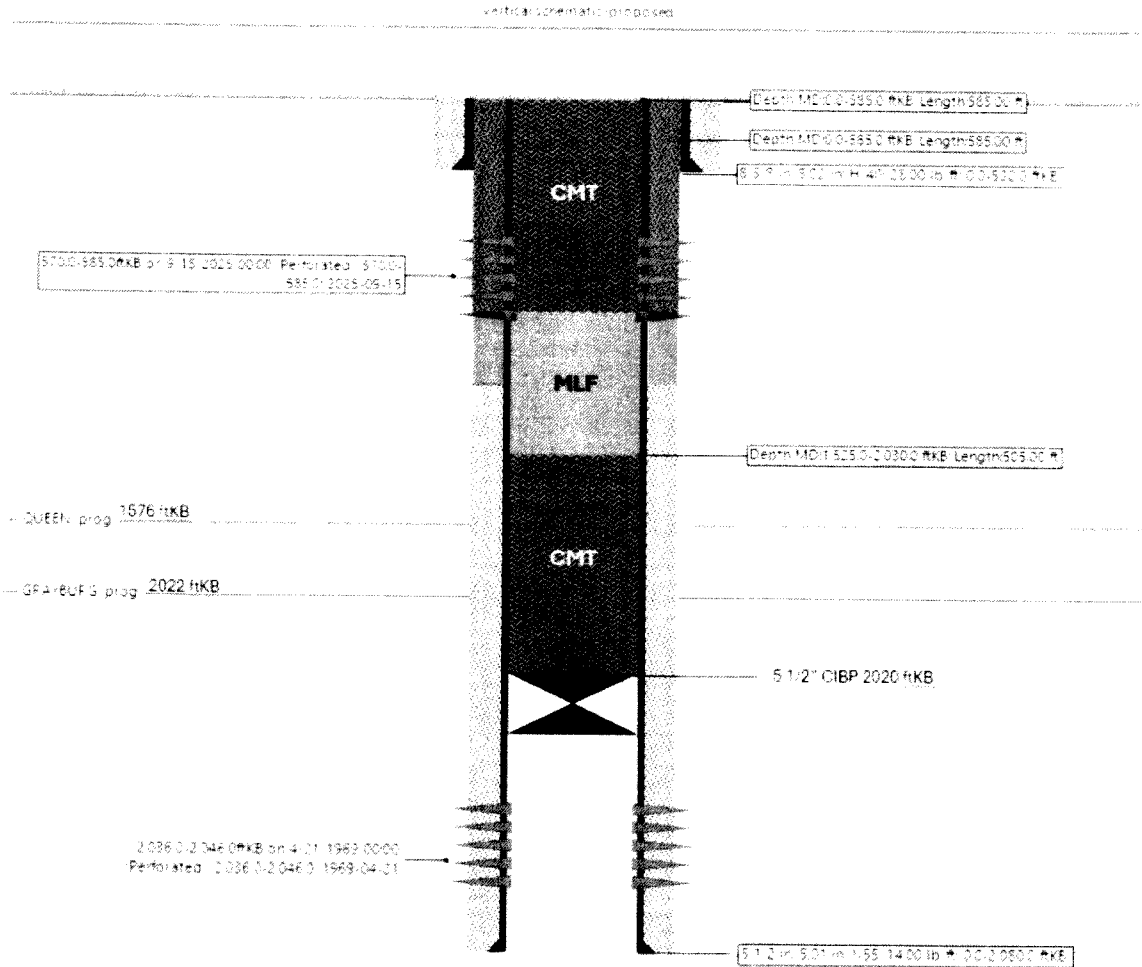

CMT to Surface Plug & Squeeze

Class C Yield	1.34
240	sks
321.6	ft^3
57.28	bbbls
614.43	ft

Mud

129.37	ft^3
23.04	bbbls
940	ft

CMT Plug

Class C Yield	1.34
55	sks
73.7	ft^3
13.13	bbbls
537.92	ft

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 517868

CONDITIONS

Operator: MEWBOURNE OIL CO P.O. Box 5270 Hobbs, NM 88241	OGRID: 14744
	Action Number: 517868
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
loren.diede	Notify the OCD inspection supervisor via email 24 hours prior to beginning Plug & Abandon (P&A) operations.	10/23/2025
loren.diede	Submit the CBL tif file for the NMOCD to upload into the Well Log File.	10/23/2025
loren.diede	NMOCD has determined that this well is not within the LPCH restricted area and an above ground P&A marker is required.	10/23/2025
loren.diede	Submit a photo and GPS coordinates of the P&A marker with the final P&A reports. The API # on the marker is to clearly legible.	10/23/2025
loren.diede	NMOCD requires that a plug(s) is to be added to cover the 7 Rivers = (960') and Yates = (760') formation tops	10/23/2025