

Submit Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-07371
5. Indicate Type of Lease STATE [] FEE [x]
6. State Oil & Gas Lease No. 19520
7. Lease Name or Unit Agreement Name North Hobbs G/SA Unit
8. Well Number 341
9. OGRID Number 157984
10. Pool name or Wildcat HOBBS; GRAYBURG-SAN ANDRES
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3634' (Gr)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)
1. Type of Well: Oil Well [x] Gas Well [] Other []
2. Name of Operator Occidental Permian LTD
3. Address of Operator P.O. Box 4294 Houston, TX 77210-4294
4. Well Location
Unit Letter O : 330 feet from the South line and 2310 feet from the EAST line
Section 20 Township 18S Range 38E NMPM County LEA

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:
PERFORM REMEDIAL WORK [] PLUG AND ABANDON [x]
TEMPORARILY ABANDON [] CHANGE PLANS []
PULL OR ALTER CASING [] MULTIPLE COMPL []
DOWNHOLE COMMINGLE []
CLOSED-LOOP SYSTEM []
OTHER: []
SUBSEQUENT REPORT OF:
REMEDIAL WORK [] ALTERING CASING []
COMMENCE DRILLING OPNS. [] P AND A []
CASING/CEMENT JOB []
OTHER: []
Notify OCD 24 hrs. prior to any work done, gilbert.cordero@emnrd.nm.gov so a SG may be assigned.

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Objective: Plug & abandon wellbore

See detailed planned procedure and current/proposed wellbore diagrams attached.

Spud Date: []

Rig Release Date: []

SEE ATTACHED COA'S MUST BE PLUGGED BY 2/12/27

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Roni Mathew TITLE Regulatory Advisor DATE 02/18/2026

Type or print name Roni Mathew E-mail address: roni_mathew@oxy.com PHONE: (713) 215-7827
For State Use Only

APPROVED BY: Gilbert Cordero TITLE Petroleum Supervisor DATE 2/26/26
Conditions of Approval (if any):


Objective: Plug & Abandon Wellbore

APPROVED GC
2/26/26


Job Plan:

1. MIRU.
2. POOH & LD rods, pump & 2-7/8" production tubing.
3. RU WL. Set CICR at 4015'.
4. Pressure test casing to 500 psi for 30 min.
5. Log CBL f/ 4015', **Keep fluid in hole & run CBL to Surface with zero psi.**
6. **Run Casing Inspection Log to surface.** - RD WL.
7. PU workstring x RIH & tag CICR @ 4015'.
8. Establish injection rate below CICR. Squeeze 100 sx Class C cmt below retainer to max 1000 psi
(San Andres/Shoe plug)
9. WOC 6 hrs. Report to NMOCD.
10. Tag CICR at 4015'. Spot 125 sx Class C cmt f/ 4015' to 3453' or greater **(GB/Queen plug)**.
11. WOC 6 hrs & Tag TOC. Report to NMOCD.
12. Circulate hole w/ 10# plugging mud.
13. Perforate 7" casing @ 3010' (verify w/ CBL). Attempt squeeze 160 sx Class C cmt. Displace cement to 2690' **(Seven Rivers/Yates/Shoe plug)**.
14. WOC 6 hrs & Tag TOC. **Bubble Test** - Report to NMOCD.
15. Spot 60 sx Class C cmt f/ 1720' to 1498' or greater **(Salt/Rustler plug)**.
 - a. No tag required if casing pressured good from Step (4) & CBL confirms good cement behind 7" casing.
16. Perforate 7" casing @ 400'. Circulate 400 sx Class C cmt from 400' to surface. **(Surface plug)**
17. Ensure cement is to surface on all casing strings. **WOC & Bubble Test**
18. RDMO.
19. Cutoff WH & install marker, 4" diameter & 4' tall.
20. Remove anchors and debris.

Current WBD

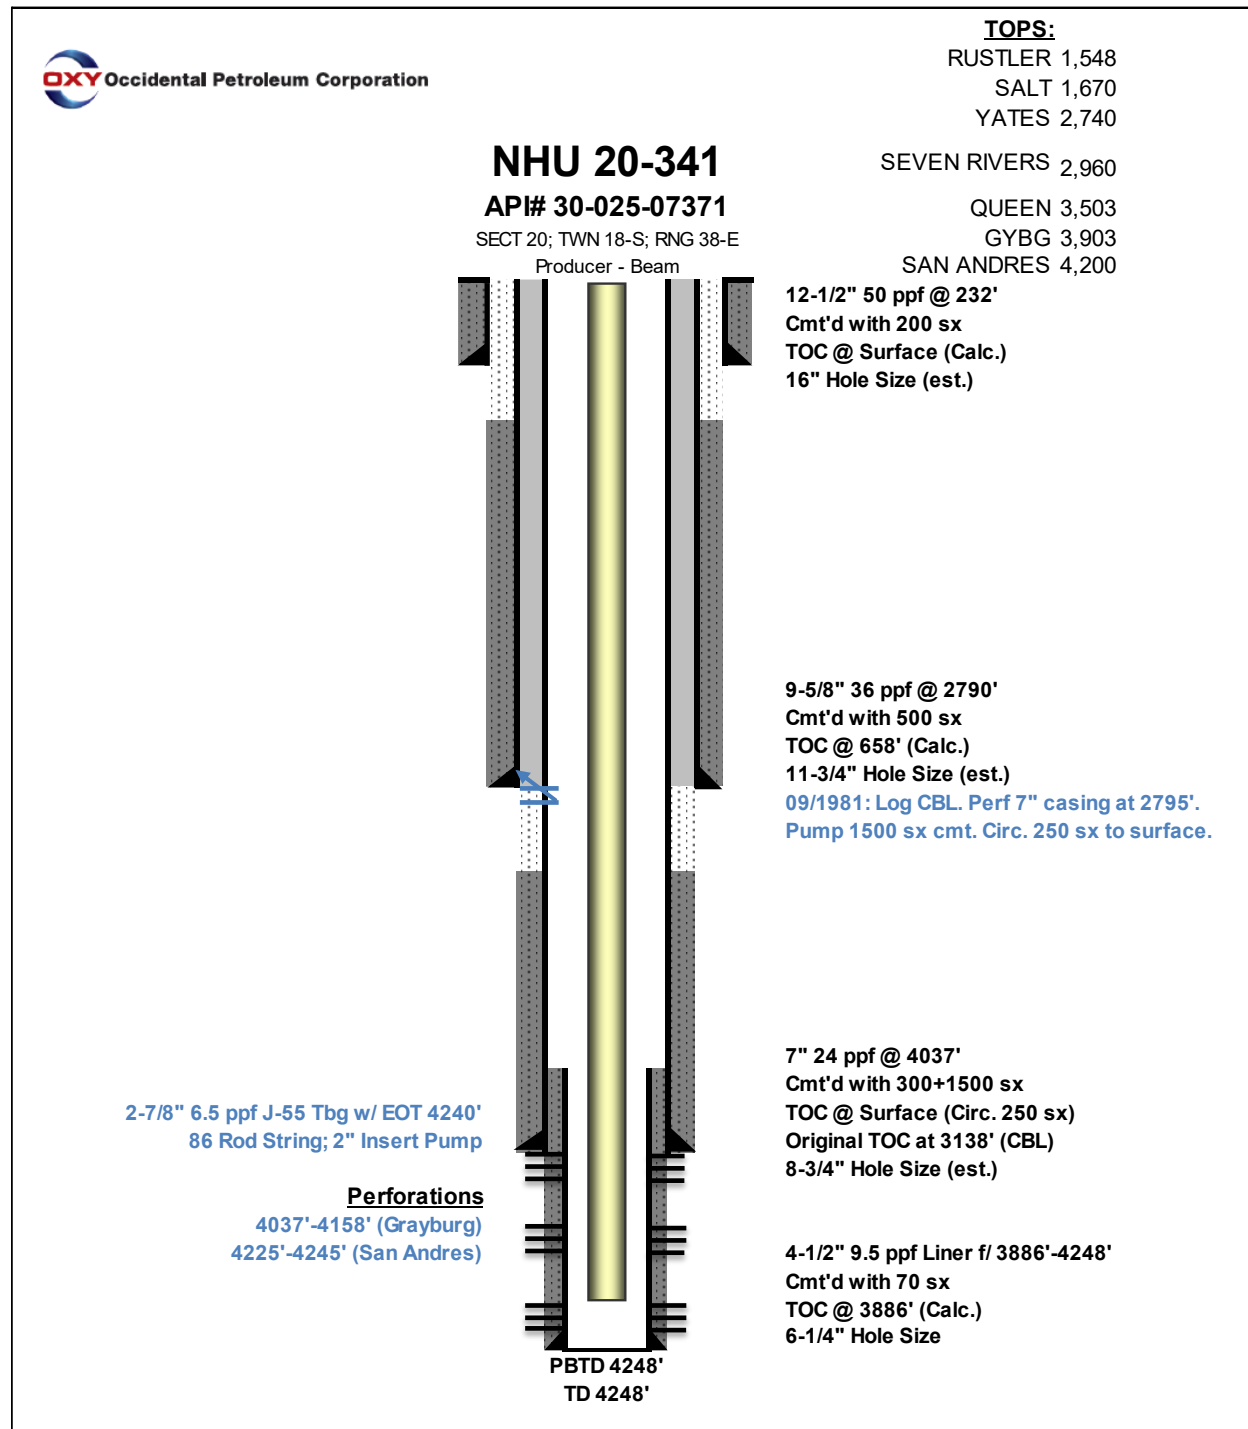

Proposed WBD

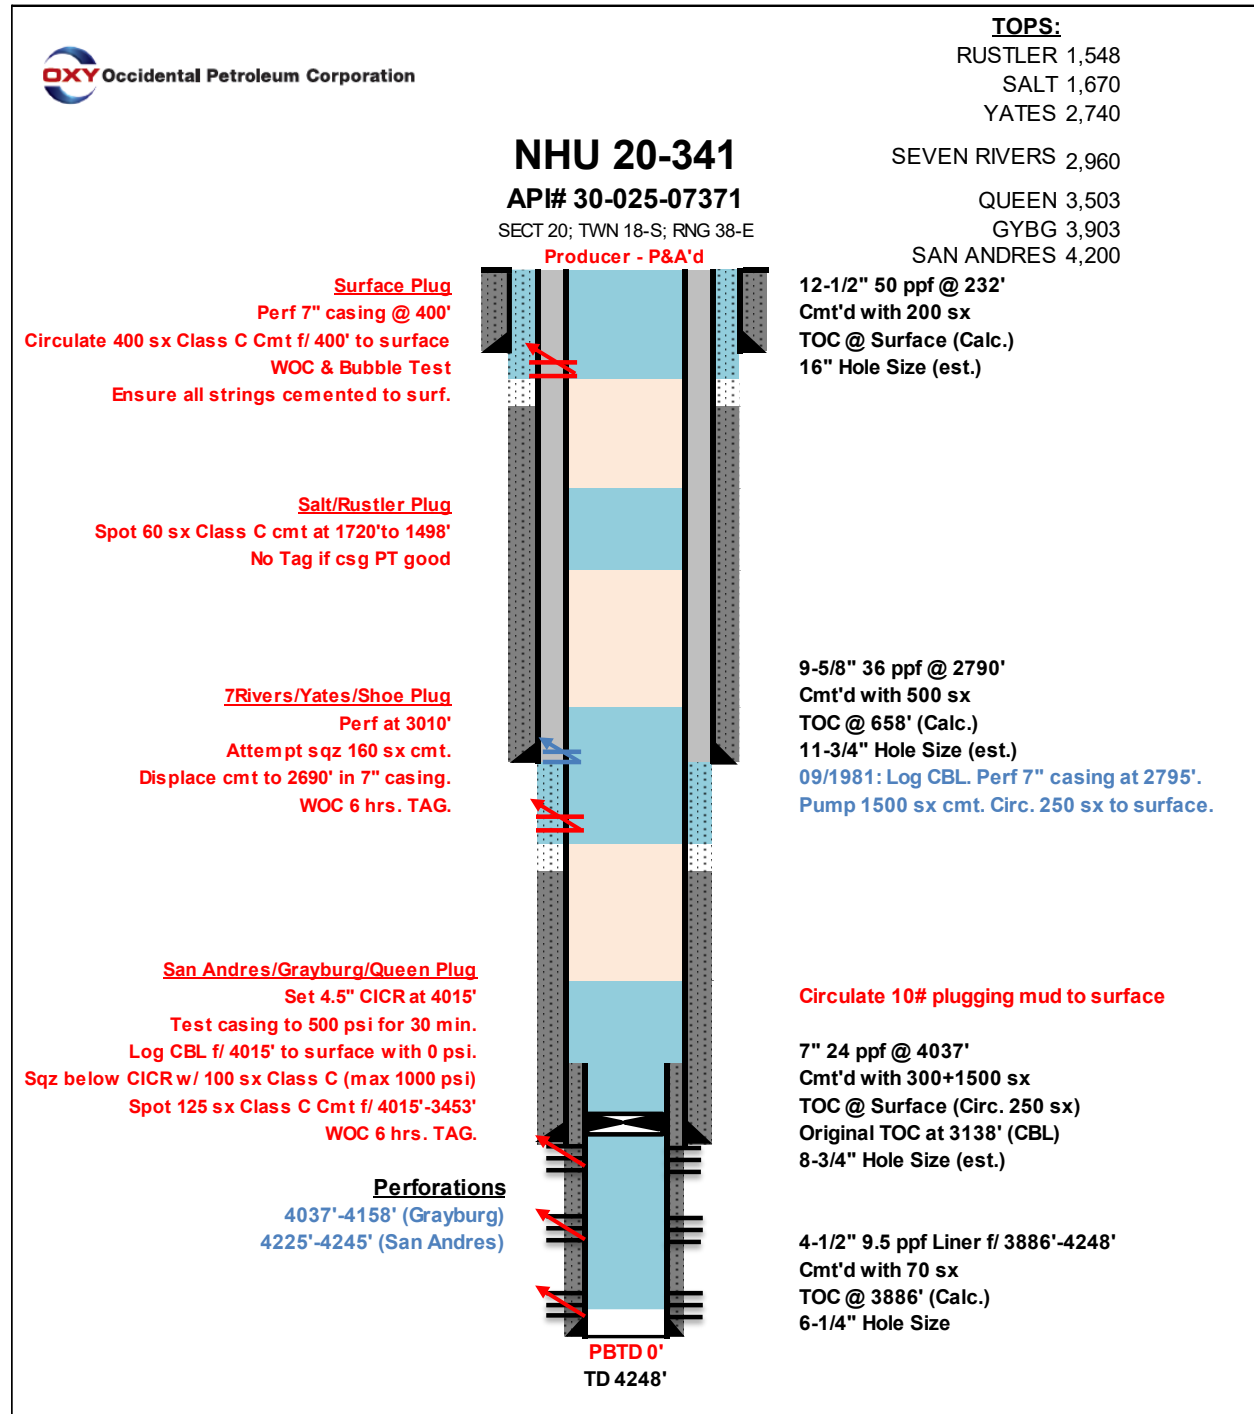

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 555606

CONDITIONS

Operator: OCCIDENTAL PERMIAN LTD P.O. Box 4294 Houston, TX 772104294	OGRID: 157984
	Action Number: 555606
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	Adhere to current Plug & Abandon (P&A) Conditions Of Approvals (COA).	2/26/2026
gcordero	A Cement Bond Log (CBL) is required to be submitted to electronic permitting.	2/26/2026
gcordero	Submit Cement Bond Logs (CBL) prior to submittal of C-103P.	2/26/2026
gcordero	A Casing Inspection Log (CIL) is required to be submitted to electronic permitting	2/26/2026