STATE OF NEW MEXICO ENERGY, MINERALS AND NATURAL RESOURCES DEPARTMENT OIL CONSERVATION DIVISION

APPLICATIONS OF RILEY PERMIAN OPERATING COMPANY, LLC, FOR APPROVAL OF A SALT WATER DISPOSAL WELL, EDDY COUNTY, NEW MEXICO.

CASE NOS. 24279 & 24280

NOTICE OF *REVISED* EXHIBITS

MRC Permian Company, gives notice that it is filing the attached **Revised Exhibits A-1 through A-6** for these cases. The exhibits update the location of the Angel Ranch SWD #1 based on the C-102 provided in Riley Permian's testimony, which is a different location than what was identified in the application for hearing. Exhibit A-4 was also revised to include the density porosity log for each well included in the cross-section. Matador's witness may refer to the density porosity logs in rebuttal testimony.

Respectfully submitted,

HOLLAND & HART LLP

Michael H. Feldewert

Adam G. Rankin

Paula M. Vance

Post Office Box 2208

Santa Fe, New Mexico 87504-2208

(505) 988-4421

(505) 983-6043 Facsimile

mfeldewert@hollandhart.com

agrankin@hollandhart.com

pmvance@hollandhart.com

ATTORNEYS FOR MRC PERMIAN COMPANY

CERTIFICATE OF SERVICE

I hereby certify that on July 22, 2024, I served a copy of the foregoing document to the following counsel of record via Electronic Mail to:

Ernest L. Padilla Padilla Law Firm, P.A. Post Office Box 2523 Santa Fe, New Mexico 87504 (505) 988-7577 padillalawnm@outlook.com

Attorney for Riley Permian Operating, LLC

Dana S. Hardy
Jaclyn M. McLean
HINKLE SHANOR LLP
P.O. Box 2068
Santa Fe, NM 87504-2068
(505) 982-4554
(505) 982-8623 FAX
dhardy@hinklelawfirm.com
jmclean@hinklelawfirm.com

Attorneys for V-F Petroleum, Inc.

Adam G. Rankin

BEFORE THE OIL CONSERVATION DIVISION EXAMINER HEARING JULY 23, 2024

CASE Nos. 24279 & 24280

ANGEL RANCH SWD

EDDY COUNTY, NEW MEXICO



STATE OF NEW MEXICO ENERGY, MINERALS AND NATURAL RESOURCES DEPARTMENT OIL CONSERVATION DIVISION

APPLICATIONS OF RILEY PERMIAN OPERATING COMPANY, LLC, FOR APPROVAL OF A SALT WATER DISPOSAL WELL, EDDY COUNTY, NEW MEXICO.

CASE NOS. 24279-24280

TABLE OF CONTENTS

MRC Exhibit A – Self-Affirmed Statement of Andrew Parker, Senior Vice President of Geosciences

- MRC Exhibit A-1 Locator Map
- MRC Exhibit A-2 Subsea Structure Map Top of Mississippian Lime with fault trace
- MRC Exhibit A-3 Subsea Structure Map Top of Cisco with fault trace
- MRC Exhibit A-4 Structural Cross-Section
- MRC Exhibit A-5 USGS Earthquake Activity and SRAs with fault trace
- MRC Exhibit A-6 UT Bureau of Economic Geology Basement Faults with SRAs

STATE OF NEW MEXICO DEPARTMENT OF ENERGY, MINERALS AND NATURAL RESOURCES OIL CONSERVATION DIVISION

APPLICATION OF RILEY PERMIAN OPERATING COMPANY, LLC, FOR APPROVAL OF A SALT WATER DISPOSAL WELL, EDDY COUNTY, NEW MEXICO.

CASE NO. 24279

APPLICATION OF RILEY PERMIAN OPERATING COMPANY, LLC, FOR APPROVAL OF A SALT WATER DISPOSAL WELL, EDDY COUNTY, NEW MEXICO.

CASE NO. 24280

SELF-AFFIRMED STATEMENT OF ANDREW PARKER, SENIOR VICE PRESIDENT OF GEOSCIENCES

- 1. My name is Andrew Parker, and I am employed by MRC Energy Company, an affiliate of MRC Permian Company and Matador Production Company (collectively, "Matador"), as a Senior Vice President of Geosciences. I have previously testified before the New Mexico Oil Conservation Division as an expert witness in petroleum geology.
- 2. I have reviewed the above-referenced applications filed by Riley Permian Operating Company, LLC ("Riley").
- 3. In Case Number 24279, Riley seeks approval of its Angel Ranch SWD #1, located in Section 12, Township 19 South, Range 27 East, NMPM, Eddy County, New Mexico, with a proposed injection interval listed in the Cisco formation at depts between 8,586' and 9,210.' I understand Riley is requesting average and maximum daily rates of injection of 15,000 BWPD and 20,000 BWPD, respectively, for this proposed SWD.
- 4. In Case Number 24280, Riley seeks approval of its Angel Ranch SWD #2, located in Section 11, Township 19 South, Range 27 East, NMPM, Eddy County, New Mexico, with a proposed injection interval listed in the Cisco formation at depts between 8,450' and 8,975.' I

BEFORE THE OIL CONSERVATION DIVISION
Santa Fe, New Mexico
Exhibit No. A
Submitted by: Matador Production Company
Hearing Date: July 23, 2024
Case Nos. 24279-24280

understand Riley is requesting average and maximum daily rates of injection of 15,000 BWPD and 20,000 BWPD, respectively, for this proposed SWD.

- 5. Matador has objected to both of Riley's proposed SWDs for two primary reasons: (i) Matador is concerned that Riley's proposed SWDs would present a significant risk of negatively impacting (i.e., watering out) the prospective Third Bone Spring target on Matador's adjacent acreage, and (ii) Matador is concerned that Riley's proposed SWDs would lead to an unreasonable increased risk of induced seismicity in this area. Matador's concerns are similar for both of Riley's proposed SWDs, so I will address those concerns for both SWDs below.
- 6. **Matador Exhibit A-1** is a locator map identifying the location of Riley's two proposed SWDs in Sections 11 and 12, Township 19 South, Range 27 East, NMPM, Eddy County, New Mexico. A red box identifies the general area where the two proposed SWDs are located, with the SWD locations identified in small yellow squares.
- of the Mississippi Lime formation. The contour intervals are 50 feet. I have also identified the locations of Riley's proposed Angel Ranch SWD #1 and Angel Ranch SWD #2 SWD with red and orange circles, respectively. The structure map shows the presence of a significant fault in this area, which I have shown using a red line on Exhibit A-2. As reflected on Exhibit A-2, this fault runs close to both of Riley's proposed SWD locations.
- 8. **Matador Exhibit A-3** contains a subsea structure map that I prepared off the top of the Cisco formation. The contour intervals are 50 feet. I have also identified the locations of Riley's proposed Angel Ranch SWD #1 and Angel Ranch SWD #2 SWD with red and orange circles, respectively. Although the fault identified in Exhibit A-2 is basement-rooted and offsets deeper stratigraphy, this structure map confirms the fault-propagated folding of the overlying

Cisco formation, which is the proposed injection interval for both of Riley's proposed SWDs. Fracturing associated with this fault-propagated folding through the Cisco and early Permian strata increases the risk of vertical communication between the water injection interval and the Third Bone Spring reservoir.

9. **Matador Exhibit A-4** is a structural cross-section that I prepared displaying openhole logs run from the five representative wells denoted from A to A' on Exhibit A-2 and Exhibit A-3. The wells in the cross-section contain gamma ray, resistivity, and porosity logs. Highlighted in green is the Third Bone Spring target that Matador intends to be developed on its adjacent acreage in this area. Highlighted in blue is the injection interval that Riley has proposed for its two proposed SWD locations.

Matador's Concerns that Riley's SWDs Could Wash Out the Third Bone Spring Target

- 10. As shown on Exhibit A-4, there is only approximately 400 feet of vertical separation between Riley's proposed SWD injection interval and Matador's Third Bone Spring target it intends to develop using horizontal wells. I do not identify any clear geologic barriers between the proposed injection interval and Matador's horizontal target that would prevent vertical migration of the produced water Riley proposes to inject into its SWDs into the shallower Third Bone Spring.
- 11. For this reason, I am concerned that there is a significant risk that Riley's proposed SWDs and the resultant injection of produced water could cause water to migrate into Matador's Third Bone Spring target and negatively impact the Third Bone Spring target, which would cause more water and less hydrocarbons to be produced from the target and thereby result in waste of the oil and gas present in the target that would not be produced but that otherwise would have.

12. My concerns are further compounded by the presence of the fault identified in MRC Exhibit A-2 and A-3. Due to the fault, the vertical separation between Riley's proposed injection interval and Matador's Third Bone Spring target could be much closer than 400 feet in parts of this area. In addition, the fault could allow for easier flow of water from the injection interval into the Third Bone Spring target, causing the negative impacts described above.

Matador's Concerns that Riley's SWDs Present Induced Seismicity Risk

- 13. **Matador Exhibit A-5** shows recent seismic activity of magnitudes greater than 3.5 to the west of the proposed Angel Ranch SWD wells. The seismic response radii are highlighted in red (3-mile radius), orange (6-mile radius), and yellow (10-mile radius). The Angel Ranch SWD wells both fall within a 10-mile radius of recent activity. At the bottom of Exhibit A-5, moment tensor data from 2 recent events demonstrates that the orientation of failure is roughly southwest to northeast, which is also sub-parallel to the fault orientation mapped in the Angel Ranch SWD area. This demonstrates that the mapped fault orientation is prone to failure in the modern stress environment.
- Matador Exhibit A-6 further supports the statements from paragraph 12 with published basement-rooted faults form the University of Texas Bureau of Economic Geology. Seismic activity west of Angel Ranch is following a significant regional offset in the basement (light blue to darker blue), and the Angel Ranch SWD wells are situated near a well-documented regional basement fault that runs parallel to the offset to the west. These parallel basement-rooted features are similarly stressed and prone to failure. Additional moment tensor data posted on this regional map further demonstrates that faults oriented southwest to northeast (i.e. 35-55 degrees) are prone to failure, regardless of being in a strike-slip, normal or reverse faulting regime.

- Accordingly, based on the fault identified in this area, the direction of the fault, and 15. the previous seismic events in this area, Matador is concerned that the approval of Riley's two applications would lead to additional induced seismicity risk in this area.
- Because there is not a clear, continuous geologic barrier that will effectively contain 16. the proposed injection, and injection into the Cisco formation will water out production in the overlying Third Bone Spring interval, Riley's applications must be denied. The proposed injection will also likely give rise to an unreasonable increased risk for induced seismicity in this area. Approving either application will likely result in waste and impair correlative rights.
- Matador Exhibits A-1 through A-6 were either prepared by me or compiled 17. under my direction and supervision.
- I affirm under penalty of perjury under the laws of the State of New Mexico that 18. the foregoing statements are true and correct. I understand that this self-affirmed statement will be used as written testimony in this case. This statement is made on the date next to my signature below. 7/16/2024 Date

Received by OCD: 7/22/2024 12:06:14 PM

Locator Map

Exhibit A-1

										Lea								
s zie Eddy	175 23E	175 24E	175 250	175 260	175.275	175 285	175 29€	175 306	Abo	Reef	175 33E	175 34E	175 192	175 368	175 37E	175 3.HE .	175 BLK AI 39E3	- -h
5216	185 23E	165 246	105 250	185265	185 27E	185 28E	185 29E	185 30E	185 316	185 326	185 33E	185340	185350	185 368	185 37E	105 308	185 3963	Saine
5.21E	195 23E	1952€	195 256	195 268	195 27E	19, 288	195 295	195 302 Y C	ungest	Goat S	еер	19534E	195356	195,444	195 375	1953HE	1953 3963	-11
					Project	Area			Capitar	Aquife	r						BLKA	
521E	205.238	205 24E	205 256	205 26E	SHITE	205 281	205 29E	205 30€	205 31E	205 325	205 336	205 34E	205 358	205 34E	20537E	205 38E	3943 BLK A3	28
T	20,55	20:55						Y	ounges	t Capita	in						A SERVICE	28
215	215/220	215 236	215 24E	215.250	215 268	215 276	215 285	215 29E	215 30€	215 316	201.321	215338	215 34E	215 356	215 36E	215 37E	4	129 A
21E	235 228	225 236	2524	225-25£	nsad	225 27E	225 745	225 29€	225 30E	225 316	225 32E	225.330	225 34E	225.3%	275 366	225 37E		ndre
21E	235.228	28 28	23524E	235 25E	235 26E	235 27€	235-28E	235 29€	23530€	225531€	235 32E	235 3 M	235 346	235 35£	225340	235 37E	235 38E	
216	245 226	245 231	246 245	245 256	245 26E	245.27E	245 28E	245.29E	245 30E	(245316	:245326	245 1318	24534E	245 35E	245 36E	245 37E	2.6 386	-
215	255 726	258,231	255 248	255 250	255 26E	255 270	255 265	255 29£	255 30E	255 31E	255 125	255 JJE	253 34E	255 35E	235 346	255 171	255 38E BUK /	
TE .	265.628	:265 23E	265 24E	265 258	265 268	265 27E	265 285	100 New Mex	000ftUS	199310	125	265-33E	265 34E	265 351	265 365	265 37E	265	A56
	BUXANTIS	BUNCATAL	8062715	BURATTIS	BLK60T1S	BUNGATU C	Uborcon	Texas	X 8.X36	BUX 55	SUK SA	B.K.71.0	vino succes	DUX CZ4	BLK C23	T SUX	C22 BUX 77	Wii


BEFORE THE OIL CONSERVATION DIVISION

Santa Fe, New Mexico Revised Exhibit No. A-1 Submitted by: Matador Production Company Hearing Date: July 23, 2024 Case Nos. 24279-24280



Subsea Structure Map (Top Miss Lime) A – A' Reference Line

Exhibit A-2

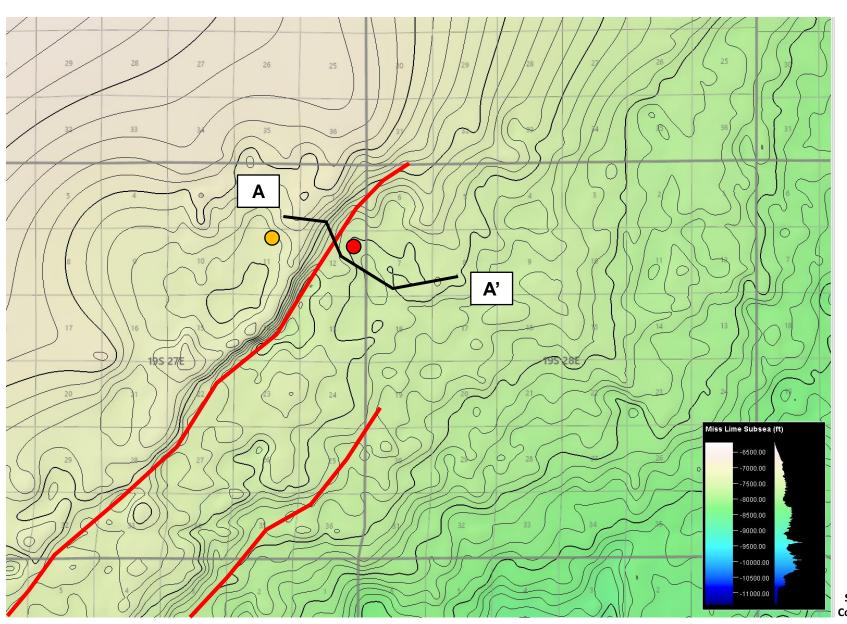

Map Legend

Angel Ranch #1

Angel Ranch #2



Fault Traces




C. I. = 50 ft

BEFORE THE OIL CONSERVATION
DIVISION Santa Fe, New Mexico
Revised Exhibit No. A-2
Submitted by: Matador Production
Company Hearing Date: July 23, 2024
Case Nos. 24279-24280



Subsea Structure Map (Top Cisco) A – A' Reference Line

Exhibit A-3

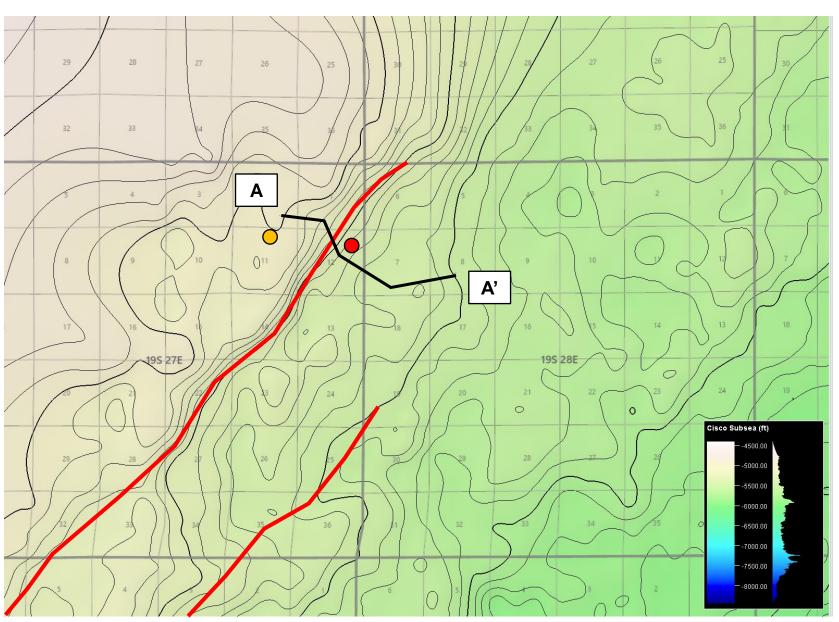

Map Legend

Angel Ranch #1



Angel Ranch #2



Fault Traces




C. I. = 50 ft

Santa Fe, New Mexico
Revised Exhibit No. A-3
Submitted by: Matador Production
Company Hearing Date: July 23, 2024
Case Nos. 24279-24280

Structural Cross-Section A – A'

Exhibit A-4

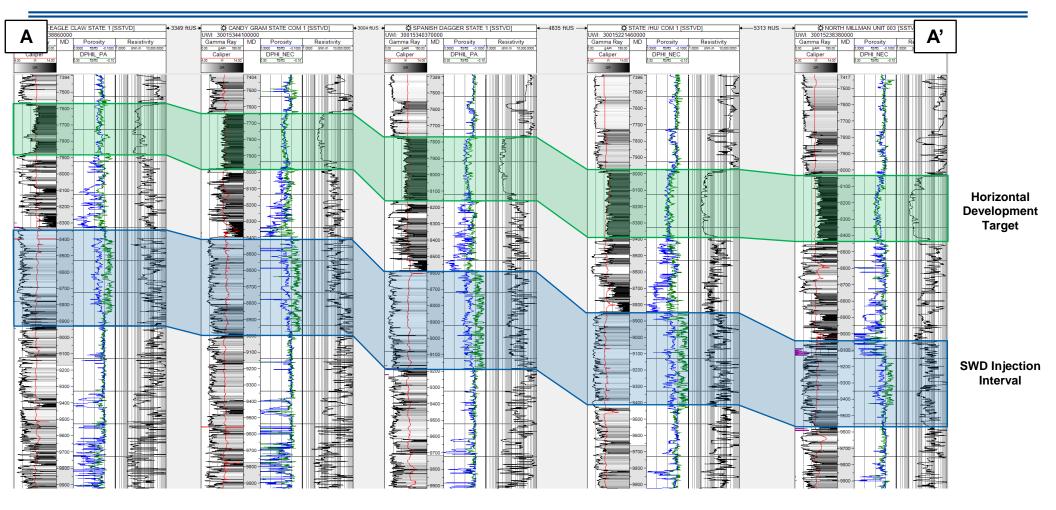


BEFORE THE OIL CONSERVATION DIVISION
Santa Fe, New Mexico
Revised Exhibit No. A-4
Submitted by: Matador Production
Company Hearing Date: July 23, 2024
Case Nos. 24279-24280



USGS Earthquake Activity & Seismic Response Radii

Exhibit A-5

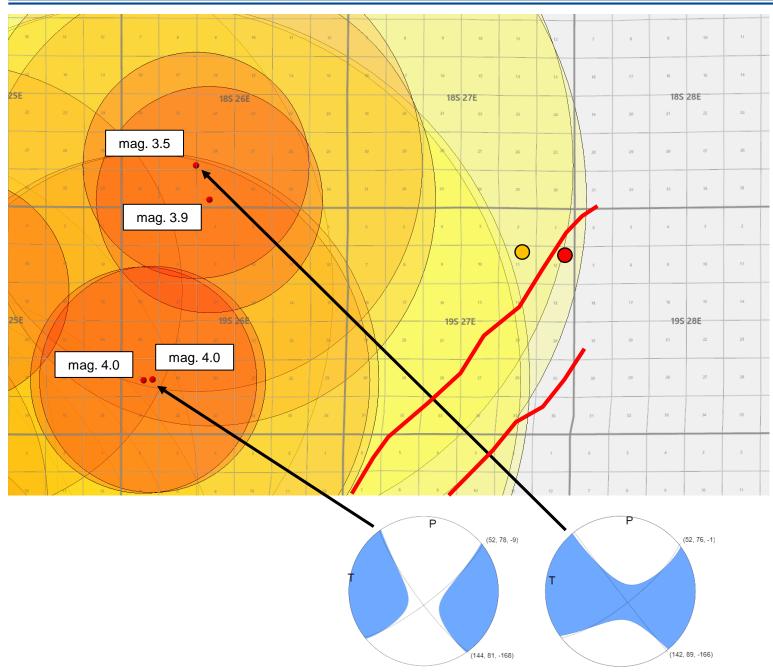

Map Legend

Angel Ranch #1




Angel Ranch #2



Fault Trace



<u>USGS Earthquakes</u> <u>Magnitude 3.5 or greater</u>

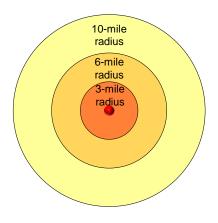

BEFORE THE OIL CONSERVATION DIVISION Santa Fe, New Mexico Revised Exhibit No. A-5 Submitted by: Matador Production Company Hearing Date: July 23, 2024 Case Nos. 24279-24280



BEG Basement Faults with SRA Radii

Exhibit A-6

