BD M-28 EOL 2013

1 :

W 25 25 3

CLOSURE

RICE Operating Company

112 West Taylor • Hobbs, New Mexico 88240 Phone: (575) 393-9174 • Fax: (575) 397-1471

April 1, 2014

Mr. Leonard Lowe

New Mexico Energy, Minerals, & Natural Resources Oil Conservation Division, Environmental Bureau 1220 S. St. Francis Drive Santa Fe, New Mexico 87505

RE: Termination Request

BD M-28 EOL: UL/M, Sec. 28, T22S, R38E

RICE Operating Company – Blinebry-Drinkard SWD System

Mr. Lowe:

Rice Operating Company (ROC) is the service provider (agent) for the BD Saltwater Disposal (SWD) System and has no ownership of any portion of the pipeline, well, or facility. The System is owned by a consortium of oil producers, System Parties, who provide all operating capital on a percentage ownership/usage basis.

Background

In 2013, ROC initiated work on the former BD M-28 EOL junction box. The site is located in UL M, Sec. 28, T22S, R38E. NM OSE records indicate that groundwater would likely be encountered at a depth of approximately 124+/- feet. The site was delineated using a backhoe to form a 20x20x12-ft deep excavation and soil samples were screened at regular intervals for both hydrocarbons and chlorides. The excavated soil was blended on site and representative composite samples of the excavation walls, bottom and blended backfill were sent to a commercial laboratory for analysis of chloride and TPH, resulting in a 4-wall composite of chloride, gasoline range organics (GRO) and diesel range organics (DRO) all below detectable limits. The bottom composite resulted in a chloride concentration of 336 mg/kg and concentrations of GRO and DRO below detectable limits. The remediated backfill resulted in a chloride concentration of 96 mg/kg and concentrations of GRO and DRO below detectable limits. At 12' below ground surface (BGS), a six inch pad was installed at the base of the excavation to protect the liner from punctures. On 10/31/2013, a 20x20 ft 20-mil reinforced liner was installed at 11.5 ft bgs and will provide a barrier that will inhibit the downward migration of chlorides to groundwater. The top of the liner was then padded with 6 inches of imported blow sand. The blended backfill was returned to the excavation and contoured to the

surrounding area. On 11/5/2013, the site was seeded with a blend of native vegetation. A junction box is no longer needed at the site.

The junction box final report, site location map, area map, photo documentation, laboratory analysis, PID sheet, chloride graph, excavation diagram, and revegetation form are attached.

Recommendations

Site investigation demonstrates that residual chloride and hydrocarbons in the vadose zone will not with reasonable probability contaminate groundwater in excess of NMOCD standards. This site meets the requirements of the NMOCD-approved Revised Junction Box Upgrade Work Plan (July 16, 2003). As such, ROC request termination of the regulatory file, or similar closure status.

Please contact me at (575)393-2967 if you have any questions or wish to discuss this site. Thank you for your time and consideration.

Sincerely,

RICE Operating Company

Hack Conder

Environmental Manager

enclosures

RICE OPERATING COMPANY JUNCTION BOX FINAL REPORT

BOX LOCATION

				,	BOX LOCA						
	SWD SYSTEM	JUNCTION	UNIT	SECTION	TOWNSHIP	RANGE	COUN		DIMENSIONS		
	Blinebry-Drinkard	M-28 EOL	M	28	228	38E	Lea	Length	Width 4'	1	epth s'
	(BD)	1VI-20 EUL	IVI	20	223	SOE	Lea	4.5'	Eliminated	1	5'
	<u>,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,</u>		<i>I</i>	L		1		J			
	LAND TYPE: E	BLM	STATE	FEE L	ANDOWNER	D.	K. Boyd	OTHER			
	Depth to Groun	ndwater	124	feet	NMOCD	SITE ASSI	ESSME	NT RANKING S	SCORE:	0	
	Date Started	9/23	/2013	Date C	ompleted	11/5/2013	0	CD Witness	No)	
	Soil Excavated	177.8	cubic ya	rds E	xcavation Le	ngth 20	٧	/idth 20	Depth	12	feet
	Soil Disposed	<u> </u>									***************************************
	Soli Disposed	INOTIE	cubic ya	ras C	nsile raciily		/a	Location	11	1/a	
	AL ANALYTI	CAL DE	CIII TC:	C	-l- D -4-	10/29/201		Causala D	4l-	40	
I 1147-	AL MINAL I II	CAL NE	SULTS.	Samp	ole Date	10/30/20	13	Sample Do	eptn	12	
	Pr	ocure 5-poi	int composit	e sample d	of bottom and	4-point cor	nposite	sample of sidev	valls, TPH		
		-	-	•		•	•	lab and testing			
	arr	a 0111011401	aboratory to		uant to NMO		•	ab and testing	procedures		
				puis	- I I I I I I I I I I I I I I I I I I I	OD galaciii	C3.				
	Sample	PID (fi	eld) G	RO	DRO	Chloride	;	CHLO	RIDE FIELD	TESTS	3
	Location	ppm	n mg	g/kg	mg/kg	mg/kg		LOCATION	DEPTH	ł	mg/kg
4	-WALL COMP.	0.8	<	10	<10	<16		background	12"		140
B	OTTOM COMP.	1.2	<	10	<10	336		4-WALL Comp	n/a		141
BLE	NDED BACKFIL	L 0.0	<	10	<10	96		Bottom Comp	12'		415
						<u> </u>			2'		112
Gener	al Description	of Remedi	al Action:	This junct	ion and line we	ere eliminated	1	Vertical	4'		164
	the pipeline repla			-				delineation	6'		142
	ed, an investigation							trench at 10'	8'	-	199
	intervals, creating							east of the	10'		245
	h sample yielded							junction (source	12'	-	219
	ich also yielded k								12	<u> </u>	213
	presentative com										
							 	ha aamala analu	منام على ممسا	la	
	blended backfill			-							
	trations of each.										
	low the liner. The						· · · · · · · · · · · · · · · · · · ·				
	nding area. On 11	75/2013, the	site was see	ded with a t	piend of native	vegetation a	na is exp	ected to return to	a productive	capac	ity
at a no	rmal rate.										
								ide graph, excavati			
IHE	REBY CERTIF	YIHAIIF	IE INFORM	A HON AE			MPLET	E TO THE BES	STOF MY K	MOM	LEDGE
D	EPORT				AND BEL				Rice Enviro	om onto	l Conquitin
	SEMBLED BY	Laura Flor	es SIG	NATURE 7	XN112B	$\mathcal{A}_{\mathcal{A}}$	1410	COMPAN		Safety	
٨٥٥		Laura i ioi	63 010	MAIGAL	juua		w y		' ——— -	- Caroty	<u> </u>
					•				Rice Enviro	nmenta	l Consultin
SITE SI	JPERVISOR	Dyllan Yarbro	ough SIG	NATURE		lot available		COMPAN	YY	& Safety	/
					1) / .	1			0 -	~	
PROJE	CT LEADER	Kyle Norma	an SIG	NATURE	Kindle A	10-0-		DATE	₌ 3-3:	- 20	14
					10/2	· • •				<u>_</u>	<u> </u>
					g g						


Site Map

			nto Map				
28 WIN	37	26	25	30	29	28	The second
S	EUNICE	37E	36 NM	176 31	21S 38E	33	
4	3	2	1	6	5	4	
9	10		12		8	9	
NW 207	15 22 \$	Drinkard Road	13	18	17 2 2 S 38E	16	
21	22 3	23	24 Viviar	19 	20	21	
28		26	25	30	29 BD-M-20	28 EOL	
33	34	35	36 Source: Esti, D Getmapping, A	31 IgitalGlobe, GeoEye, il- erogrid, IGN, IGP, swis	32 gubed, USDA, USGS, Al stopo, and the GIS User	33 EX, ©ommunity	



BD M-28 EOL

Unit Letter M, Section 28, T22S, R38E, Lea County, NM

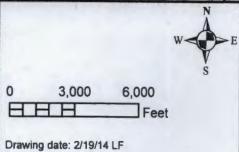


Area Map P 24 225 38E 22S 37E BD M-28 EOL 36 31 Source Earl, Digital Ciries, OsoEys, Louisel, USDA, USOS, SELE Cathologian, Autorith, Ion, 107, avisologo, and the Old Usor Community H




BD M-28 EOL

Unit Letter M, Section 28, T22S, R38E, Lea County, NM

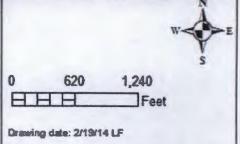


BD M-28 EOL

UL/M Sec.28 (T22S-R38E)

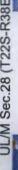



Excavating site, facing west

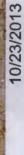



Collecting sample, facing north





Seeding site, facing north

10/29/2013

Completed excavation, facing west

11/5/2013



November 01, 2013

KYLE NORMAN

Rice Operating Company

112 W. Taylor

Hobbs, NM 88240

RE: BD M-28 EOL

Enclosed are the results of analyses for samples received by the laboratory on 10/30/13 16:50.

Cardinal Laboratories is accredited through Texas NELAP under certificate number T104704398-11-3. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accreditated through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2

Haloacetic Acids (HAA-5)

Method EPA 524.2

Total Trihalomethanes (TTHM)

Method EPA 524.4

Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

Celey & Keens

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

Celey D. Keene

Lab Director/Quality Manager



Analytical Results For:

Rice Operating Company KYLE NORMAN 112 W. Taylor Hobbs NM, 88240

Fax To: (575) 397-1471

Received:

10/30/2013

Sampling Date:

10/29/2013

Reported:

11/01/2013

Sampling Type:

Soil

Project Name:

BD M-28 EOL

Sampling Condition:

Cool & Intact

Project Number:

NONE GIVEN

Sample Received By:

Jodi Henson

Project Location:

NOT GIVEN

Sample ID: BOTTOM 5 PT COMP (H302646-01)

Chloride, SM4500Cl-B	mg,	/kg	Analyze	d By: AP					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	336	16.0	10/31/2013	ND	400	100	400	0.00	
TPH 8015M	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	10/31/2013	ND	187	93.6	200	5.36	
DRO >C10-C28	<10.0	10.0	10/31/2013	ND	179	89.7	200	8.06	
Surrogate: 1-Chlorooctane	91.0	% 65.2-14	0						
Surrogate: 1-Chlorooctadecane	94.4	% 63.6-15	4						

Sample ID: 4 WALL COMP (H302646-02)

Chloride, SM4500CI-B	mg	/kg	Analyze	d By: AP					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	<16.0	16.0	10/31/2013	ND	400	100	400	0.00	
TPH 8015M	mg	/kg	Analyze	d By: MS			-		
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	10/31/2013	ND	187	93.6	200	5.36	
DRO >C10-C28	<10.0	10.0	10/31/2013	ND	179	89.7	200	8.06	
Surrogate: 1-Chlorooctane	87.8	% 65.2-14	0						
Surrogate: 1-Chlorooctadecane	93.1	% 63.6-15	4						

Cardinal Laboratories *=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claims to based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This

Celey & Keine

Celey D. Keene, Lab Director/Quality Manager



Notes and Definitions

ND Analyte NOT DETECTED at or above the reporting limit

RPD Relative Percent Difference

** Samples not received at proper temperature of 6°C or below.

*** Insufficient time to reach temperature.

Chloride by SM4500Cl-B does not require samples be received at or below 6°C

Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories *=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any daim ansing, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claims is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celeg & Keine

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

ARDINAL LABORATORIES
101 East Marland, Hobbs, NM 88240 2111 Beechwood, Abilene, TX 79603

FAX (325)673-7020
X (32!
(325) 673-7001
(325)
393-2476
FAX (505)
505) 393-2326
(505)

Company Nan	Company Name: RICE Operating					BIL	BILL TO				¥	ANALYSIS		REQUEST	ST		
Project Manag	Project Manager: Kyle Norman		200		P.O.#:	#;		_		<u> </u>	\vdash	-	_			_	_
Address: 112 W. Taylor	2 W. Taylor			To and the state of the state o	Com	Сотрапу:						SI					
City: Hobbs	State: NM	Zip: 882	38240	the state of the s	Attn:	And the second second control	THE R. P. LEWIS CO., LANSING, S. L. P. L.					JOI					
Phone #:	The state of the s			p product of the Majorana and	Address:	.688;	the second of th					IU/	-10-10-10-1				
Project #:	Project Owner:	e.			City:		energies de la companya del companya de la companya del companya de la companya d	S	M			/ /S					
Project Name:					State:		Zip:	163	91								
Project Location	Project Location: (3) M-28 EOL	Section of Confession	100000000000000000000000000000000000000		Phone #:			oiro	30	(3.	 L S	SC	-				
Sampler Name	Sampler Name: Dyllan Yarbrough				Fax#:	<i>:::</i> :		ŊL	3 F								
FOR LAB USE ONLY				MATRIX	<u>d</u>	PRESERV	SAMPLING		łc	-		-					
Lab I.D. (Sample I.D.	G)RAB OR (C)OMP.	RECOUNDWATER	SOIL SOIL	SLUDGE SHER: SEARAIDA	CE / COOL	DATE TIME	:	1 T	radar avit - 10 Atro- A-santa Atlant bert van rappassa		Complet				er den VIII der en sekret skrivet en skrivet	
	36762 507 Carrier					-	~		1	T	-	\vdash	_		-	-	-
7	4 Lall Chaps 51th	()			14:304004.		27. H 17/8/01	\	\		Maria de la companio del companio de la companio de la companio del companio de la companio della companio della companio de la companio della companio dell					And the second s	
		The same of the sa			mater por ma												
											-	With the Right	-	d at the second second		110	
eresse residen vanerressenske man verke i til sterre	THE STATE OF THE S						The second state of the se									10.00	
MARKET SEC. 10 TOTAL STORY, Mr Morrows Control Section Section 20.	many division and extension and and extension of the second extension of the s	many, on			The same of the sa		Marine commence (MARINES) — marines (MARINES) (MARINES)										
		1		er.	1			-		1	1	-	4		-	-	

PLEABE NOTE. Leabily and Damayae. Cardinal's backey and Lavis sestable remody for any claim arturny whether based in contract or fort. Just he invoted to he amount paid by the chain for the services and the leaves much arturnly for service and the constitution of the application are applicated in the application of the application of

Phone Result: C Yes C No Add'l Phone #: Fax Result: C Yes C No Add'l Fax #: REMARKS: \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	email results (SM) (Sm. knorman@rice.ecs.com.	Lpena@riceswd.com;dyarbrough@rice-ecs.com;
Received By: Ap MABM	pceived By:	Sample Condition CHECKED BY: Cool Intact United (Diffes) No II No
Inquished By	nauished By:	Delivered By: (Circle One) Sampler - UPS - Bus - Other:

† Cardinal cannot accept verbal changes. Please fax written changes to 505-393-2176

RICE ENVIRONMENTAL CONSULTING & SAFETY

122 West Taylor Hobbs, NM 88240 PHONE: (505) 393-9174 FAX: (505) 397-1471 PID METER CALIBRATION & FIELD REPORT FORM

CK. MODEL: PGM 7300 MODEL: PGM 7300 NO. X MODEL: PGM 7320 MODEL: PGM 7300	SERIAL SERIAL	NO: 590-000508 NO: 590-000504 NO: 592-903318 NO: 590-000183		
GAS COMPOSITION	ON: ISOBUTY	LENE 100PPM / AIR:	BALANCE	
LOT NO: HAL-248-100-1	-	EXPIRATION DATE	: 7/1/2015	
MET		G ACCURACY: 100 CY:+/-2%		
	ACCORAC	C1 . 1/- Z/0		
	CO	MPANY		
	RICE	OPERATING		
SYSTEM JUNCTION	UNIT	SECTION	TOWN SHIP	RANGE
BD M-28 EOL	М	28	T22S	R38E
SAMPLE ID	PID	SA	MPLE ID	PID
4-WALL COMPOSITE	0.8			
BOTTOM COMPOSITE	1.2			

I verify that I have calibrated the above instrument in accordance to the manufacture operation manual.

SIGNATURE: Not available	DATE:	10/29/2013
--------------------------	-------	------------



November 01, 2013

KYLE NORMAN

Rice Operating Company

112 W. Taylor

Hobbs, NM 88240

RE: BD M-28 EOL

Enclosed are the results of analyses for samples received by the laboratory on 10/31/13 14:04.

Cardinal Laboratories is accredited through Texas NELAP under certificate number T104704398-11-3. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tcaq.taxns.gov/field/ga/lab-accred-certif.html.

Cardinal Laboratories is accreditated through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2

Haloacetic Acids (HAA-5)

Method EPA 524.2

Total Trihalomethanes (TTHM)

Method EPA 524.4

Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

Celeg & Keine

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

Celey D. Keene

Lab Director/Quality Manager



Analytical Results For:

Rice Operating Company KYLE NORMAN 112 W. Taylor Hobbs NM, 88240

Fax To:

(575) 397-1471

Received:

10/31/2013

Reported:

11/01/2013 BD M-28 EOL

Project Name: Project Number:

NONE GIVEN

Project Location:

NOT GIVEN

Sampling Date:

10/30/2013

Sampling Type:

Soil

Sampling Condition:

Cool & Intact

Sample Received By:

Jodi Henson

Sample ID: BLENDED BACKFILL (H302659-01)

Chloride, SM4500CI-B	mg	/kg	Analyze	d By: AP					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	96.0	16.0	10/31/2013	ND	416	104	400	3.92	
TPH 8015M	mg	/kg	Analyze	d By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True V alue QC	RPD	Qualifier
GRO C6-C10	<10.0	10.0	11/01/2013	ND	185	92.5	200	0.526	
DRO >C10-C28	<10.0	10.0	11/01/2013	ND	174	87.0	200	2.20	
Surrogate: 1-Chlorooctane	85.5	% 65.2-14	0						1.11 2 11 2 11 2
Surrogate: 1-Chlorooctadecane	91.1	% 63.6-15	4						

Cardinal Laboratories *=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shalf not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene



Notes and Definitions

ND Analyte NOT DETECTED at or above the reporting limit

RPD Relative Percent Difference

** Samples not received at proper temperature of 6°C or below.

*** Insufficient time to reach temperature.

- Chloride by SM4500CI-B does not require samples be received at or below 6°C

Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories *=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

A ARDINAL LABORATORIES

)	101 East Marland, Hobbs, NM 88240) 2111 Beechwood, Abilene, TX 79603	od, Abilen	e, TX 79603								
	(505) 393-2326 FAX (505) 393-2476	325) 673-7001 FAX (325)673-7020	FAX (325)	673-7020								
Company Nam	Company Name: RICE Operating			BULLIO	200 miles			AN	ANALYSIS	SRE	REQUEST	-
Project Manage	Project Manager: Kyle Norman		P.O. #:	-								
Address: 112 W. Taylor	W. Taylor		Сотрапу:	ıy:				SI	<u></u>			
city: Hobbs	State: NM Zip	Zip: 88240	Aftn:					uO	10			
Phone #:	Fax#:		Address:					u/	113			
Project#:	Project Owner:		City:			M	- 1		110			
Project Name:			State:	Zip:								
Project Locatio	Project Location: BM M.28 50L		Phone #:		oirc	08	(3 ₋	r s oite	DE			
Sampler Name	Sampler Name: Dyllan Yarbrough		Fax #:									
FOR LAB USE ONLY		MATRIX	K PRESERV.	ERV. SAMPLING								
Lab I.D. H <i>%0205</i> 9	Sample I.D.	# CONTAINERS GROUNDWATER WASTEWATER SOIL	ICE COOF OTHER: STUDGE	OTHER:		<u></u>		Comple	olduloo			
_	D 1 1 1 1 1 1 1 1 1			18/50/12 11:25		7	_		_		_	

10150/13 41:35

PLEASE NOTE: Liability and Clamages. Cardinal's liability and dent's exclasive remay for any claim artialing whether besed in contract or brit, shall be limited to the amount paid by the clean for the supplicable analyses. At claims including those for negligence and any other cause whatesoever shall be deemed we'ved unless made in writing and received by Cardinal Wishin 30 days after completion of the applicable service. Any creates that Cardinal be labely for independent consequented defining with a formation of the consequented defining which the standard as a formation of the cardinal resort design of the cardinal resort design of the cardinal resort design of the cardinal resort of the cardinal resort design of the cardinal resort of the cardinal resort design of the cardinal resort of the cardinal resort design of the cardinal resort design of the cardinal resort of the cardinal reso

affiliates or subpossors arism.	iffinities or subcessors arising out of or refated to the performance of services hereunder by Cardinal, regard	of services hereunder by C.	ardinal, regardless of whether such claim is based upon any of the above stated reasons of otherwise.	d upon any or the above stated rea	SOUS OF OTHERWISE.	-		
Relinguished By	7.	Date:	Received By:		Phone Result: Yes No Add'l Phone #:	☐ Yes ☑	No A	dd'i Phone #:
1 1		16/3/ /13	101		Fax Result:	☐ Yes ☑	No A	dd'i Fax #:
了 ·		Time ou	ald senson	MAN	REMARKS:			
Relinquished By		Date:	Regelved By:	:	email results	lts	Y	Y WAY Y
-		Time:			knorman@	rice-ec	s.com,	knorman@rice-ecs.com;hconder@rice-ecs.com;
-					I wainhaim	or Orice	J SOC C	weinheimer@rice-ece com. kionee@riceswd com.
Delivered By: (Circle One)	(Circle One)		Sample Condition	снескер ву:	LWGIIII IGIIII			colli, njolica (cliccawa, colli,
Sampler - UPS	Sampler - UPS - Bus - Other:		Cool Intact	A STATE OF THE PARTY OF THE PAR	Lpena@ric	eswd.c	om;dy	Lpena@riceswd.com;dyarbrough@rice-ecs.com
			No					

† Cardinal cannot accept verbal changes. Please fax written changes to 505-393-2415

RICE ENVIRONMENTAL CONSULTING & SAFETY

122 West Taylor Hobbs, NM 88240 PHONE: (505) 393-9174 FAX: (505) 397-1471 PID METER CALIBRATION & FIELD REPORT FORM


CK. MODEL NO.	X	MODEL: PGM 7300 MODEL: PGM 7300 MODEL: PGM 7320 MODEL: PGM 7300	SERIAL SERIAL	NO: 590-000508 NO: 590-000504 NO: 592-903318 NO: 590-000183							
		GAS COMPOSITION	ON: ISOBUTY	LENE 100PPM / AIR:	BALANCE						
LOT NO: HA	L-248-	100-1		EXPIRATION DATE	7/1/2015						
	LOT NO: HAL-248-100-1 EXPIRATION DATE: 7/1/2015 METER READING ACCURACY: 100										
			ACCURAC	CY: +/- 2%							
			CO	MPANY							
			RICE	OPERATING							
SYSTI	EM	JUNCTION	UNIT	SECTION	TOWN SHIP	RANGE					
BD		M-28 EOL	M	28	T22S	R38E					
	SA	MPLE ID	PID	SA	MPLE ID	PID					
В	LENDE	ED BACKFILL	0								
	I vei	rify that I have calibrated th	e above instrum	nent in accordance to the	e manufacture operation manu	L ual.					

Not available

SIGNATURE: ____

DATE: 10/30/2013

Excavation Cross-Section

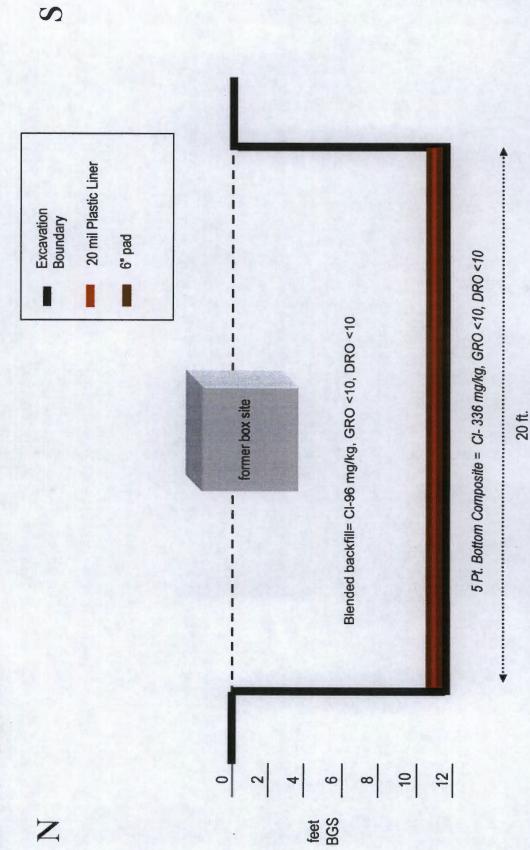


BD M-28 EOL Unit 'M', Sec. 28, T22S, R38E

Backhoe samples at 10' east of of the junction (source)

[CI] ppm	112	164	142	199	245	516
Depth bgs (ft)	2	4	9	8	10	12



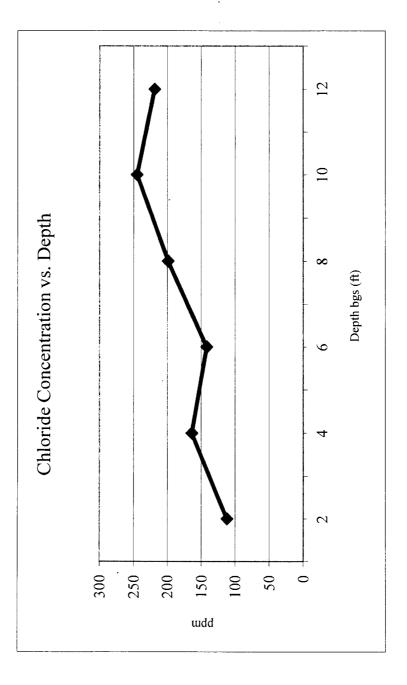



PO Box 5630 Hobbs, NM 88241 Phone: (575) 393-4411 Fax: (575) 393-0293

1	Canana	Infa	uma	+: ~ +	

Site name:	BD M-28 EOL					
U/L	Section	Township	Range	County	Latitude	Longitude
M	28	T22S	R38E	Lea	32.35782 N	103.07270 W
Contact Name:	Hack Conder	<u> </u>				
Email:	hconder@rice-ecs.com					
Site size:						
						

VEGETATION FORM

M		28	1	T22S	F	R38E]	Lea 32.35	782 N	103.07270 W	
Contact Name: Hack Conder											
Email: heor	ider@	rice-ecs.com									
Site size:											
2. Soils		*Da	not r	ip caliche subsoi	ls; calich	e rocks broug	ht to the	surface by ripping sha	ıll be remo	ved.	
Salvaged from site		Bioremediated		Imported		X Blend	led	Depth (in)		
Texture:	Red	Sand		Desc	ribe soil	& subsoil:	Light red	dish sand			
Soil prep methods:	1	Rip X	T	Depth (in)			Disc	Depth (in		Rollerpack	
Date completed:		11/5/2013						4			
		7-4.7 4	<u> </u>	Hay							
3. Bioremediation											
Fertilizer			<u> </u>	Hay				Other		X	
Туре:				1				1	gs RestorN	Hance, 6 Bgs Potting	
Lbs/acre:								Mix, 2 Bgs Manure			
4. Seeding		·		his form. Seed bo					<u>.</u>		
Custom Seed Mix	m Seed Mix X Prescribed Mix		(Seed Mix	5 lbs Lea County Mix, 5 lbs Blu and 10 lbs Winter Rye		,	Date:	11/5/2013		
Broadcast mec	al	Method:			pus	h seeder	1				
Soil conditions durin	g see	d: Dry	Х	Damp	Wet		•				
Observations:			aked t	thoroughly into s	oil			······································			
5. Certification	I he	reby certify that	the int	formation in this	form and	attachments	is true an	d complete to the best	of my kno	wledge and belief.	

5. Cer	tification	I hereby certify that	he information in this form	n and attachments is true and com	nplete to the best of my know	vledge and belief.
Name:	Dyllan Ya	rbrough	Title:	Environmental Tech	Date:	11/5/2013
Signature	2:			Not available		

RICE Operating Company

122 West Taylor • Hobbs, New Mexico 88240 Phone: (575) 393-9174 • Fax: (575) 397-1471

April 1, 2014

Mr. Leonard Lowe New Mexico Energy, Minerals, & Natural Resources Oil Conservation Division, Environmental Bureau 1220 S. St. Francis Drive Santa Fe, New Mexico 87505

RE: JUNCTION BOX UPGRADE REPORT for 2013

BD SWD SYSTEM Lea County, New Mexico

Mr. Lowe:

Rice Operating Company (ROC) takes this opportunity to submit the Junction Box Upgrade results for the year 2013. Enclosed is a list of the completed junction boxes and their respective closure/disclosure dates. These boxes are located in the Blinebry-Drinkard (BD) Salt Water Disposal (SWD) System located in the vicinity of Eunice, New Mexico.

ROC completed 12 junction boxes in 2013. Junction box upgrades in 2014 will be conducted in conjunction with scheduled pipeline replacements.

Enclosed are the 2008 results (17 sites evaluated with 22 sampling locations) from the PID/BTEX study described in the NMOCD-approved Revised Junction Box Upgrade Work Plan (July 16, 2003). A third-party analysis, conducted by Peter Galusky, Jr. Ph.D. of Texerra, concluded from the data collected thus far that field-composited values tend to produce slightly higher BTEX numbers above the point at which BTEX concentrations become significant. This is likely due to the fact that BTEX is volatile and quickly biodegradable. This analysis was submitted to NMOCD on March 12, 2009. An appropriate number of sample sites could not be obtained to conduct a 2013 BTEX comparison analysis. Peter Galusky, Jr. Ph.D. of Texerra also compared ROC's 2013 chloride field tests to chloride laboratory analyses; the analysis is also enclosed. The study of this data continues to validate the accuracy of the chloride field tests employed by ROC.

ROC is the service provider (agent) for the BD SWD System and has no ownership of any portion of the pipeline, well, or facility. The System is owned by a consortium of oil producers, System Parties, who provide all operating capital on a percentage ownership/usage basis.

Replacement/closure projects of this magnitude require System Party AFE approval and work begins as funds are received.

Thank you for your consideration of this Junction Box Upgrade Report for 2013.

RICE OPERATING COMPANY

Hack Conder

Environmental Manager

enclosures as stated

cc: SC, file, Mr. Geoffrey Leking

NMOCD, District I Office 1625 N. French Drive Hobbs, NM 88240 Rice Operating Company BD SWD System Junction Box Upgrade Project 2013 Completed Boxes

		Leg	al De	scrip	ion			a see a see a	
	Jet Box Name	Unit	Sec	T	ĸ	Completion Date	OCD Assessment Score	Report Status	Case Number
1	G-29 EOL	G	29	225	38E	1/7/2014	0	Disclosure	
2	Jct. G-31	G	31	225	38E	1/7/2014	20	Disclosure	
3	JCT. M-29	М	29	22S	38E	11/1/2013	0	Disclosure	
4	JCT. N-29	N	29	225	38E	9/11/2013	0	Disclosure	
5	JCT. N-30	N	30	225	38E	8/19/2013	10	Disclosure	
6	O-29-1 VENT	0	29	22S	38E	7/26/2013	0	Disclosure	
7	O-30 VENT	0	30	225	38E	11/6/2013	10	Disclosure	
8	Jct. P-14	Р	14	22S	37E	8/21/2012	10	Disclosure	
9	J-29 Vent	J	29	225	38E	n/a	0	Closure	
10	J-30 EOL	J	30	225	38E	10/22/2013	10	Closure	
11	JCT. J-29	J	29	22\$	38E	n/a	0	Closure	
12	M-28 EOL.	М	28	225	38E	11/5/2013	0	Closure	

L. Peter Galusky, Jr. Ph.D., P.G.

Texerra

505 N Big Spring, Suite 404 Midland, Texas 79701 Tel: 432-634-9257 E-mail: lpg@texerra.com

March 10th, 2009

Mr. Brad Jones New Mexico Energy, Minerals, & Natural Resources Oil Conservation Division, Environmental Bureau 1220 S. St. Francis Drive Santa Fe, New Mexico 87504

Re: Comparison of Field versus Lab Compositing of BTEX soil samples

Rice Operating Company, Junction Box Upgrade Work Plan

Sent via Certified Mail w/ Return Receipt No. 7006 0100 0001 2438 3944

Dear Mr. Jones:

On behalf of Rice Operating Company (ROC) I am submitting the attached comparison and analysis of field versus laboratory soil compositing for soil BTEX samples. This is to address the question of whether it is better to mix multiple samples in the field or to do so in the laboratory in order to produce a composite, representative sample for analysis. This work was undertaken in support of ROC's Junction Box Upgrade Work Plan to ensure the quality of their field analysis program.

In brief, this work indicates that field compositing of soil samples generally gives rise to *slightly* higher BTEX values than does laboratory compositing of multiple samples. This is presumably due to the likelihood that field compositing and packaging of soil samples better preserves sample integrity. It would therefore appear that field compositing would represent the better method of procuring soil samples for subsequent analysis of BTEX.

Please call me if you have any questions or wish to discuss any of the details of this study.

ROC is the service provider (agent) for various Salt Water Disposal Systems (SWDs) and has no ownership of any portion of pipeline, well or facility. The SWD Systems that ROC operates are owned by a consortium of oil producers, System Partners, who provide all operating capital on a percentage ownership/usage basis.

Sincerely,

L. Peter Galusky, Jr. Ph.D.

Principal

Copy: Rice Operating Company,

Edward Hansen (NMOCD) sent certified mail w/ return receipt

No. 7006 0100 0001 2438 3937

Attachment: As noted, above.

Rice Operating Company Comparison of Field Compositing versus Laboratory Compositing of Soil BTEX Samples¹

The careful mixing of multiple soil samples is critical in order to produce a representative, composite sample from a respective study area (such as a excavation face or bottom). Field technicians typically take four or five "grab" samples from excavation walls and/or bottom and send each of these to a laboratory for analysis of the composite, or mixed, sample. It would be far simpler, however, to composite such samples in the field. This study was undertaken to determine if field compositing produced results substantially different than laboratory compositing for the analysis of BTEX. Data were provided by Rice Operating Company encompassing 22 sampling locations over the period of 2004 through 2008.

A comparison of lab-composited soil samples versus field-composited soil samples revealed a close correspondence for total BTEX between the two methods (Figure 1).

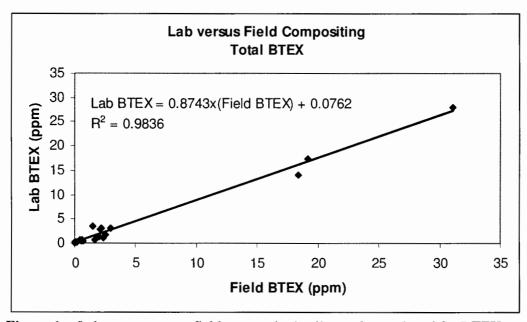


Figure 1 - Laboratory versus field-composited soil samples analyzed for BTEX.

The high R² value (0.9836) of the best-fit statistical regression line indicates a high degree of reliability in using the field-compositing method over the range of values observed. Below a "field-composited BTEX" value of 0.61 ppm the "lab-composited BTEX" values are slightly lower. However, above a field-composited BTEX value of 0.61 the lab-composited values run slightly lower. In other words, the field-composited values tended to produce slightly higher BTEX numbers above the point at which BTEX concentrations become significant.

There is a reason for this. BTEX is volatile and quickly biodegradable. The compositing and "packaging" of soil samples in the field minimize the handling and aeration that occur in the laboratory. Thus, field-composited soil samples lose less BTEX to evaporation and/or biodegradation prior to laboratory analysis. In other words, the field compositing and packaging of soil samples better preserves sample integrity, and for this reasons would appear to represent the better method of procuring soil samples for subsequent analysis of BTEX.

-

¹ Prepared 03-12-09 by L. Peter Galusky, Jr. of Texerra.

L. Peter Galusky, Jr. Ph.D., P.G.

Texerra LLC

20055 Laredo Lane Monument, CO 80132 Tel: 719-339-6791 E-mail: lpg@texerra.com

March 25th, 2014

Mr. Leonard Lowe New Mexico Energy, Minerals, & Natural Resources Oil Conservation Division, Environmental Bureau 1220 S. St. Francis Drive Santa Fe, New Mexico 87505

Re: Comparison of 2013 Laboratory versus Field Measured Soil Chloride Values

Rice Operating Company, Junction Box Upgrade Work Plan

Mr. Lowe:

The attached comparison and analysis of 2013 laboratory versus field measured soil chloride values is submitted in support of Rice Operating Company's (ROC's) Junction Box Upgrade Work Plan to ensure the quality of their field analysis program.

In brief, this work indicates that Rice's 2013 field chloride measurement efforts provided a reasonable qualitative approximation of the laboratory-measured (and presumed true) values.

ROC is the service provider (agent) for various Salt Water Disposal Systems (SWDs) and has no ownership of any portion of pipeline, well or facility. The SWD Systems that ROC operates are owned by a consortium of oil producers, System Parties, who provide all operating capital on a percentage ownership/usage basis.

Please call me if you have any questions or wish to discuss this study.

Sincerely,

L. Peter Galusky, Jr. Ph.D.

Principal

Copy: Glenn VonGonten, NMOCD; Rice Operating Company

Attachment: As noted, above.

Rice Operating Company Comparison of Laboratory to Field Measured Soil Chloride Concentrations Based upon 2013 Field Data

A representative sample of 29 pairs of laboratory versus field measured soil chloride values was compared to determine how well field measurements matched laboratory measurements. It is assumed that laboratory measurements better represent the "true" values due to the controlled environment that a laboratory provides. A simple plot of the laboratory versus field measured soil chloride values is given below (Figure 1).

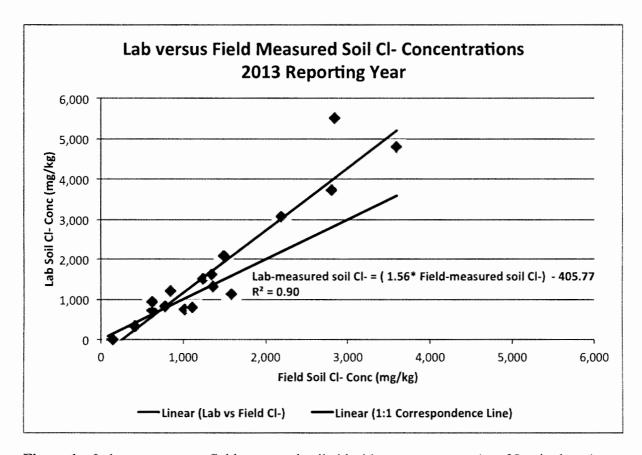


Figure 1 – Laboratory versus field measured soil chloride measurements (n = 29 paired sets).

A straight line fit to the data confirms a general linear trend over a wide range of soil chloride concentrations, and the R² value (0.90) indicates that field measurements provide a reliable approximation of laboratory-measured values. Based on the best-fit line of lab vs field measured values, field measured values overestimate lab measure values below a field measured value of 723 mg/kg and above this underestimate the lab-measured values. This is indicated in the graph where the (blue) best-fit line of lab vs field measured chlorides crosses the (black) line which would indicate a 1:1 correspondence.

Texerra LLC 2