

District I – (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II – (575) 748-1283
811 S. First St., Artesia, NM 88210
District III – (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV – (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Record Clean Up

<p>SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)</p>		<p>WELL API NO. 30-015-22307</p>
<p>1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other <input type="checkbox"/></p>		<p>5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/></p>
<p>2. Name of Operator Devon Energy Production Co., LP</p>		<p>6. State Oil & Gas Lease No.</p>
<p>3. Address of Operator 333 W. Sheridan Avenue, Oklahoma City, OK 73102</p>		<p>7. Lease Name or Unit Agreement Name Bogle State Com</p>
<p>4. Well Location Unit Letter _____ : 2560 feet from the North line and 660 feet from the East line Section 2 Township 16S Range 27E NMPM Eddy County</p>		<p>8. Well Number 1H</p>
<p>11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3578' GL</p>		<p>9. OGRID Number 6137</p>
<p>12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data</p>		<p>10. Pool name or Wildcat Diamond Mound; Upper Penn (G)</p>

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:


REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: Add Pay ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work).
SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

11/9/06 – RU UNIT. TST 4 ½ CSG. REL PAC. SWABBED TO 3000'
11/10/06 – SWABBED TO 7600' REL PAC. TOOH W/PAC
11/13/06 – SET PAC @ 20'. SET RBP @ 7884'. TOOH W/ PAC'. PT TUB TO 2000 PSI – OK
11/14/06 – TST 4 ½ CSG TO 1500 PSI. TIH W/ TUB TO 7700'. 2 SX SD ON RBP
11/15/06 – TOOH W/ TUB. PERF WOLF CAMP 4 SPF 60 DEG PHASE AT 6512'-6516'. RDWL. 1. 6' TUB SUB W/RE-ENTRY.
EOT AT 6542.04'. ND BOP. NU TREE.
11/16/06 – ACIDIZED WOLF CAMP PERFS W/ 1000 GAL 15% HCL ACID. SWABBED BACK
11/17/06 – 2 SWAB RUNS. NO FLUID. REL PAC. PULLED PAC. TIH TO 6000' W/RET TOOL
11/20/06 – WASHED SD OFF RBP. SWABBED TO 7000'
11/21/06 – TOOH W/ RBP. TIH W/PAC & TUB. SWABBED DRY
11/22/06 – SWAB RUN. NO FLUID. SI RD UNIT
11/27/06 – 2 SWAB RUN. NO FLUID. SLIGHT GAS. RD. TURNED DOWN LINE.

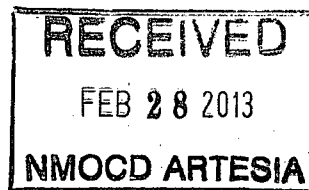

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Melanie Crawford TITLE Regulatory Analyst DATE 2/27/13
Type or print name: Melanie Crawford E-mail address: melanie.crawford@dmn.com PHONE: _____

For State Use Only
APPROVED BY: SR Dade TITLE Dist # Spewison DATE 3/1/13
Conditions of Approval (if any): _____