
t Submit 1 Copy To Appropriate District	State - ENI-			$E_{a} = C_{102}$
Office	State of New Me , Minerals and Natu		Rev	Form C-103 ised August 1, 2011
1625 N. French Dr., Hobbs, NM 88240	, minorars and mara		WELL API NO.	
511 5. That St., Fittesia, 1441 00210	CONSERVATION		30-015-20360 5. Indicate Type of Lease	
District III – (505) 334-6178 1 1000 Rio Brazos Rd., Aztec, NM 87410	220 South St. Fran		STATE	FEE 🛛
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Santa Fe, NM 87	303	6. State Oil & Gas Lease	No.
87505 SUNDRY NOTICES AND R (DO NOT USE THIS FORM FOR PROPOSALS TO DRILI DIFFERENT RESERVOIR. USE "APPLICATION FOR PI	L OR TO DEEPEN OR PLU	JG BACK TO A	7. Lease Name or Unit A Jackson AT	greement Name
PROPOSALS.) 1. Type of Well: Oil Well Gas Well] Other		8. Well Number	
2. Name of Operator			9. OGRID Number	
Yates Petroleum Corporation 3. Address of Operator			025575 10. Pool name or Wildcat	
105 South Fourth Street, Artesia, NM 88210			Eagle Creek; San Andres	· .
4. Well Location Unit Letter K : 1650 feet	from the South	line and	2310 feet from the	West line
	nship 17S Rai			County
11. Elevati	on (Show whether DR,			
	3492	<u>GK</u>		
12. Check Appropriate	Box to Indicate N	ature of Notice,	Report or Other Data	
NOTICE OF INTENTION	TO:	SUB	SEQUENT REPORT	OF:
		REMEDIAL WOR		
TEMPORARILY ABANDON CHANGE F		COMMENCE DRI CASING/CEMEN		A L
			· · · · ·	
OTHER:		OTHER:		
13. Describe proposed or completed operation of starting any proposed work). SEE RU				
proposed completion or recompletion.	JLE 19.13.7.14 INMAC	2. For Multiple Col	mpletions: Attach wendore	diagram of
Yates Petroleum Corporation plans to plug and ab	andon this well as foll	ows:		
 MIRU any safety equipment as needed. NU B RIH with bit and scraper to just below perfs at you are unable to get below perfs then TOH and s Cut off wellhead and verify that there is cemer perforate and circulate cement to surface behind e Install dry hole marker and clean location. 	1450' and circulate Cl set a CIBP above perfs at behind all casing stri	lass "C" cement to a at 1230' before circ ings at surface. If s re cementing to sur	culating cement to 500' (90 o, cement to surface with 60	sx).) sx. If not then
Wellbore schematics attached	_	Approval Grar	nted providing work is	
NOTE: Yates Petroleum Corporation will use sto	eel pits and no earth pi	Completed by		ECEIVED
Spud Date:	Rig Release D	pproved for plugging of lability under bond is re f C-105 (Subsequent Re fich may be found at O	port of Well Plugging) CD Web Page under	JUL 3 0 2013
		orms, www.emrird.state.	.nm.us/ocd.	
I hereby certify that the information above is true	and complete to the be	est of my knowledg	e and belief.	
	• 			
SIGNATURE (June) furth	TITLE Reg	ulatory Reporting S	upervisor DATE July 2	26, 2013
Type or print name <u>Tina Huerta</u>	E-mail address: <u>tir</u>	nah@yatespetroleur	m.com PHONE: <u>5'</u>	75-748-4168
APPROVED BY: ADD		s-ASpei	wish DATE	KD, 2013
Conditions of Approval (if any):	E AttAched	1 COA'S	-	

Well Name:Jackson AT #3Field:Eagle CreekLocation:1650' FSL & 2310' FWL Sec 14-17S-25ECounty:EddyState:New MexicoGL:3,492'Zero:KB:Spud Date:1/2/1971Completion Date:1/28/1971Comments:API # 30-015-203600000

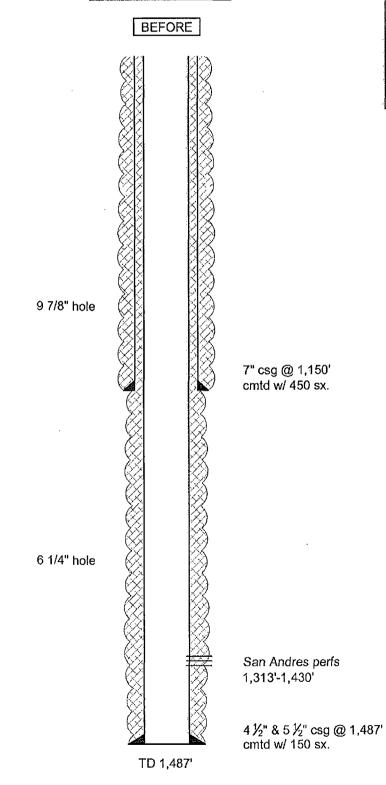

Casing Program	1
Size/Wt/Grade	Depth Set
7" 23# K-55	1,150'
4 ½" 9.5# & 5 ½" 15.5# K-55	1,487'
<u> </u>	

SKETCH NOT TO SCALE

 Well Name: Jackson AT #3
 Field: Eagle Creek


 Location: 1650' FSL & 2310' FWL Sec 14-17S-25E

 County: Eddy
 State: New Mexico

 GL: 3,492'
 Zero:
 KB:

 Spud Date: 1/2/1971
 Completion Date: 1/28/1971

 Comments: API # 30-015-203600000

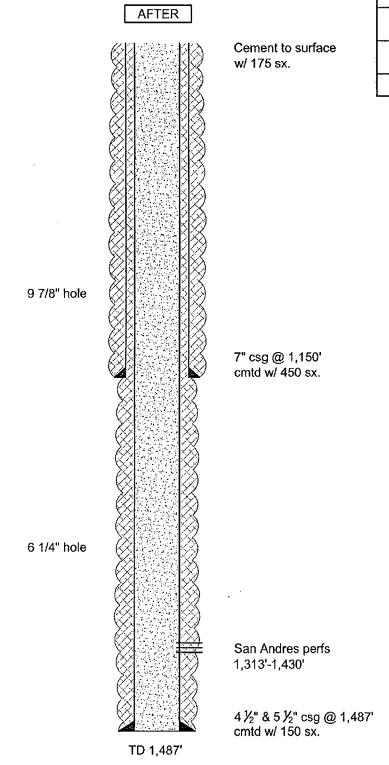

Casing Program		
Size/Wt/Grade	Depth Set	
7* 23# K-55	1,150'	
4 ½" 9.5# & 5 ½" 15.5# K-55	1,487'	

SKETCH NOT TO SCALE

NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator: Vates Petroleum Corp Well Name & Number: <u>Aactson</u> AT #3 API #: 30-015-20360

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- 6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.

9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
10. Plugs may be combined after consulting with and getting approval from NMOCD.
11. Minimum WOC time for tag plugs will be 4 Hrs.

DATE: Aug 2, 2013

APPROVED BY:

and the second second

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - o Fusselman
 - o Devonian
 - o Morrow
 - o Wolfcamp
 - o Bone Spring
 - o Delaware
 - Any Salt Section (Plug at top and bottom)
 - o Abo
 - o Glorieta
 - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section.
 Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).