Sul wit I Copy To Appropriate District Office	State of New Mexico		Form C-103	
District 1 – (575) 393-6161	Energy, Minerals and Natural Resources		Revised July 18, 2013 ELL API NO.	
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	OH CONCEDUATION DIVI	20	0-015-36753	
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	OIL CONSERVATION DIVI	1.5	Indicate Type of Lease	
1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis D		STATE 🗌 FEE 🛛	
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Santa Fe, NM 87505	6.	State Oil & Gas Lease No.	
87505				
	ICES AND REPORTS ON WELLS		Lease Name or Unit Agreement Name	
	DSALS TO DRILL OR TO DEEPEN OR PLUG BAC ICATION FOR PERMIT" (FORM C-101) FOR SUCF	, ~	uick Draw 15 H	
PROPOSALS.)		8.	Well Number	
1. Type of Well: Oil Well	Gas Well Other	1	O O D D D D	
2. Name of Operator  Mewbourne Oil Company			OGRID Number 1744	
3. Address of Operator	· · · · · · · · · · · · · · · · · · ·		). Pool name or Wildcat	
PO Box 5270, Hobbs NM 88241			Seven Rivers Glorieta; Yeso 97565	
4. Well Location				
	1650 feet from the North	line and 99	0 feet from the East line	
Section 15	Township 20S Range 25E		ddy County	
Section 13	11. Elevation (Show whether DR, RKB)		Landy County	
	3423' GL	111, GH, 616.)		
			Local state of the control of the co	
12. Check	Appropriate Box to Indicate Nature	of Notice, Re	port or Other Data	
NOTICE OF IN	NTENTION TO:	CLIDCE	QUENT REPORT OF:	
PERFORM REMEDIAL WORK		SUBSE EDIAL WORK	QUENT REPORT OF.  ☐ ALTERING CASING ☐	
TEMPORARILY ABANDON	<del></del>	MËNCE DRILLII		
PULL OR ALTER CASING	· <del></del>	NG/CEMENT JC	<del>_</del>	
DOWNHOLE COMMINGLE	_		<del></del>	
CLOSED-LOOP SYSTEM		_	_	
OTHER	OTHE			
	oleted operations. (Clearly state all pertiner ork). SEE RULE 19.15.7.14 NMAC. For			
proposed completion or re-		viulipie Compie	ctions. Attach wendore diagram of	
F F				
Diagram and another age about a large for	and the first Country of the same of the same to the same of the s			
Please review the attached plugging procedure for the above captioned well.  Approved for plugging of well bore only.			NM OIL CONSERVATION	
	Liability under bond is retained pend	ling receipt	ARTESIA DISTRICT	
CONDITIONS OF APPROVAL ATTACH	eD of C-103 (Subsequent Report of Wel which may be found at OCD Web Pa	ge under	MAR <b>2 4</b> 2015	
	Forms, www.cmnrd.state.nm.us/ocd.		WAR & 4.2013	
Approval Granted providing work	is			
Completed by 2 201- 20	Rig Release Date:		RECEIVED	
<u> </u>	10			
Lharaby cartify that the information	above is true and complete to the best of m	v knovilodno on	d ballat	
Thereby certify that the information	above is true and complete to the best of it	ly knowledge an	d belief.	
	V			
SIGNATURE OCTU	TITLE Regulatory_	DATE_	03/24/15	
(.)	)			
Type or print name Mackie Lathan E-mail address: jlathan@mewbourne.com PHONE: 575-393-5905				
For State Use Only	do 7 000		-1./	
APPROVED BY:	OU TITLE UST HE	) QUI)!	DATE 3/24/2015	
Conditions of Approval (if any):		/ -50,0		

> See Attached COA's

# INSTERNATION ON CONTRAPOSITATE

### **COMPLETION PROCEDURE**

Submitted By: J. Nave

Wellname: Quick Draw 15H #1

Location: Sec 15, T20S, R25E

SL: 1650' FNL & 990' FEL

Date: 11/20/2014

Csg Set: Surface to 3170' Packer Type: None

Csg Size: 4 ½" 11.6# J55 LT&C Packer Depth:

Liner Size: N/A Tbg: 2 3/8" 4.7# 8rd EUE

Liner Top: N/A \_\_\_\_\_ Tbg Set: \_762'\_


Ports: N/A Total Rods: N/A

#### Procedure:

- 1. Test anchors.
- 2. MIRU BCM. ND wellhead & NU BOP. POOH w/tbg & LD perforated sub.
- 3. RIH w/tbg to CIBP @ 2500'.
- 4. Pump 160 sks Class C to surface.
- 5. POOH w/tbg and WOC.
- 6. If cmt circ top off from surface. If did not circ tag and pump 2<sup>nd</sup> plug.
- 7. RDMO BCM.
- 8. Cutt off Wh & install dry hole marker @ ground level.


## Quick Draw 15H #1

Last Updated: 11/20/2014 By: J. Nave

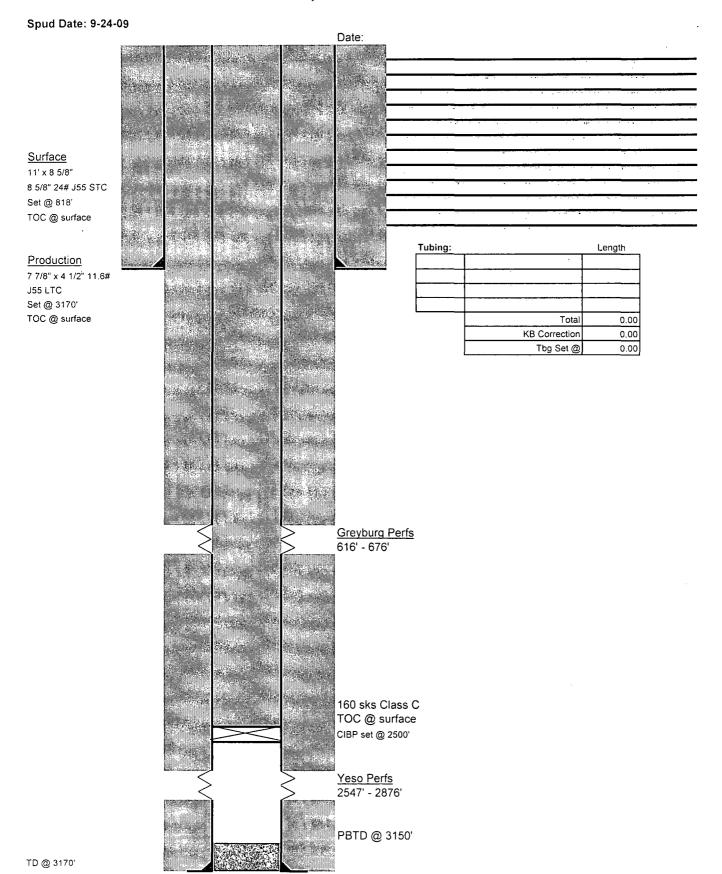

#### Quick Draw 15H #1 Last Updated: 11/20/2014 By: J. Nave

Spud Date: 9-24-09

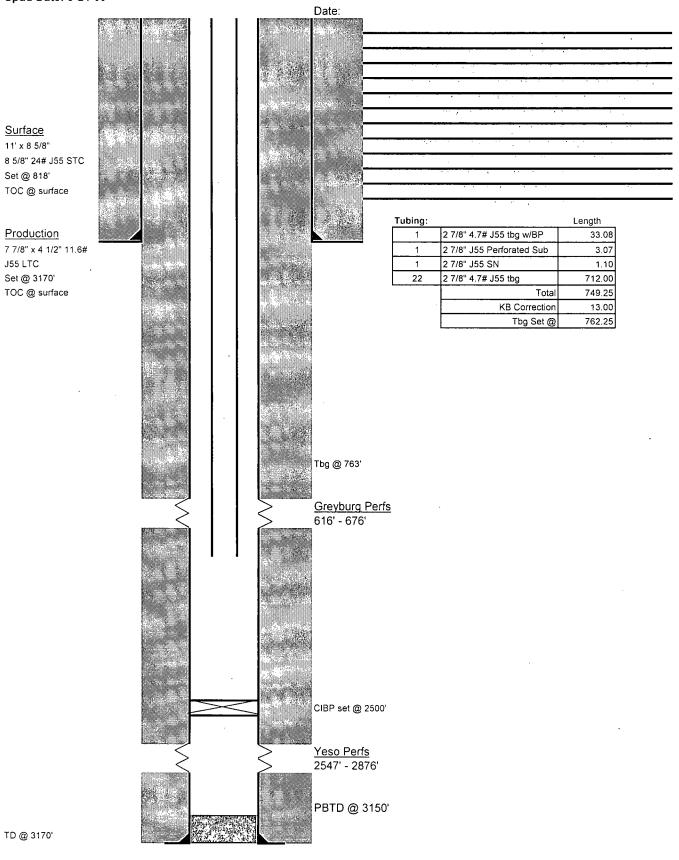

## NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

## CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator: Mewbanne	_
Well Name & Number: Quek Draw 15 H	#/
API #: 30-015-36753	_

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- **6.** If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.
- 9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
- 10. Plugs may be combined after consulting with and getting approval from NMOCD.
- 11. Minimum WOC time for tag plugs will be 4 Hrs.

DATE: 3/24/2015

APPROVED BY:

#### **GUIDELINES FOR PLUGGING AND ABANDONMENT**

#### DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub
  plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
  - o Fusselman
  - o Devonian
  - o Morrow
  - o Wolfcamp
  - o Bone Spring
  - o Delaware
  - Any Salt Section (Plug at top and bottom)
  - o Abo
  - o Glorieta
  - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing
  must be cut and pulled with plugs set at these depths or casing must be perforated and cement
  squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).