District 1
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505 For drilling and production facilities, submit to appropriate NMOCD District Office.

For downstream facilities, submit to Santa Fe office

Form C-144

June 1, 2004

Pit or Below-Grade Tank Registration or Closure


Is pit or below-grade tank covered by a "general plan"? Yes No X Type of action: Registration of a pit or below-grade tank Cosure of a pit or below-grade tank X		
Facility or well name: Boise Federal #1 API#: 30-015-33735	Mexico 88211	MAR 0 1 2006
Pit Type: Drilling X Production Disposal Workover Emergency Lined X Unlined Liner type: Synthetic X Thickness 12/20 mil Clay	Below-grade tank	RÊÇEIYÉD
Pit Volumebbl Depth to ground water (vertical distance from bottom of pit to seasonal high water elevation of ground water.)	Less than 50 feet 50 feet or more, but less than 100 feet 100 feet or more	(20 points) (10 points) (0 points) X
Wellhead protection area: (Less than 200 feet from a private domestic water source, or less than 1000 feet from all other water sources.)	Yes No Less than 200 feet	(20 points) X NOV 0 8 2005 (20 points) X NOV 0 8 2005
Distance to surface water: (horizontal distance to all wetlands, playas, irrigation canals, ditches, and perennial and ephemeral watercourses.)	200 feet or more, but less than 1000 feet 1000 feet or more Ranking Score (Total Points)	(10 points) (0 points)X 0 Points
If this is a pit closure: (1) Attach a diagram of the facility showing the pit's relationship to other equipment and tanks. (2) Indicate disposal location: (check the onsite box if you are burying in place) onsite X offsite If offsite, name of facility		
has been/will be constructed or closed according to NMOCD guidelines X , a general permit , or an (attached) alternative OCD-approved plan . Date: 11/05/05 Printed Name/Title // N. 199aa // Signature		

Allstate Environmental Services

9-12-05

Reserve Pit Solidification Procedure

1. Diagram of deep burial trench(s) is provided with application for closure (form C-144)

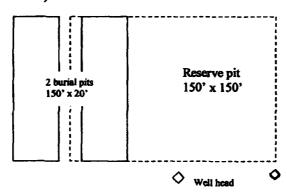

2. Solidification of Cuttings:

- (A) The cuttings will be mixed with a track hoe. Contents will be lifted and dropped so as to create a stirring process. This process will continue until CKD and pit contents are thoroughly bonded.
- (B) The solidification material will be Cement Kiln Dust (CKD).
- (C) CKD to pit contents ratio will be 1 yard of pit contents to 240 lbs. of CKD or 1,000 cubic yards of pit contents to 120 tons of CKD. Pit contents will be measure to determine actual volume (length' x width' x depth') /27. CKD is weighed and delivered to the site in 40,000 lb increments.
 - A 1,000 cubic yard work pit is constructed inside the original reserve pit beside the encapsulation/solidification trench. One thousand cubic yards of pit contents will be placed in the work trench along with six 20 ton loads of CKD to begin the mixing process.
- (D) Water may be introduced to initiate the bonding process of CKD and pit Contents.
- (E) In order to assure proper mixing, all CKD is precisely weighed before delivery and pit construction is measure to a predetermined need depending on exact volume of pit contents.
- 3. A minimum of three representative samples will be taken from pit contents Prior to any work. These samples will be stored in a closed container.

- 4. Each stage being mixed will be sampled prior to transferring the slurry to the deep trench as follows:
 - (A) One sample of the slurry will be taken at the beginning of the transference and stored in a <u>closed</u> container.
 - (B) One sample of the slurry will be taken a the beginning of the transference and stored in an <u>open</u> container.
 - (C) One sample of the slurry will be taken at the end of the transference and stored in a <u>closed</u> container.
 - (D) One sample of the slurry will be taken at the end of the transference and stored in an open container.
- 5. All samples will be stored in environmentally approved containers.
- 6. All samples and associated paperwork will be delivered to the OCD office within 3 working days of closure.