
e T		UNITED STATES	NTERIOR	E GONSERVAT	ION FORM OMB NO Expires:	APPROVED D. 1004-0135 July 31, 2010
	Form 3160-5 (August 2007)* UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS ARTESIA DISTRICT				5. Lease Serial No. NMNM1372	
	abandoned well. Use form 3160-3 (APD) for such proposals.				6. If Indian, Allottee or Tribe Name	
	SUBMIT IN TRIPLICATE - Other instructions on reverse side. RECEIVED				7. If Unit or CA/Agreement, Name and/or No.	
	1. Type of Well ☐ Oil Well ⊠ Gas Well □ Other				8. Well Name and No. LEHMAN FEDERAL COM 11	
	2. Name of Operator Contact: TINA HUERTA YATES PETROLEUM CORPORATIONE-Mail: tinah@yatespetroleum.com				9. API Well No. 30-015-26711	
	3a. Address 105 SOUTH FOURTH STREET ARTESIA, NM 88210		3b. Phone No. (include area code) Ph: 575-748-4168 Fx: 575-748-4585		10. Field and Pool, or Exploratory N SEVEN RIVER WOLFCAMP	
	4. Location of Well <i>(Footage, Sec., T.</i> Sec 18 T19S R25E NWSW 19			11. County or Parish, and State EDDY COUNTY, NM		
	12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA					
	TYPE OF SUBMISSION TYPE OF ACTION					
	 Notice of Intent Subsequent Report 	 Acidize Alter Casing Casing Repair 	 Deepen Fracture Treat New Construct 	t 🗌 Reclam		 Water Shut-Off Well Integrity Other
	Final Abandonment Notice	Change Plans	Plug and Aba	`	rarily Abandon	
	following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.) Yates Petroleum Corporation plans to plug and abandon this well as follows: 1. MIRU safety equipment as needed. POOH with production equipment. 2. Set a 7 inch CIBP at 6034 ft. Tag CIBP then cap it with 35 sx Class C cement. 3. Load hole with plugging mud and spot a 35 sx Class C cement plug from 5224 ft - 5424 ft across Wolfcamp top. 4. Spot a 35 sx Class C cement plug from 3966 ft - 4166 ft across Abo top. 5. Spot a 35 sx Class C cement plug from 1845 ft - 2045 ft across Glorieta top. 6. Spot a 35 sx Class C cement plug from 1058 ft - 1258 ft across casing shoe. WOC and tag, reset if necessary. 7. Spot a 35 sx Class C cement plug from 0 - 200 ft, this will form surface plug. WOC and tag, reset if necessary. 7. Spot a 35 sx Class C cement plug from 0 - 200 ft, this will form surface plug. WOC and tag, reset if necessary.					
					ACCEPNIMO	Be
	14. I hereby certify that the foregoing is true and correct. Electronic Submission #351628 verified by the BLM Well Information System For YATES PETROLEUM CORPORATION, sent to the Carlsbad Committed to AFMSS for processing by DEBORAH MCKINNEY on 09/19/2016 () Name (Printed/Typed) TINA HUERTA					
•	Signature (Electronic S	ubmission)	Date	09/19/2016		
	Signature (Electronic Submission) Date 09/19/2016 THIS SPACE FOR FEDERAL OR STATE OFFICE USE					
	Approved By)	Title	Eng		Date 10/27/10
	Conditions of approval, if any, are attached certify that the applicant holds legal or equ which would entitle the applicant to conduc	table title to those rights in the	not warrant or subject lease Office	CFO		· · · /
;	Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.					
	** OPERAT	OR-SUBMITTED ** O	PERATOR-SUBMI	TED ** OPERA	OR-SUBMITTED	**
			•		·	
		·				,


Additional data for EC transaction #351628 that would not fit on the form


32. Additional remarks, continued


8. Cut off wellhead, install marker and clean up location as per regulated.

Wellbore schematics attached.

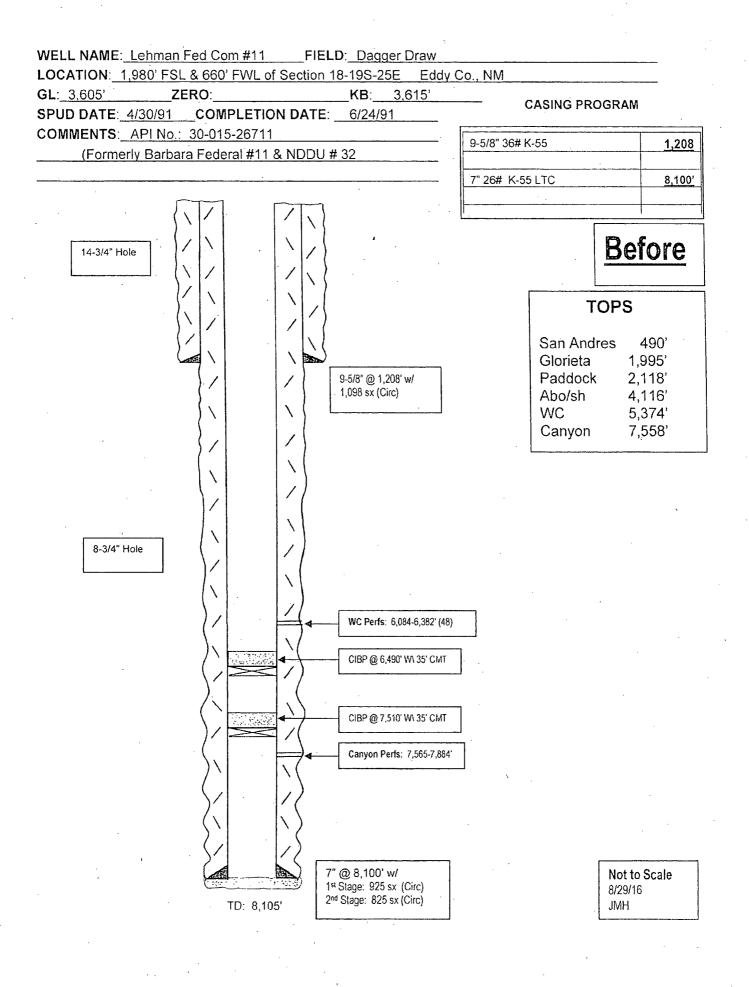

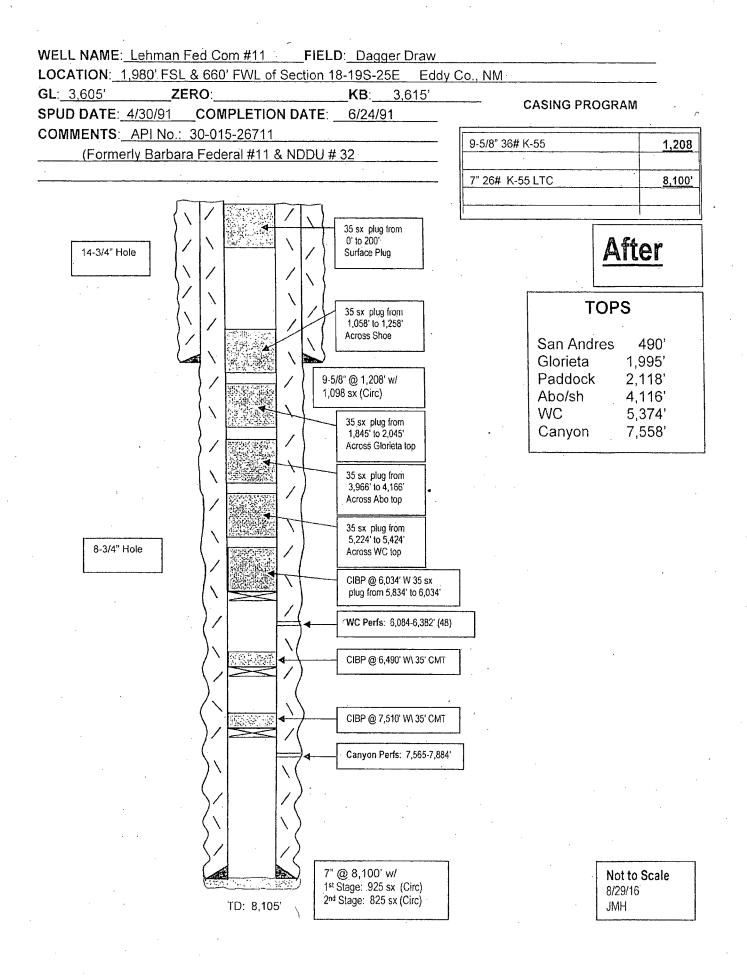

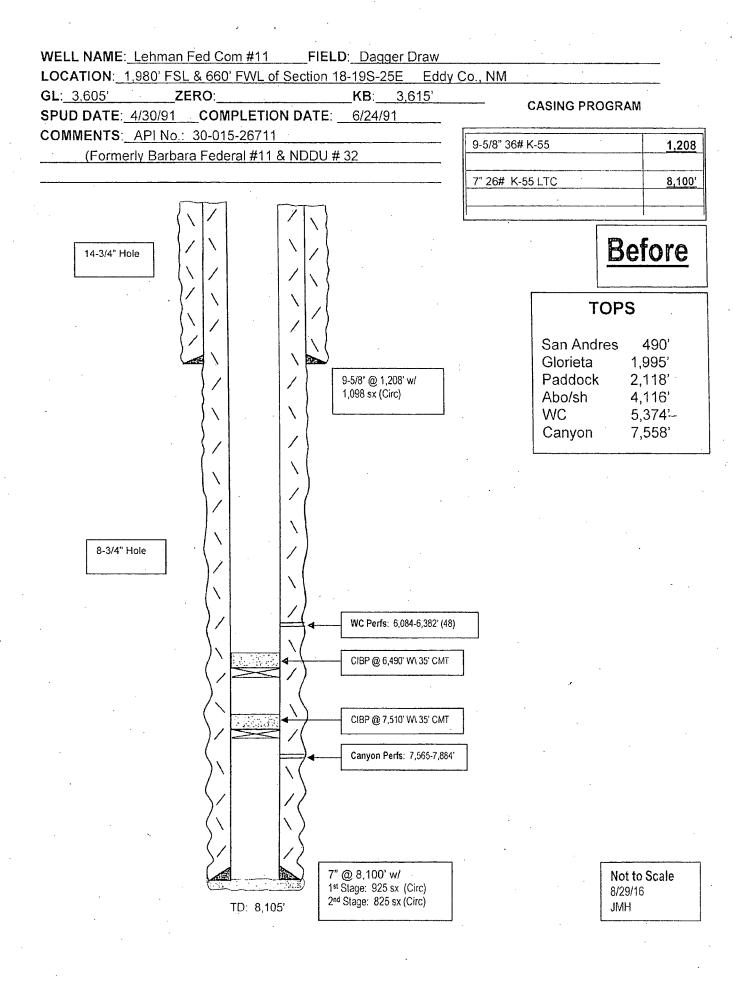

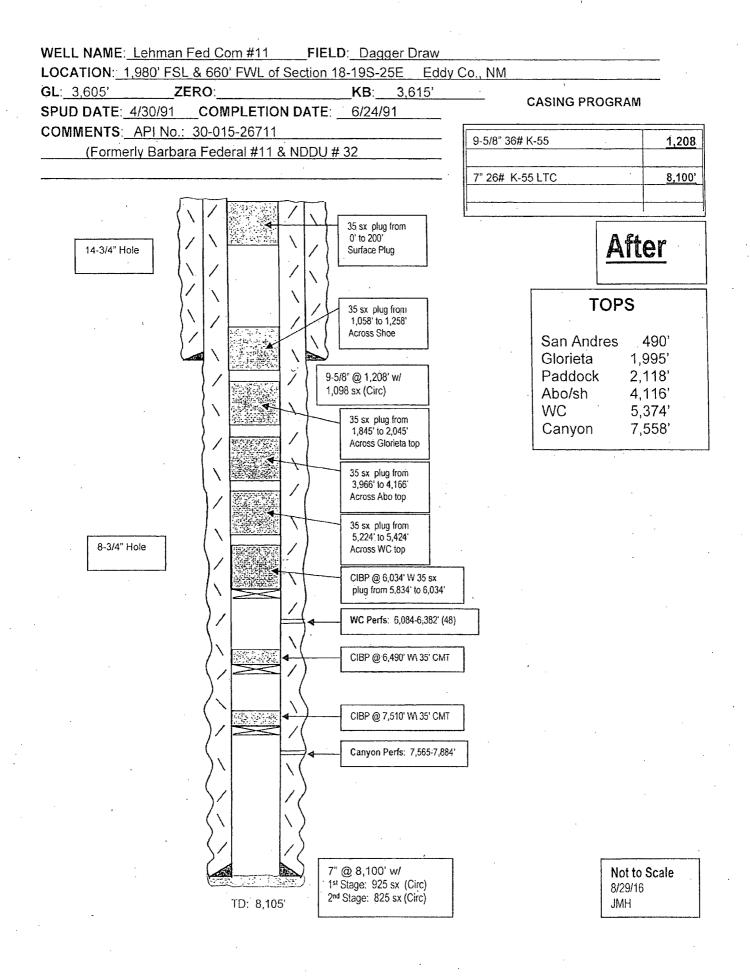

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.