Form \$160-5 (June 2015)

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

Expires: January
5. Lease Serial No.
NMNM2748

;	SUNDRY	NOTIC	<b>ES AND</b>	REPOR	TS ON	WELLS	
Do i	not use th	is form	for propo			re-enter a	n

6. If Indian, Allottee or Tribe Name

abandoned wei	i. Use form 3160-3 (APD) 10	or such proposals.							
SUBMIT IN 1	TRIPLICATE - Other instruct	tions on page 2	7. If Unit or CA/Agr	eement, Name and/or No.					
Type of Well     Gas Well ☐ Oth	ıer		8. Well Name and No GISSLER B 6	).					
Name of Operator     EOG Y RESOURCES INC	Contact: TIN, E-Mail: tina_huerta@ed	A HUERTA ogresources.com	9. API Well No. 30-015-04119-	9. API Well No. 30-015-04119-00-S1					
3a. Address 104 S 4TH STREET ARTESIA, NM 88210		Phone No. (include area code) 1: 575-748-4168	10. Field and Pool or SQUARE LAK	Exploratory Area E					
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description)		11. County or Parish	, State					
Sec 11 T17S R30E NENW 66	0FNL 1980FWL		EDDY COUNT	Y, NM					
12. CHECK THE AF	PPROPRIATE BOX(ES) TO	INDICATE NATURE OF	NOTICE, REPORT, OR OT	HER DATA					
TYPE OF SUBMISSION		TYPE OF	ACTION						
■ Notice of Intent	☐ Acidize	□ Deepen	☐ Production (Start/Resume)	■ Water Shut-Off					
_	☐ Alter Casing	☐ Hydraulic Fracturing	□ Reclamation	■ Well Integrity					
☐ Subsequent Report	Casing Repair	■ New Construction	☐ Recomplete	Other					
☐ Final Abandonment Notice	☐ Change Plans	🛮 Plug and Abandon	□ Temporarily Abandon						
	☐ Convert to Injection	Plug Back	■ Water Disposal						
Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.  EOG Resources, Inc. plans to plug and abandon this well as followscepted for record. NMOCD E ATTACHED FOR  1. MIRU any safety equipment as needed. POOH with production equipment.  2. RIH with GR/JB to top perforation.  3. Set a CIBP at 2770 ft with 35 ft of Class C cement on top to 2735 ft.  4. Perforate at 2250 ft. Spot a 40 sx Class C cement inside/outside plug from 2297 ft - 2262 ft.  This will plug the Red Sand.  2. 3. 8. C. 2. 2. C. T. O. T. O. T. Add. For f. 2. 2. C. T. O. T. Add. For f. 2. 2. C. T.									
14. I hereby certify that the foregoing is  Commi  Name (Printed/Typed) TINA HUE	Electronic Submission #4580 For EOG Y RESC tted to AFMSS for processing	DURCES NC, sent to the Co by DEBORAH MCKINNEY o	arlsbad	PR 0 1 2019					
Signature (Electronic S	ubmission)	Date 03/14/20	<b>19</b>						
	THIS SPACE FOR F	EDERAL OR STATE O	<del>`</del>						
Approved By	a la . ans	Title St	ST	327-19 Date					
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to condu			2						

## Additional data for EC transaction #458082 that would not fit on the form

32. Additional remarks, continued

Wellbore schematics attached.


1 2 2	Gissler B#6	1 1 1 1 1 1 1 1 1	Se		11-17S-30E			API:	30-01	5-04119	<del></del>	BEFORE
CONNENTO	()		4	Lat/Long:	32.8544693,-103.	944847	1					
COMMENTS			75 745	Spud	E/6/19/16				P. II. Januaria		S. M. W. San Jan	
Ì					Lite Charles File Bellion Pr	4 T. C.	1, 16,27,6	Children !!	1. 71.75	artine to kind	(15) 全进行工作的支持	
	[2]	1      4		G DETAIL		1 -					,	<del></del>
	[3 1]		#	HOLE SIZE	SIZE	WGHT	GRADE	+	Bottorn	Sx Cmt	Cire/TOC	<b>-</b>
l.	(tri)		A	estimate 10 5/8	8 1/4	ļ	<b></b>	0	552 -	50	- Cite	
}		] [h 3	В	estimate 8 3/4	5 1/2	<u> </u>		0	2,820	100	Calc TOC; 2297	<b></b>
			C	4 3/4		-	<del></del>	2820	3048		Open Hote	ļ
l i			<b> </b>			<u> </u>	ļ				Ļ	ļ <u></u>
			- 44 ~		1 1 1 1 1 1 1 1	1		<u> </u>	1	4 (4)	n the state of the	2002
:	[[[대]	(3)			e die Volgen in der	alessa i	5, " . ]	35.191	<u> </u>		المسائدة المديد الأدا	2
) 1	B(1)	/° <b>5</b> .	FORMA	TION TOPS		1						
1		N= 1			FORMATION	TOP						
		Let !			Sutter Zust/ar	380	_					
			<u> </u>		Salt Top .	490				1	1447	
1	A		<b>-</b>		Sait base	1240	-		15	10,3 a Z	×30	<del></del>
	<u> </u>	1 1			Red Sand	2200	_		, C.	-	730	
]		1 1			Gray Burg	2820	4					-
1 1			<b> </b>				<del>                                     </del>		<del></del>		<del></del>	<del> </del>
		1	-				$\vdash$					<del>  -</del>
į			<del></del>	<del></del>		1	<del> </del>			<del></del>		
] }			1.13 (4.27)	ا العامواي فالأوروز عن	nie teres	1.00	اــــا	لببا	14 .	L	1 2 2 4 4 4	L
1		<b> </b>		DETAIL	11 4, 7 74 7 4	- 4, .				ş <u>ş.</u>	- Ty i the i	V
}						<del></del>	T 1					
1		1 1	#	Joints	Description	Length		ĮD.	Grade	Wt (lb/lt):	Top (fikB):	Blm (ftXB):
1			<del></del>			FT	in					
1			1 1	08	2 7/8" TBG	2541,00		2.441			0.00	<del></del>
			2	1	TAC	3.00					2,541.00	
1			3		2 7/8" TBG		27/8	2.441			2,544.00	
1			4	1	Seating nipple	1.10	┡				3,048.00	3,049,10
1 1	j l		<del> </del>	-								
1 . 1				·		-		-			<u> </u>	
	J											
]	1		<u> </u>									
1 1			<del></del>				<b>├</b> -				<del></del>	
			لحجيا					لب				
]			ROD DE	TAN	<u>. 24 - 241 5 - 44</u>			<u> </u>	9.7	•	in the second of	
1			#		Description	Length			Grade	Wt(lb/ft	Top (BVD)	Dim (BI/D)
			1		1,25" X 16' PR, 1.5X 10' L				Giade	VVIIIIVII	Top (ftKB) 0.00	8tm (flK8) 16,00
}		<del>_</del>	2		0.625" subs	6,00					16.00	
i i	, ,	1 1	3		0.625" Rods with FSTH	2950.00						22.00
	F. 14.		4		200-150-16 RHBC	2950.00 16,00	-	_			22.00	2972.00
, ,	17.7	[ ] [ ]	<del> </del>	<del>'</del> -	200-130-10 KITBC	16,00		+			2972.00	2988,00
1			$\vdash \vdash \vdash$		<del></del>							
								<del></del>				—·
	fich.			<del></del>			$\dashv$	$\rightarrow$				
i					The second secon	76.77	- <u> </u>	<del>4</del> 77	· · · · · · · · · · · · · · · · · · ·		<del></del>	
	<b>L</b> .		1 70.74	<u> </u>	<u> </u>		<del>/</del>	<u> </u>	* *r ******			
			— т									
	B )	\^ <b>~</b>	<del></del>					-+		<del></del>		
OH 2820' - 3048'	• /	\ \										
5.1 2020 - 0040	(	} }	-	T	<del></del>	ī						
ŀ	)	/ /								<del></del>		
<u> </u>	{	( )					$\rightarrow$	-+				
	J	<b>)</b>	$\rightarrow$						-		<del></del>	
]	1	1 }	-	·				$\rightarrow$				
	L		5. J.	المهور سيدي وسي	The second secon	<del></del>			<del></del> _		Apple Colored Colored	and the second
	•	ļ	ببريدن		The second second	<u> </u>	<u></u>					
<u> </u>	C C 2 C C			Prep	ared by: MJM					Date: 14-M	lar-2019	
- !	PBTD: 3,048 MD	ĺ										J
	TD: 3,048 MD											ľ

,

1

:

1

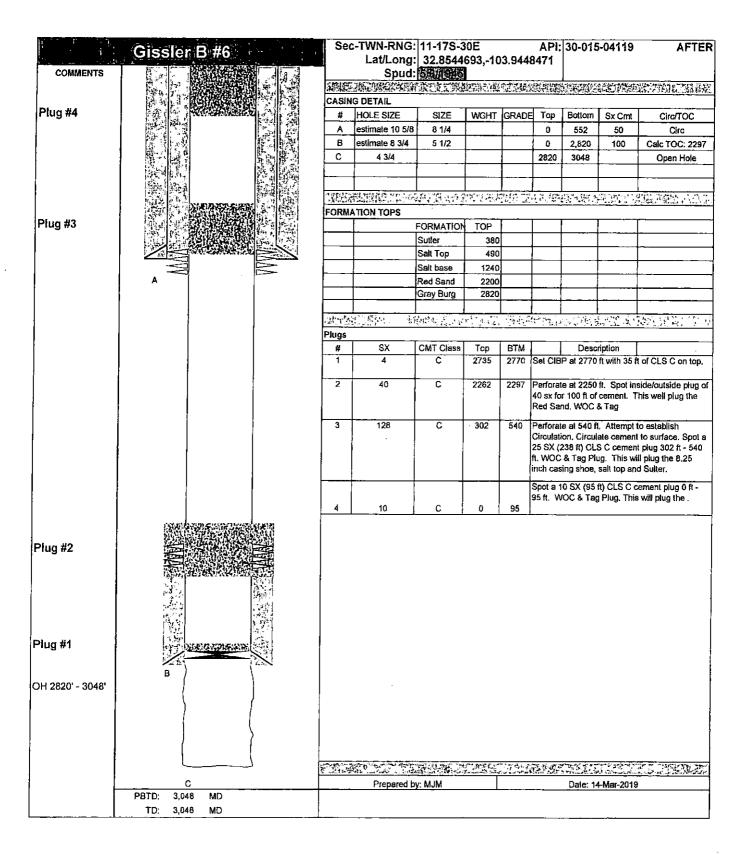

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted