#### **UNITED STATES** DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT



FORM APPROVED

	PARTMENT OF THE I UREAU OF LAND MANA		Expires	s: January 31, 2018		
OUNDOV	5. Lease Serial No.					
SUNDRY Do not use thi	9	NMLC067144				
abandoned wei	II. Use form 3160-3 (AP	odrill or to re-emblan 5 201 PD) for such proposals.	6. If Indian, Allotte	ee or Tribe Name		
<u> </u>		CIETOTE VARIEST	10.0.D. 7 1511 CA/A			
SUBMIT IN T	TRIPLICATE - Other ins	truction DIST BUGG 12-HATEST	/. If Unit or CA/A	7. If Unit or CA/Agreement, Name and/or No.		
1. Type of Well			8. Well Name and	8. Well Name and No.		
☑ Oil Well ☐ Gas Well ☐ Oth	ner .			INDIAN FLATS BASS 2		
Name of Operator     XTO PERMIAN OPERATING	9. API Well No. 30-015-2171	9. API Well No. 30-015-21715-00-S1				
3a. Address · 6401 HOLIDAY HILL ROAD B MIDLAND, TX 79707		10. Field and Pool or Exploratory Area INDIAN FLATS				
4. Location of Well (Footage, Sec., T	, R., M., or Survey Description	n)	11. County or Pari	11. County or Parish, State		
Sec 35 T21S R28E SENW 19	80FNL 1980FWI		EDDY COUN	EDDY COUNTY, NM		
	00//12/000///2			2557 0001(11,1111)		
12. CHECK THE AF	PPROPRIATE BOX(ES)	) TO INDICATE NATURE OF	F NOTICE, REPORT, OR C	THER DATA		
TYPE OF SUBMISSION		TYPE OF	ACTION			
Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	■ Water Shut-Off		
_	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation	■ Well Integrity		
☐ Subsequent Report	□ Casing Repair	■ New Construction	☐ Recomplete	☐ Other		
☐ Final Abandonment Notice	☐ Change Plans	▶ Plug and Abandon	☐ Temporarily Abandon			
	☐ Convert to Injection	☐ Plug Back	☐ Water Disposal			
Attach the Bond under which the wor following completion of the involved	ally or recomplete horizontally, it will be performed or provide operations. If the operation re bandonment Notices must be fil	ent details, including estimated starting, give subsurface locations and measu e the Bond No. on file with BLM/BIA esults in a multiple completion or recoiled only after all requirements, includ	red and true vertical depths of all pe Required subsequent reports mus impletion in a new interval, a Form	ertinent markers and zones. t be filed within 30 days 3160-4 must be filed once		
the referenced wellbore.		sundry notice of intent to plug	SEE ATTACHED	FOR		
During operations to TA the w sundry of TA operations attack	ell, decision was made to ned.	o P&A due to condition of casir	o sconditions of	FAPPROVAL		
1. ND WH and NU 3K manual CBL on WL, log from 3,455? t	BOP. Function test BOP o 1,500?. Locate TOC or	P. MIRU WL. RIH with CBL tool n CBL. Circulate hole with 9.5#	s to 3,455?. PUH with	Uotify Vim U, 575.861-2698		
2. RIH w/tbg to +/-2,355'. Spot **Notify BLM rep of activity, BI	t 25 sxs Class C cmt from _M rep must be on location	m 2,355' to 2,230'. PUH w/tbg. ion to witness tag.** (B/ Salt Plu	WOC & Tag.	ide Tac.		
			Accepted for record	NMOCD		
14. I hereby certify that the foregoing is						
	Electronic Submission #	#466665 verified by the BLM Wel	I Information System			

Notify BLIM f	ep of activity, bein rep must be on location to witness	; tag."" (	Accepted for record	NMOC	<b>D</b>
14. I hereby certify t	hat the foregoing is true and correct. Electronic Submission #466665 verifi For XTO PERMIAN OPERAT Committed to AFMSS for processing by DEBO	ĭr∳G ĹLC	, sent to the Carlsbad		
Name(Printed/Ty	ped) TRACIE J CHERRY	Title	REGULATORY COORDINATOR		
Signature	(Electronic Submission)	Date	05/24/2019		,
	THIS SPACE FOR FEDER	AL OR	STATE OFFICE USE		
Approved By	James a. Om	Title	SÆT		S-28-19 Date
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.		Office	e AO		
	1001 and Title 43 U.S.C. Section 1212, make it a crime for any tious or fraudulent statements or representations as to any matter			ent or agency	of the United

## Additional data for EC transaction #466665 that would not fit on the form

#### 32. Additional remarks, continued


- 3. RIH w/WL and perf 5-1/2" casing at 700'. Sqz 135 sxs Class C cmt from 700' to surface. WOC & Verify cmt at surface.(T/ Salt, Csg Shoe, Surface Plug)
- 4. ND BOP and cut off wellhead 5' below surface. Set P&A marker



### **Existing vs Proposed WBDs**

Well Name: INDIAN FLATS BASS FEDERAL 002

API/UWI 3001521715	SAP Cost Center ID 1135671001	Permit Number	State/Province New Mexico		County Eddv	7,000	
Surface Location			Spud Date	Original KB Elevation (ft)	Gr Elev (ft)		face Casing Flange Elevatio
T21S-R28E-S35			3/8/1976 00:00	3,190.00	3,179.00	11.00	

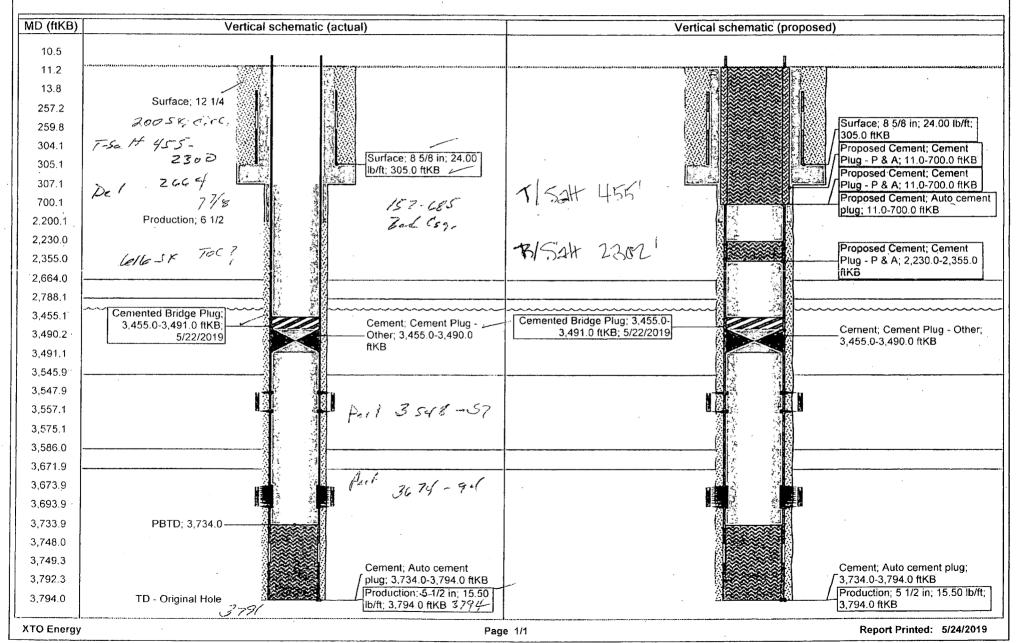

# BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

# Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.