						FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018		
SUNDRY NOTICES AND REPORTS ON WELLS					5. Lease Serial No. NMNM0157779			
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					6. If Indian, Allottee or Tribe Name			
SUBMIT IN TRIPLICATE - Other instructions on page 2					 If Unit or CA/Agreement, Name and/or No. 891000303E 			
1. Type of Well 1. Type of Well Gas Well Image: Contract of the second se			8. Well Name and No. POKER LAKE UNIT 108					
2. Name of Operator XTO PERMIAN OPERATING	ERRY .com		9. API Well No. 30-015-28086-00-S1					
3a. Address 6401 HOLIDAY HILL ROAD E MIDLAND, TX 79707	o. (include area code) 21-7379	······································	10. Field and Pool or Exploratory Area POKER LAKE					
4. Location of Well (Footage, Sec., 7			11. County or Parish, State					
Sec 25 T24S R30E NWSE 19		EDDY COUNTY, NM						
12. CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE,	REPORT, OR OT	HER DATA		
TYPE OF SUBMISSION TYPE OF ACTION								
Notice of Intent	C Acidize	🗖 Dee	-		ion (Start/Resume)	U Water Sh		
Subsequent Report	 Alter Casing Casing Repair 		Iraulic Fracturing v Construction	-	Reclamation Recomplete		grity	
Final Abandonment Notice	Change Plans		g and Abandon		arily Abandon	Other		
	Convert to Injection	🗖 Plu	g Back	U Water D	-			
 XTO Permian Operating, LLC the referenced wellbore. 1. MIRU. POOL with rods and 2. RIH, tag fill at 8063'. Spot 2 3. Set 5-1/2" CIBP @ 6200'. T Circulate 9.5# salt fel mud. Te 4. Spot 45 sx Class C 4250'-3 	pump. ND wellhead and 5 sx Class H cmt 8000'-7 ag w/tbg to verify setting. st csg to 500 psi. (Bone S	install 3K ma 750 ¹ . WOC 8 Spot 25 sx (Spring & Dela ware). (Sh	nual BOP. Funct tag (T/Bone Spr Class c to 5950'. V ware perfs).	ion test. ing) wood	E ATTACH	ED FOR	45	
14. I hereby certify that the foregoing is		hole	marter	regue		IL CONSER		
For XTO PERMIAN OPERATIN Committed to AFMSS for processing by DEBO Name (Printed/Typed) TRACIE CHERRY			by the BLM Well Information System G LLC, sent to the Carlsbad AH MCKINNEY on 07/12/2019 (19DLM0567SE) Title REGULATORY COORDINATOR					
Signature (Electronic Submission)			Date 07/12/2()19		RECEIVE	C	
	THIS SPACE FO	OR FEDER	L OR STATE	OFFICE U	SE	<u> </u>		
Approved By James J. Comos			Title S	AFT		7-2 Date	27-19	
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.			Office CH	0				
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s	U.S.C. Section 1212, make it a statements or representations as	crime for any pe to any matter w	erson knowingly and ithin its jurisdiction.	willfully to ma	ke to any department o	r agency of the Ur	nited	
(Instructions on page 2) ** BLM REV	ISED ** BLM REVISED) ** BLM RI	EVISED ** BLM	I REVISED) ** BLM REVISE	D **	Ŧ	


Additional data for EC transaction #473083 that would not fit on the form

32. Additional remarks, continued

5. Perf 5-1/2" csg @ 1100'. Sqz 55 sx Class C to 900'. WOC & tag. (T/Rustler, T/Salt).

6. Perf 5-1/2" csg @ 60'. Sqz 25 sx Class C to surf. WOC & verify

7. Cut off wellhead. Install marker.

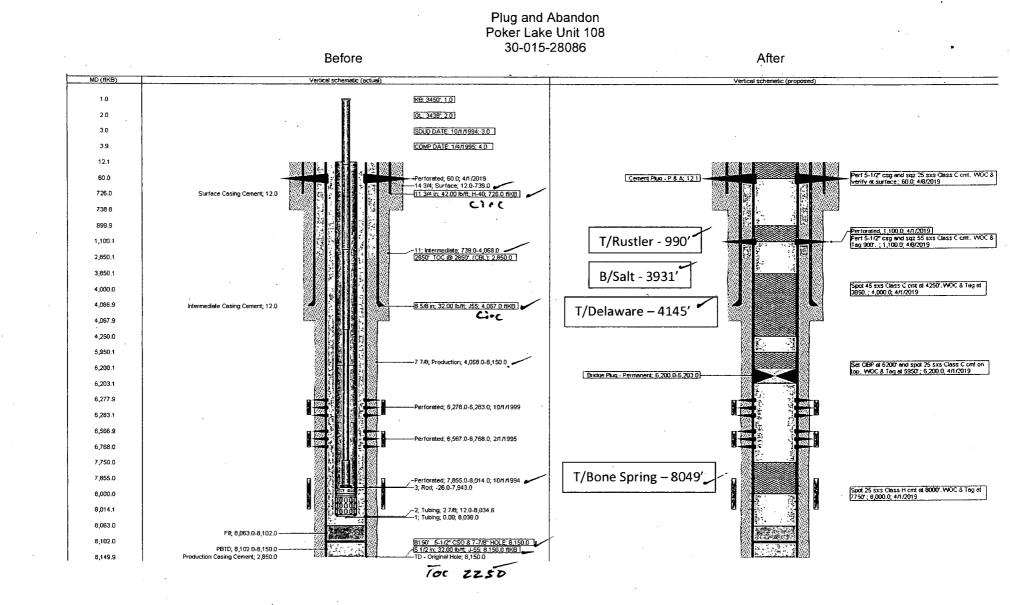

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

• Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.