Basin Environmental Service Technologies, LLC OCD-ARTESIA

2800 Plains Highway
P. O. Box 301
Lovington, New Mexico 88260
cstanley@basinenv.com

Office: (505) 396-2378

Fax: (505) 396-1429



W

Mr. Mike Bratcher New Mexico Oil Conservation Division 1301 W. Grand Avenue Artesia, New Mexico 88210

Re: Fairway Resources Operating, LLC South Red Lake II Unit #57 Reserve Pit Closure

30-015-36116

Mr. Bratcher,

Basin Environmental Service Technologies (Basin), on behalf of Fairway Resources Operating, LLC (Fairway) is submitting reserve pit closure documentation for the above referenced facility.

On May 16, 2008, Fairway submitted a request (Form C-144) to the NMOCD to close a reserve pit at the South Red Lake II Unit #57 (SRLIIU #57) facility located in Unit Letter "C", Section 36, Township 17 South, Range 27 East. The Form C-144 was approved by the NMOCD on May 16, 2008. The facility is located in rural Eddy County, east of Artesia. Closure activities began prior to the implementation the "New Pit Rules" and Fairway requested a closure under NMOCD Rule 50.

A burial trench was excavated adjacent to and east of the reserve pit. The pit liner was removed from the reserve pit and placed in the burial trench in accordance with NMOCD Rule 50. On June 11, 2008, a composite soil sample (Composite Floor) was collected from the soil beneath the liner (approximately six feet below ground surface) and submitted to the laboratory for determination of BTEX, TPH and chloride concentrations using EPA method 8021b, SW-8015M and EPA 300, respectively.

The analytical results indicated the "Composite Floor" soil sample exhibited a BTEX concentration of <0.0020 mg/Kg, a TPH concentration of <17.1 mg/Kg and a chloride concentration of 975 mg/Kg.

Following the sampling event, four (4) test trenches were excavated to a depth of approximately ten (10) feet below ground surface in the corners of the reserve pit. On June 26, 2008, soil samples (NE-1, SE-1, NW-1 and SW-1) were collected from the floor of the test trenches and submitted to the laboratory.

Accepted for record

Final Closure Report



The analytical results indicated BTEX and TPH concentrations were below the laboratory method detection level in the four soil samples. Chloride concentrations ranged from 174 mg/Kg in soil sample NE-1 to 1,190 mg/Kg in soil sample SW-1.

Following discussion with a NMOCD representative in the Artesia District Office, the NMOCD approved the excavation of additional quantities of chloride impacted soil in the southern half of the reserve pit to the extent the soil could be placed in the burial trench.

When the burial trench was at capacity, the NMOCD approved the backfilling of the reserve pit with locally purchased caliche and closed the burial trench following NMOCD guidelines.

Attached are NMOCD Form C-144, a site map, a table summarizing the concentrations of BTEX, TPH and chlorides in Soil and laboratory analytical reports.

If you have any questions, please contact me at 575-441-2244.

Respectfully,

Curt D. Stanley Project Manager Basin Environmental 575-396-2378 575-441-2244 cstanley@basinenv.com Listricki 1625 N. French Dr., Hobbs, NM 88240 District II 1301 W. Grand Avenue, Artesia, NM 88210 District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Form C-144 June 1, 2004



Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

For drilling and production facilities, submit to appropriate NMOCD District Office.
For downstream facilities, submit to Santa Fe office

Pit or Below-Grade Tank Registration or Closure Is pit or below-grade tank covered by a "general plan"? Yes No S

	or below-grade tank [] Crosure of a pic of below-g	COTTICOIA
Operator Fairway Resources Operating LLCTelephone:		_kpearce@fairwayresources com
Address:538 Silicon Drive, Suite 101 Southlake, TX 76092		
Facility or well name:South Red Lake II Unit #57API #: _	30-015-36116U/L or Qtr/QtrG	Sec _36 T _17S R _27E
County:EddyLatitude	_32°47'29.38"Longitude _	_104°13'44.13" NAD: 1927 ∐ 1983 ⊠
Surface Owner. Federal State Private Indian		
Pit	Below-grade tank	
Type: Drilling Production Disposal D	Volume:bbl Type of fluid:	
Workover Emergency	Construction material:	-
Lined 🛭 Unlined 🗌	Double-walled, with leak detection? Yes If a	iot, explain why not
Liner type: Synthetic M Thickness 12 mil Clay		
Pit Volume _5,000_bbl		1.00
Depth to ground water (vertical distance from bottom of pit to seasonal	Less than 50 feet	(20 points)
high water elevation of ground water.) >100'	50 feet or more, but less than 100 feet	(10 points)
	100 feet or more	(0 points) 0
Wellhead protection area: (Less than 200 feet from a private domestic	Yes	(20 points)
water source, or less than 1000 feet from all other water sources)	No	(0 paints) 0
	Less than 200 feet	(20 points)
Distance to surface water (horizontal distance to all wetlands, playas,	200 feet or more, but less than 1000 feet	(10 points)
irrigation canals, ditches, and perennial and ephemeral watercourses.)	1000 feet or more	(0 points) 0
	Ranking Score (Total Points)	0
mediation start date and end date. (4) Groundwater encountered: No i) Attach soil sample results and a diagram of sample locations and excava Additional Comments: Deep trench bury	_	ft and attach sample results
As per NMOCD Rule 50		
Encapsulate using 12 mil plastic in pit, 20 mil pla	actic cover	
Place 3' clean top soil on top	BSIC COTO	
Seed area with specified seed mixture Estimated start date May 21, 2008		
I hereby certify that the information above is true and complete to the best has been/will be constructed or closed according to NMOCD guidelin DateMay 16, 2008 Printed Name/Title _Kenneth Pearce - Engineer Your certification and NMOCD approval of this application/closure does	es 🖾, a general permit 🗍, or an (attached) alter Signature Not relieve the operator of liability should the contents	native OCD-approved plan
otherwise endanger public health or the environment. Nor does it relieve regulations.	the operator of its responsibility for compliance with	AMAY 3 @ 2000
Approval:	Signature Signed By Miles Beau	MILE Date:
III I OOD HIIOOIM I	rench is to be constructed , samples are to be obtained	

NC to obtaining samples. Samples are to be obtained from pit area and analyses submitted to OCD prior to back-filling.

PRIOR to lining trench.


CONCENTRATIONS of BTEX, TPH and CHLORIDE IN SOIL Fairway Resources - South Red Lake II Unit #57 API # 30-015-36116 EDDY COUNTY, NEW MEXICO


All measurments recorded in mg/kg

							Methods	: EPA SW 84	6-8021B, 503	10			Methods:	SW 846-8015M		EPA 300
SAMPLE DATE	SAMPLE LOCATION	SAMPLE DEPTH	SAMPLE TYPE	SOIL STATUS	BENZENE (mg/Kg)	TOLUENE mg/Kg)	ETHYL- BENZENE (mg/Kg)	m,p- XYLENE (mg/Kg)	o-XYLENE (mg/Kg)	TOTAL XYLENE (mg/Kg)	TOTAL BTEX (mg/Kg)	GRO C ₆ -C ₁₂ (mg/Kg)	DRO C ₁₂ -C ₂₈ (mg/Kg)	ORO C ₂₈ -C ₃₅ (mg/Kg)	TOTAL TPH C ₈ -C ₃₅ (mg/Kg)	Chloride (mg/Kg)
06/11/08	Composite Floor	6 feet bgs	Soil	In-Situ	<0 0010	<0.0020	<0 0010	<0 0020	<0 0010	<0 0020	<0.0020	<171	<17 1	<171	<171	975
學報發致之	5.能源。196世纪194天西部。	"我产生" (**)	The Fidelity of the	1	AND THE STATE OF	呼音 污草	12. 1. 2	TO BE WAS !	15 th 18.0	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	13 / / / / / / / / / / / / / / / / / / /	500 C · G	13" AST	The Contract	編心是·17-729	4的选制整约等
06/26/08	NE-1	10 feet bgs	Soil	In-Situ	<0 0012	<0.0025	<0.0012	< 0.0025	< 0 0012	<0 0025	<0.0025	<18.6	<18 6	<186	<186	174
06/26/08	SE-1	10 feet bgs	Soil	In-Situ	<0 0012	< 0.0023	<0.0012	< 0.0023	<0 0012	<0 0023	<0.0023	<17.5	<17.5	<17.5	<17.5	820
06/26/08	NW-1	10 feet bgs	Soil	In-Situ	<0 0012	< 0.0023	<0.0012	<0 0023	< 0 0012	<0 0023	<0 0023	<17.4	<17.4	<17.4	<174	203
06/28/08	SW-1	10 feet bgs	Soil	tn-Situ	<0 0012	<0 0024	<0 0012	<0 0024	< 0.0012	<0 0024	<0 0024	<179	<17.9	<17.9	<17.9	1,190
一度透出的新產	PERMITTANDS TO THE TOTAL	(中国的)中国	196 M 1864	71 min 45 7 mil	繁安 与中枢	S. S. W. 7 . P. A.	may for the	北京可数署 。	Carry Will	医与神经性	Sho to feel it of	The same of	能力于1986。	数 数 分	The state of the	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
	NMOCD REGULATORY STA	ANDARD			10						50		1		1,000	•

BOLD indicates concentration exceeding NMOCD regulatory standards



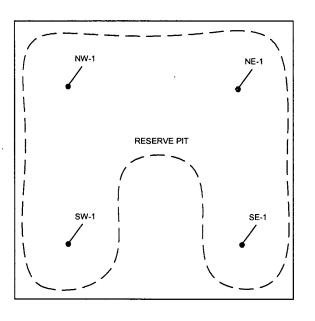

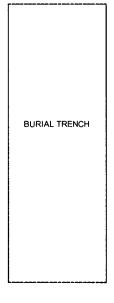



Legend:

Grab Soll Sample Location

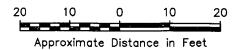


Figure X
Site and Sample
Location Map
Falrway Resources
South Red Lake II Unit
57
Eddy County, NM

Basin Environmental Services

Scale 1" = 20"	CAD By CDS	Checked By CDS	
 October 20, 2008			

Analytical Report 305664


for

Basin Enivronmental Services

Project Manager: Curt Stanley

South Red Lake II Unit # 57
Fairway Operating

17-JUN-08

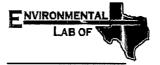

12600 West I-20 East Odessa, Texas 79765

Texas certification numbers: Houston, TX T104704215

Florida certification numbers:
Houston, TX E871002 - Miami, FL E86678 - Tampa, FL E86675
Norcross(Atlanta), GA E87429

South Carolina certification numbers: Norcross(Atlanta), GA 98015

North Carolina certification numbers: Norcross(Atlanta), GA 483

Houston - Dallas - San Antonio - Austin - Tampa - Miami - Latin America Midland - Corpus Christi - Atlanta





17-JUN-08

Project Manager: Curt Stanley Basin Enivronmental Services

P.O. Box 301

Lovington, NM 88260

Reference: XENCO Report No: 305664

South Red Lake II Unit # 57 Project Address: Lea County, NM

Curt Stanley:

We are reporting to you the results of the analyses performed on the samples received under the project name referenced above and identified with the XENCO Report Number 305664. All results being reported under this Report Number apply to the samples analyzed and properly identified with a Laboratory ID number. Subcontracted analyses are identified in this report with either the NELAC certification number of the subcontract lab in the analyst ID field, or the complete subcontracted report attached to this report.

Unless otherwise noted in a Case Narrative, all data reported in this Analytical Report are in compliance with NELAC standards. Estimation of data uncertainty for this report is found in the quality control section of this report unless otherwise noted. Should insufficient sample be provided to the laboratory to meet the method and NELAC Matrix Duplicate and Matrix Spike requirements, then the data will be analyzed, evaluated and reported using all other available quality control measures.

The validity and integrity of this report will remain intact as long as it is accompanied by this letter and reproduced in full, unless written approval is granted by XENCO Laboratories. This report will be filed for at least 5 years in our archives after which time it will be destroyed without further notice, unless otherwise arranged with you. The samples received, and described as recorded in Report No. 305664 will be filed for 60 days, and after that time they will be properly disposed without further notice, unless otherwise arranged with you. We reserve the right to return to you any unused samples, extracts or solutions related to them if we consider so necessary (e.g., samples identified as hazardous waste, sample sizes exceeding analytical standard practices, controlled substances under regulated protocols, etc).

We thank you for selecting XENCO Laboratories to serve your analytical needs. If you have any questions concerning this report, please feel free to contact us at any time.

Respectfully,

Brent Barron, II

Odessa Laboratory Manager

Recipient of the Prestigious Small Business Administration Award of Excellence in 1994.

Certified and approved by numerous States and Agencies.

A Small Business and Minority Status Company that delivers SERVICE and QUALITY

Houston - Dallas - San Antonio - Austin - Tampa - Miami - Atlanta - Corpus Christi - Latin America



Sample Cross Reference 305664



Basin Enivronmental Services, Lovington, NM

South Red Lake II Unit # 57

Sample Id	Matrix	Date Collected	Sample Depth	Lab Sample Id
Composite Floor	S	Jun-11-08 13:20		305664-001



Certificate of Analysis Summary 305664

Basin Enivronmental Services, Lovington, NM

Project Name: South Red Lake II Unit # 57

Project Id: Fairway Operating
Contact: Curt Stanley

Project Location: Lea County, NM

Date Received in Lab: Thu Jun-12-08 08:30 am

Report Date: 17-JUN-08

Project Manager: Brent Barron, II 305664-001 Lab Id: Field Id: Composite Floor Analysis Requested Depth: Matrix: SOIL Jun-11-08 13.20 Sampled: Jun-12-08 09:39 Extracted: BTEX by EPA 8021B Analyzed: Jun-12-08 15:40 Units/RL: mg/kg Benzene ND 0 0010 Toluene ND 0.0020 Ethylbenzene ND 0.0010 m,p-Xylenes ND 0.0020 o-Xylene ND 0.0010 Total Xylenes ND Total BTEX ND Extracted: **Inorganic Anions by EPA 300** Jun-12-08 16 51 Analyzed: Units/RL: mg/kg Chloride 975 25.0 Extracted: **Percent Moisture** Analyzed: Jun-13-08 09:00 Units/RL. RL. Percent Moisture 12.5 1 00 Extracted: Jun-12-08 12:15 TPH by SW8015 Mod Analyzed: Jun-12-08 20:37 Units/RL. mg/kg C6-C12 Gasoline Range Hydrocarbons ND 17 1 C12-C28 Diesel Range Hydrocarbons ND 171 C28-C35 Oil Range Hydrocarbons 171 ND Total TPH ND

This analytical report, and the entire data package it represents, has been made for your exclusive and confidential use. The interpretations and results expressed throughout this analytical report represent the best judgment of XEVCO Laboratories XEVCO Laboratories assumes no responsibility and makes no warranty to the end use of the data hereby presented Our hability is limited to the amount invoiced for this work order unless otherwise agreed to in writing

Since 1990 Houston - Dallas - San Antonio - Austin - Tampa - Miamu - Latin America - Atlanta - Corpus Christi

Brent Barron
Odessa Laboratory Director

XENCO Laboratories

Flagging Criteria

- X In our quality control review of the data a QC deficiency was observed and flagged as noted. MS/MSD recoveries were found to be outside of the laboratory control limits due to possible matrix /chemical interference, or a concentration of target analyte high enough to effect the recovery of the spike concentration. This condition could also effect the relative percent difference in the MS/MSD.
- **B** A target analyte or common laboratory contaminant was identified in the method blank. Its presence indicates possible field or laboratory contamination.
- **D** The sample(s) were diluted due to targets detected over the highest point of the calibration curve, or due to matrix interference. Dilution factors are included in the final results. The result is from a diluted sample.
- E The data exceeds the upper calibration limit; therefore, the concentration is reported as estimated.
- F RPD exceeded lab control limits.
- J The target analyte was positively identified below the MQL(PQL) and above the SQL(MDL).
- U Analyte was not detected.
- L The LCS data for this analytical batch was reported below the laboratory control limits for this analyte.

 The department supervisor and QA Director reviewed data. The samples were either reanalyzed or flagged as estimated concentrations.
- **H** The LCS data for this analytical batch was reported above the laboratory control limits. Supporting QC Data were reviewed by the Department Supervisor and QA Director. Data were determined to be valid for reporting.
- K Sample analyzed outside of recommended hold time.
- * Outside XENCO'S scope of NELAC Accreditation

Recipient of the Prestigious Small Business Administration Award of Excellence in 1994.

Certified and approved by numerous States and Agencies.

A Small Business and Minority Status Company that delivers SERVICE and QUALITY

Houston - Dallas - San Antonio - Austin - Tampa - Miami - Atlanta - Corpus Christi - Latin America

Phone Fax (281) 589-0692 (281) 589-0695 11381 Mcadowglen Lane Suite L Houston, Tx 77082-2647 9701 Harry Hines Blvd , Dallas, TX 75220 (214) 902 0300 (214) 351-9139 5332 Blackberry Drive, Suite 104, San Antonio, TX 78238 (210) 509-3334 (210) 509-3335 (813) 620-2000 (813) 620-2033 2505 N. Falkenburg Rd., Tampa, FL 33619 5757 NW 158th St, Miami Lakes, FL 33014 (305) 823-8500 (305) 823-8555 6017 Financial Dr., Norcross, GA 30071 (770) 449-8800 (770) 449-5477



Project Name: South Red Lake II Unit # 57



Work Order #: 305664

Project ID: Fairway Operating

Lab Batch #: 725340

Sample: 305635-003 S / MS

Matrix: Soil Batch:

Units: mg/kg	SURROGATE RECOVERY STUDY							
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags			
Analytes			[D]					
1,4-Dıfluorobenzene	0.0280	0.0300	93	80-120				
4-Bromofluorobenzene	0.0325	0.0300	108	80-120				

Lab Batch #: 725340

Sample: 305635-003 SD / MSD

Matrix: Soil Batch: 1

Units: mg/kg	SU	SURROGATE RECOVERY STUDY						
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags			
Analytes	('-'	[D]					
1,4-Difluorobenzene	0.0255	0.0300	85	80-120				
4-Bromofluorobenzene	0.0295	0.0300	98	80-120				

Lab Batch #: 725340

Sample: 305664-001 / SMP

Batch: 1

Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY						
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags		
Analytes	""		[D]	,,,,			
1,4-Difluorobenzene	0.0342	0.0300	114	80-120			
4-Bromofluorobenzene	0.0304	0.0300	101	80-120			

Lab Batch #: 725340

Sample: 510556-1-BKS / BKS

Batch: 1

Matrix: Solid

Units: mg/kg	SURROGATE RECOVERY STUDY						
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags		
Analytes			[D]				
1,4-Difluorobenzene	0.0275	0.0300	92	80-120			
4-Bromofluorobenzene	0.0309	0.0300	103	80-120			

Lab Batch #: 725340

Sample: 510556-1-BLK / BLK

Batch: 1

Matrix: Solid

Units: mg/kg	SURROGATE RECOVERY STUDY						
BTEX by EPA 8021B Analytes	Amount Found [A]	True Amount [B]	Recovery %R [D]	Control Limits %R	Flags		
1,4-Difluorobenzene	0.0336	0.0300	112	80-120			
4-Bromofluorobenzene	0.0299	0.0300	100	80-120			

^{**} Surrogates outside limits; data and surrogates confirmed by reanalysis

Surrogate Recovery [D] = 100 * A / B

^{***} Poor recoveries due to dilution



Project Name: South Red Lake II Unit # 57



Work Order #: 305664

Project ID: Fairway Operating

Lab Batch #: 725340

Sample: 510556-1-BSD / BSD

Matrix: Solid Batch:

Units: mg/kg	SURROGATE RECOVERY STUDY						
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags		
Analytes			{D}	ļ			
1,4-Difluorobenzene	0.0279	0.0300	93	80-120			
4-Bromofluorobenzene	0.0311	0.0300	104	80-120			

Lab Batch #: 725343

Sample: 305635-003 S / MS

Batch: 1

Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY						
TPH by SW8015 Mod	Amount Found [A]	True Amount [B]	Recovery %R [D]	Control Limits %R	Flags		
Analytes			(2)				
1-Chlorooctane	86.4	100	86	70-135			
o-Terphenyl	46.9	50.0	94	70-135			

Lab Batch #: 725343

Sample: 305635-003 SD / MSD

Batch: 1

Matrix: Soil

Units: mg/kg	SU	SURROGATE RECOVERY STUDY						
TPH by SW8015 Mod	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags			
Analytes	()	[2]	[D]	/ / /				
1-Chlorooctane	83.1	100	83	70-135				
o-Terphenyl .	45.8	50.0	92	70-135				

Lab Batch #: 725343

Sample: 305664-001 / SMP

Batch: 1

Matrix: Soil

Units: mg/kg	SU	RROGATE R	ECOVERY	STUDY	
TPH by SW8015 Mod	Amount Found [A]	True Amount [B]	Recovery %R [D]	Control Limits %R	Flags
Analytes	00.0				
1-Chlorooctane	82.0	100	82	70-135	
o-Terphenyl	46.2	50.0	92	70-135	

Lab Batch #: 725343

Sample: 510554-1-BKS/BKS

Batch: 1

Matrix: Solid

Units: mg/kg	SURROGATE RECOVERY STUDY								
TPH by SW8015 Mod	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags				
Analytes			[D]						
1-Chlorooctane	94.0	100	94	70-135					
o-Terphenyl	51.0	50.0	102	70-135					

^{**} Surrogates outside limits; data and surrogates confirmed by reanalysis

Surrogate Recovery [D] = 100 * A / B

^{***} Poor recoveries due to dilution







Work Order #: 305664

Project ID: Fairway Operating

Lab Batch #: 725343

Sample: 510554-1-BLK / BLK

Matrix: Solid Batch: 1

Units: mg/kg	SU	RROGATE R	ECOVERY	STUDY	
TPH by SW8015 Mod	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags
Analytes			[D]		
1-Chlorooctane	77.6	100	78	70-135	
o-Terphenyl	44.0	50.0	88	70-135	

Lab Batch #: 725343

Sample: 510554-1-BSD / BSD

Batch: 1

Matrix: Solid

Units: mg/kg	SURROGATE RECOVERY STUDY								
TPH by SW8015 Mod	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags				
Analytes			[D]						
1-Chlorooctane	83.5	100	84	70-135					
o-Terphenyl	46.4	50.0	93	70-135					

Surrogate Recovery [D] = 100 * A / B
All results are based on MDL and validated for QC purposes.

^{**} Surrogates outside limits; data and surrogates confirmed by reanalysis

^{***} Poor recoveries due to dilution



Blank Spike Recovery



Project Name: South Red Lake II Unit # 57

Work Order #: 305664 Fairway Operating Project ID:

Lab Batch #: 725309 Sample: 725309-1-BKS Matrix: Solid Date Analyzed: 06/12/2008 **Date Prepared:** 06/12/2008 Analyst: IRO

Reporting Units: mg/kg Batch #: BLANK /BLANK SPIKE RECOVERY STUDY

Inorganic Anions by EPA 300 Analytes	Blank Result [A]	Spike Added [B]	Blank Spike Result [C]	Blank Spike %R [D]	Control Limits %R	Flags
Chloride	ND	10.0	10.4	104	75-125	



BS / BSD Recoveries



Project Name: South Red Lake II Unit # 57

Work Order #: 305664

Date Prepared: 06/12/2008

Project ID: Fairway Operating Date Analyzed: 06/12/2008

Analyst: SHE

Lab Batch ID: 725340

Sample: 510556-1-BKS

Batch #: 1

Matrix: Solid

Units: mg/kg		BLANK /BLANK SPIKE / BLANK SPIKE DUPLICATE RECOVERY STUDY									
BTEX by EPA 8021B	Blank Sample Result [A]	Spike Added	Blank Spike Result	Blank Spike %R	Spike Added	Blank Spike Duplicate	Blk. Spk Dup. %R	RPD %	Control Limits %R	Control Limits %RPD	Flag
Analytes		[B]	[C]	[D]	[E]	Result [F]	[G]				
Benzene	ND	0.1000	0.1027	103	0.1	0.1012	101	1	70-130	35	
Toluene	ND	0.1000	0.1061	106	0.1	0.1045	105	2	70-130	35	
Ethylbenzene	ND	0.1000	0.1144	114	0.1	0.1127	113	1	71-129	35	
m,p-Xylenes	ND	0.2000	0.2340	117	0.2	0.2301	115	2	70-135	35	
o-Xylene	ND	0.1000	0.1156	116	0.1	0.1136	114	2	71-133	35	

Analyst: ASA **Date Analyzed:** 06/12/2008 **Date Prepared:** 06/12/2008

Matrix: Solid Lab Batch ID: 725343 Batch #: 1 Sample: 510554-1-BKS

Units: mg/kg		BLAN	K/BLANK S	SPIKE / E	BLANK S	PIKE DUPI	ICATE 1	RECOVI	ERY STUD	Y	
TPH by SW8015 Mod Analytes	Blank Sample Result [A]	Spike Added [B]	Blank Spike Result [C]	Blank Spike %R [D]	Spike Added [E]	Blank Spike Duplicate Result [F]	Blk. Spk Dup. %R [G]	RPD %	Control Limits %R	Control Limits %RPD	Flag
	ND	1000	932	02		954	9.5		70-135	25	
C6-C12 Gasoline Range Hydrocarbons C12-C28 Diesel Range Hydrocarbons	ND ND	1000	932	93	1000	854 850	85 85	8	70-135	35	\vdash

Relative Percent Difference RPD = 200*|(D-F)/(D+F)| Blank Spike Recovery [D] = 100*(C)/[B]Blank Spike Duplicate Recovery [G] = 100*(F)/[E] All results are based on MDL and Validated for QC Purposes



Form 3 - MS Recoveries

Project Name: South Red Lake II Unit # 57



Work Order #: 305664

Lab Batch #: 725309

Date Analyzed: 06/12/2008

Date Prepared: 06/12/2008

1

Project ID: Fairway Operating

Analyst: IRO

QC-Sample ID: 305635-001 S

Batch #:

Matrix: Soil

Reporting Units: mg/kg	MATRIX / MATRIX SPIKE RECOVERY ST						
Inorganic Anions by EPA 300 Analytes	Parent Sample Result [A]	Spike Added [B]	Spiked Sample Result [C]	%R [D]	Control Limits %R	Flag	
Chloride	13800	4000	19900	153	75-125	х	

Matrix Spike Percent Recovery [D] = 100*(C-A)/B Relative Percent Difference [E] = 200*(C-A)/(C+B) All Results are based on MDL and Validated for QC Purposes



Form 3 - MS / MSD Recoveries

Project Name: South Red Lake II Unit # 57

Work Order #: 305664

Project ID: Fairway Operating

Lab Batch ID: 725340

QC-Sample ID: 305635-003 S

Matrix: Soil

Date Analyzed: 06/12/2008

Date Prepared: 06/12/2008

Analyst: SHE

Batch #:

Reporting Units: mg/kg

MATRIX SPIKE / MATRIX SPIKE DUPLICATE RECOVERY STUDY

BTEX by EPA 8021B Analytes	Parent Sample Result [A]	Spike Added [B]	Spiked Sample Result [C]	Spiked Sample %R [D]	Spike Added [E]	Duplicate Spiked Sample Result [F]	Spiked Dup. %R [G]	RPD %	Control Limits %R	Control Limits %RPD	Flag
Benzene	ND	0.1000	0.0945	95	0.1000	0.0870	87	9	70-130	35	
Toluene	ND	0.1000	0.0948	95	0.1000	0.0875	88	8	70-130	35	
Ethylbenzene	ND	0.1000	0.1004	100	0.1000	0.0915	92	8	71-129	35	
m,p-Xylenes	ND	0.2000	0.2068	103	0.2000	0.1895	95	8	70-135	35	
o-Xylene	ND	0.1000	0.1053	105	0.1000	0.0952	95	10	71-133	35	

Lab Batch ID: 725343

QC-Sample ID: 305635-003 S

Batch #:

Matrix: Soil

Date Analyzed: 06/12/2008

Date Prepared: 06/12/2008

Analyst: ASA

Reporting Units: mg/kg	MATRIX SPIKE / MATRIX SPIKE DUPLICATE RECOVERY STUDY										
TPH by SW8015 Mod	Parent Sample	Spike	Spiked Sample Result	Sample	Spike	Duplicate Spiked Sample	Spiked Dup.	RPD	Control Limits	Control Limits	Flag
Analytes	Result [A]	Added [B]	[C]	%R [D]	Added [E]	Result [F]	%R [G]	%	%R	%RPD	
C6-C12 Gasoline Range Hydrocarbons	ND	1140	1010	89	1140	968	85	5	70-135	35	
C12-C28 Diesel Range Hydrocarbons	ND	1140	1020	89	1140	976	86	3	70-135	35	



Sample Duplicate Recovery



Project Name: South Red Lake II Unit # 57

Work Order #: 305664

Lab Batch #: 725309

Project ID: Fairway Operating

Date Analyzed: 06/12/2008

Date Prepared: 06/12/2008

Analyst: IRO

QC- Sample ID: 305635-001 D

1 Batch #:

Matrix: Soil

Reporting Units: mg/kg	SAMPLE	SAMPLE / SAMPLE DUPLICATE RECOVERY								
Inorganic Anions by EPA 300	Parent Sample Result [A]	Sample Duplicate Result [B]	RPD	Control Limits %RPD	Flag					
Analyte	}	[Ð]		ł						
Chloride	13800	14200	3	20						

Lab Batch #: 725377

Date Analyzed: 06/13/2008

Date Prepared: 06/13/2008

Analyst: IRO

QC-Sample ID: 305635-001 D

Batch #:

Matrix: Soil

Reporting Units: %

SAMPLE / SAMPLE DUPLICATE RECOVERY

SAMILE / SAMILE DUILICATE RECOVERT									
Result	Sample Duplicate Result	RPD	Control Limits %RPD	Flag					
	(B)	Ì	ĺ						
10.6	9.26	13	20						
	Parent Sample Result [A]	Parent Sample Result [A] Sample Duplicate Result [B]	Parent Sample Result [A] Sample Duplicate Result [B]	Parent Sample Result [A] Sample Duplicate Result [B] Control Limits %RPD					

g
Θ
_
4
으
_
5

Environmental Lab of Texas

CHAIN OF CUSTODY RECORD AND ANALYSIS REQUEST

12600 West I-20 East Odessa, Texas 79765 Phone: 432-563-1800 Fax: 432-563-1713

	Project Manager	Curt Stanley			PAGE 01 C	DF 01											P	rojec	a Na	me.	So	uth	Red	Lal	te il	Un	it#	57			
	Company Name	Basin Environmental Se	rvice T	echnol	ogres, LLC											-		ρ	roje	:4#:	Fal	rwa	y O	pera	ting	1					
	Company Address	P O Box 301														_		Proj	ect (.oc.	Lea	Cou	inty,	NM							
	City/State/Zip.	Lovington, NM 88260																	P) #·											
	Telephone No Sampler Signature	(505) 441-2244	- 14		2511.	Fax No e-mail		_	5) 3				in o	nv c		. •	Repo	rt Fo	nna	t:	X	Stan	dard) TR	RP.			NPDE	\$
(lab use			Th	<u>~ ř</u>	BICLL	سام توسد	_		old	lley	ζωί	145	uve	riv C	OIII			F			7/	1P	Ana	yże l	FOR:	_	_	_	_	٦.	1
ORDER	225	664	•		115 6 55	•		-	De		antio.		- C- C-	catsu		,	otn	上	7	_	TOT	AL	_	#	丰	1				72 hrs	
LAB # (tab use only)		LD CODE	Beginning Depth	Ending Depth	Date Sampled	Time Sampled	peudit i dened	Total # of Containers		CONT			PA-OH OF CO.	Nove Nove		- Drinking Water SL - Sludg	GW - Groundwater 5 - Soilsoil 19	18.0	1X 1005 X 1	Calions (Ca, Mg Na K)	Amout (Cl SO4 Alkalinty)	SARTESPICEC	Metals As Ag Ba Cd Cr Pb Hg Sa	Serrodalies	STEX MOTIONS JETS BIEX 8280	RCI	NORM	Chorides (E - 300)		RUSH TAT Pre Schooute) 24 48,	\Box
61		osite Floor			6/11/2008	1320	-	1	1 -			_	+	+	ľ	_	OIL	Ī	_	Ť	-	~	-	۳	۱¥	4-	۲	Ĭ	廾	╫	x
																		İ						I					工	I	
												\perp		Ţ				L				\perp	\perp	Ţ	L			П	\bot	T	П
<u> </u>			ļ					L	L		\dashv	4	4	1	1	L		\downarrow	┡	Ц	4	1	4	+-	\perp	Ш	Ш	Н	4	\bot	Н
			<u> </u>				_	L	L	_	-	+	+	+	₽	ļ		+	ļ.,	Н	-	+	+	╁	╄-	\vdash	Н	┥	+	╁	Н
			ļ	-				H	-	Н	\dashv	+	+	+-	Н	-	-	╀	⊢	\dashv	+	+	+	╀	╀	Н	Н	Н	-	╫	H
-			-	-			_	H	H	H	\dashv	+	+	+	+	-		╁	+	\vdash	+	+	+	╁	╁	Н	Н	\vdash	+	┿	Н
				-			-	-	H		+	+	+	+		H		t	\vdash	\dashv	+	+	$^{+}$	+-	${\mathsf T}$	H	Н	H	+	十	Н
		······································						_	П		\forall	1	†	+		T		T	\vdash	T	+	7	Ť	十	丅		П	П	十	\top	П
	nstructions Bill to Ba si o Envir																			Sen VO(iple Cs Fe	Cont	atne: if Hea	ment rs Int	act? ace?			(200 X	N	
Relinquist	1	S3 C Date	لمالي	Jo?	Received by	·····			_					1	Da		+	Tim		Cus Cus San	tody tody tple	sea sea Harv	s on s on Del	conti cook ivere	giner er(s) id)		- 7	፟	Z 6 Z	,
Retinquist	ned by	Date	Tsr	me	Received by EL	D D Lun	ء ن					_		6		2/0	8 8	Tim 8 7.	。 30		by S by C	onuo 611 611	or/CE	ent R UP i 15 5 en Re	ep ? 'S ceipt	DHI t		Fedi		one St	

Environmental Lab of Texas

Variance/ Corrective Action Report- Sample Log-In

. . .

0				
Client Basiv Env.				
Date/ Time: (0:12:08 8:30				
ab ID# 305664				
nitials AL				
Constant Description	Ob 1:11-4			
Sample Receipt	CHECKIST		Client Init	مامام
1 Temperature of container/ cooler?	Tes	No	1.0 °C	
2 Shipping container in good condition?	498	No	1.0	
3 Custody Seals intact on shipping container/ cooler?	Yes	No	Not Present	_
4 Custody Seals intact on sample bottles/ container?	860	No	Not Present	7
5 Chain of Custody present?	Mes	No		
6 Sample instructions complete of Chain of Custody?	(es)	No		7
7 Chain of Custody signed when relinquished/ received?	(Yes)	No		
8 Chain of Custody agrees with sample label(s)?	Yes	No	ID written on Cont / Lid	7
9 Container label(s) legible and intact?	/(₹es	No	Not Applicable	\neg
10 Sample matrix/ properties agree with Chain of Custody?	Ves 1	No		
11 Containers supplied by ELOT?	(des)	No		\neg
12 Samples in proper container/ bottle?	(es)	No	See Below	_
13 Samples properly preserved?	(es)	No	See Below	\neg
14 Sample bottles intact?	Yes)	No		
15 Preservations documented on Chain of Custody?	(Yes)	No		\neg
16 Containers documented on Chain of Custody?	Yes	No		
17 Sufficient sample amount for Indicated test(s)?	res	No	See Below	\neg
18 All samples received within sufficient hold time?	X65	No	See Below	
r19 Subcontract of sample(s)?	Yes	No	Not Applicable	\neg
20 VOC samples have zero headspace?	(Yes)	No	Not Applicable	\neg
Contact Contacted by.	mentation		Date/Time	1
Corrective Action Taken:				
Check all that Apply: See attached e-mail/ fax Client understands and wou Cooling process had begun				

Analytical Report 306755

for

Basin Enivronmental Services

Project Manager: Curt Stanley

Fairway- South Red Lake II Unit # 57

08-JUL-08



12600 West I-20 East Odessa, Texas 79765

Texas certification numbers: Houston, TX T104704215

Florida certification numbers:
Houston, TX E871002 - Miami, FL E86678 - Tampa, FL E86675
Norcross(Atlanta), GA E87429

South Carolina certification numbers: Norcross(Atlanta), GA 98015

North Carolina certification numbers: Norcross(Atlanta), GA 483

Houston - Dallas - San Antonio - Austin - Tampa - Miami - Latin America Midland - Corpus Christi - Atlanta





08-JUL-08

Project Manager: Curt Stanley Basin Enivronmental Services

P.O. Box 301

Lovington, NM 88260

Reference: XENCO Report No: 306755

Fairway- South Red Lake II Unit # 57 Project Address: Eddy County, NM

Curt Stanley:

We are reporting to you the results of the analyses performed on the samples received under the project name referenced above and identified with the XENCO Report Number 306755. All results being reported under this Report Number apply to the samples analyzed and properly identified with a Laboratory ID number. Subcontracted analyses are identified in this report with either the NELAC certification number of the subcontract lab in the analyst ID field, or the complete subcontracted report attached to this report.

Unless otherwise noted in a Case Narrative, all data reported in this Analytical Report are in compliance with NELAC standards. Estimation of data uncertainty for this report is found in the quality control section of this report unless otherwise noted. Should insufficient sample be provided to the laboratory to meet the method and NELAC Matrix Duplicate and Matrix Spike requirements, then the data will be analyzed, evaluated and reported using all other available quality control measures.

The validity and integrity of this report will remain intact as long as it is accompanied by this letter and reproduced in full, unless written approval is granted by XENCO Laboratories. This report will be filed for at least 5 years in our archives after which time it will be destroyed without further notice, unless otherwise arranged with you. The samples received, and described as recorded in Report No. 306755 will be filed for 60 days, and after that time they will be properly disposed without further notice, unless otherwise arranged with you. We reserve the right to return to you any unused samples, extracts or solutions related to them if we consider so necessary (e.g., samples identified as hazardous waste, sample sizes exceeding analytical standard practices, controlled substances under regulated protocols, etc).

We thank you for selecting XENCO Laboratories to serve your analytical needs. If you have any questions concerning this report, please feel free to contact us at any time.

Respectfully,

Brent Barron, II

Odessa Laboratory Manager

Recipient of the Prestigious Small Business Administration Award of Excellence in 1994.

Certified and approved by numerous States and Agencies.

A Small Business and Minority Status Company that delivers SERVICE and QUALITY

Houston - Dallas - San Antonio - Austin - Tampa - Miami - Atlanta - Corpus Christi - Latin America



Sample Cross Reference 306755



Basin Enivronmental Services, Lovington, NM

Fairway- South Red Lake II Unit # 57

Sample Id	Matrix	Date Collected Sample Depth	Lab Sample Id
NE-1	S	Jun-26-08 11:00	306755-001
SE-1	S	Jun-26-08 11:05	306755-002
NW-1	S	Jun-26-08 11:10	306755-003
SW-1	S	Jun-26-08 11:15	306755-004



Certificate of Analysis Summary 306755

Basin Enivronmental Services, Lovington, NM

Project Name: Fairway- South Red Lake II Unit # 57

Project Id:
Contact: Curt Stanley

Contact: Curt Stanley
Project Location: Eddy County, NM

Date Received in Lab: Fri Jun-27-08 09:03 am

Report Date: 08-JUL-08

Project Manager: Brent Barron, II

							Froject Miz	mager:	Blein Ballon, II	
Lab Id:	306755-00	DI	306755-0	02	306755-0	003	306755-	004		
Field Id:	NE-1		SE-1		NW-1		SW-1	l		
Depth:										
Matrix:	SOIL		SOIL		SOIL		SOIL			
Sampled:	Jun-26-08 1	1:00	Jun-26-08 1	1:05	Jun-26-08	11:10	Jun-26-08	11:15		
Extracted:	Jun-27-08 0	9·25	Jun-27-08 (9:25	Jun-27-08 (09·25	Jul-02-08	11:00		
Analyzed:	Jun-29-08 2	1.01	Jun-29-08 2	1:25	Jun-29-08 2	21:48	Jul-02-08	16:57		
Units/RL:	mg/kg	RL	mg/kg	RL	mg/kg	RL	mg/kg	RL		
					ND	0.0012	ND	0.0012		
	ND (0.0025			ND	0.0023	ND	0.0024		
			ND	0.0012			ND	0.0012		
	ND (0.0025	ND	0.0023	ND	0 0023	ND	0.0024		
	ND (0.0012	ND	0.0012	ND	0.0012	ND	0.0012		
	ND		ND				ND			
	ND	ND			ND		ND			
Extracted:										
Analyzed:	Jul-01-08 08:51		Jul-01-08 08·51		Jul-01-08 08:51		Jul-01-08 08:51			
Units/RL:	mg/kg	RL	mg/kg	RL	mg/kg	RL	mg/kg	RL		
	174	31.0	820	58.3	203	28.9	1190	59.6		
Extracted:										
Analyzed:	Jun-27-08 1	7·00	Jun-27-08 I	7.00	Jun-27-08 l	17:00	Jun-27-08	17:00		
Units/RL:	%	RL	%	RL	%	RL	%	RL		
	19.3		14.3		13.6		16.1			
Extracted:	Jul-01-08 1	6:05	Jul-01-08 1	6:05	Jul-01-08 1	6 05	Jul-01-08	16·05		
Analyzed:	Jul-03-08 1	6:27	Jul-03-08 1	6:53	Jul-03-08 1	7.20	Jul-03-08	17:46		
Units/RL:	mg/kg	RL	mg/kg	RL	mg/kg	RL	mg/kg	RL		
			ND	17.5	ND					
	ND	186	ND	175	ND	17.4	ND	179		
	ND	18.6	ND	175	ND	17.4	ND	179		
	ND		ND		ND		ND			
	Field Id: Depth: Matrix: Sampled: Extracted: Analyzed: Units/RL: Extracted: Analyzed: Units/RL: Extracted: Analyzed: Units/RL: Extracted: Analyzed: Analyzed: Analyzed: Analyzed: Analyzed:	Field Id:	Field Id: Depth: Matrix: Sampled: Jun-26-08 11:00 Extracted: Jun-27-08 09:25 Analyzed: Jun-29-08 21:01 Units/RL: mg/kg RL ND 0.0012 ND 0.0025 ND 0.0012 ND 0.0025 ND 0.0012 ND ND ND Extracted: Analyzed: Jul-01-08 08:51 Units/RL: mg/kg RL 174 31.0 Extracted: Analyzed: Jun-27-08 17:00 Units/RL: % RL 19.3 Extracted: Analyzed: Jul-01-08 16:05 Analyzed: Jul-03-08 16:27 Units/RL: mg/kg RL ND 18 6 ND 18 6 ND 18 6	Field Id: NE-1 SE-1	SE-1	NE-1	Seld Seld	Lab Id:	Lab Id:	SE-1

This analytical report, and the entire data package it represents, has been made for your exclusive and confidential use. The interpretations and results expressed throughout this analytical report represent the best judgment of XEVCO Laboratories XEVCO Laboratories assumes no responsibility and makes no warranty to the end use of the data hereby presented. Our liability is limited to the amount invoiced for this work order unless otherwise agreed to in writing

Since 1990 Houston - Dallas - San Antonio - Austin - Tampa - Miami - Latin America - Atlanta - Corpus Christi

Brent Barron
Odessa Laboratory Director

XENCO Laboratories

Flagging Criteria

- X In our quality control review of the data a QC deficiency was observed and flagged as noted. MS/MSD recoveries were found to be outside of the laboratory control limits due to possible matrix /chemical interference, or a concentration of target analyte high enough to effect the recovery of the spike concentration. This condition could also effect the relative percent difference in the MS/MSD.
- **B** A target analyte or common laboratory contaminant was identified in the method blank. Its presence indicates possible field or laboratory contamination.
- **D** The sample(s) were diluted due to targets detected over the highest point of the calibration curve, or due to matrix interference. Dilution factors are included in the final results. The result is from a diluted sample.
- E The data exceeds the upper calibration limit; therefore, the concentration is reported as estimated.
- F RPD exceeded lab control limits.
- J The target analyte was positively identified below the MQL(PQL) and above the SQL(MDL).
- U Analyte was not detected.
- L The LCS data for this analytical batch was reported below the laboratory control limits for this analyte. The department supervisor and QA Director reviewed data. The samples were either reanalyzed or flagged as estimated concentrations.
- H The LCS data for this analytical batch was reported above the laboratory control limits. Supporting QC Data were reviewed by the Department Supervisor and QA Director. Data were determined to be valid for reporting.
- K Sample analyzed outside of recommended hold time.
- * Outside XENCO'S scope of NELAC Accreditation

Recipient of the Prestigious Small Business Administration Award of Excellence in 1994.

Certified and approved by numerous States and Agencies.

A Small Business and Minority Status Company that delivers SERVICE and QUALITY

Houston - Dallas - San Antonio - Austin - Tampa - Miami - Atlanta - Corpus Christi - Latin America

Phone	Fax
(281) 589-0692	(281) 589-0695
(214) 902 0300	(214) 351-9139
(210) 509-3334	(210) 509-3335
(813) 620-2000	(813) 620-2033
(305) 823-8500	(305) 823-8555
(770) 449-8800	(770) 449-5477
	(281) 589-0692 (214) 902 0300 (210) 509-3334 (813) 620-2000 (305) 823-8500







Work Order #: 306755

Project ID:

Lab Batch #: 726690

Sample: 306745-009 S / MS

Batch:

Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY									
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags					
Analytes			[D]							
1,4-Difluorobenzene	0.0295	0.0300	98	80-120						
4-Bromofluorobenzene	0.0338	0.0300	113	80-120						

Lab Batch #: 726690

Sample: 306745-009 SD / MSD

Batch: 1

Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY									
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags					
Analytes			[D]							
1,4-Difluorobenzene	0.0310	0.0300	103	80-120	(
4-Bromofluorobenzene	0.0288	0.0300	96	80-120						

Lab Batch #: 726690

Sample: 306755-001 / SMP

Batch: 1

Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY									
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags					
Analytes			[D]							
1,4-Dıfluorobenzene	0.0335	0.0300	112	80-120						
4-Bromofluorobenzene	0.0302	0.0300	101	80-120						

Lab Batch #: 726690

Sample: 306755-002 / SMP

Batch: 1

Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY									
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags					
Analytes			[D]							
1,4-Difluorobenzene	0.0334	0.0300	111	80-120						
4-Bromofluorobenzene	0.0294	0.0300	98	80-120						

Lab Batch #: 726690

Sample: 306755-003 / SMP

Batch: 1

Matrix: Soil


Units: mg/kg	SURROGATE RECOVERY STUDY									
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags					
Analytes			[D]							
1,4-Difluorobenzene	0.0334	0.0300	111	80-120	,					
4-Bromofluorobenzene	0.0302	0.0300	101	80-120						

^{**} Surrogates outside limits; data and surrogates confirmed by reanalysis

Surrogate Recovery [D] = 100 * A / B

^{***} Poor recoveries due to dilution



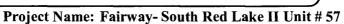



Work Order #: 306755

Project ID:

Lab Batch #: 726690

Sample: 511311-1-BKS / BKS

Matrix: Solid Batch:

Units: mg/kg	SURROGATE RECOVERY STUDY									
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags					
Analytes	11		[D]							
1,4-Difluorobenzene	0.0283	0.0300	94	80-120						
4-Bromofluorobenzene	0.0326	0.0300	109	80-120						

Lab Batch #: 726690

Sample: 511311-1-BLK / BLK

Batch: 1

Matrix: Solid

Units: mg/kg	SURROGATE RECOVERY STUDY					
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags	
Analytes			[D]			
1,4-Difluorobenzene	0.0337	0.0300	112	80-120		
4-Bromofluorobenzene	0.0297	0.0300	99	80-120		

Lab Batch #: 726690

Sample: 511311-1-BSD / BSD

Batch: 1

Matrix: Solid

Units: mg/kg	SURROGATE RECOVERY STUDY					
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags	
Analytes			(D)			
1,4-Difluorobenzene	0.0276	0.0300	92	80-120		
4-Bromofluorobenzene	0.0317	0.0300	106	80-120		

Lab Batch #: 727018

Sample: 306383-002 S / MS

Batch: 1

Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY					
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags	
Analytes			{ D }	1		
1,4-Difluorobenzene	0.0288	0.0300	96	80-120		
4-Bromofluorobenzene	0.0357	0 0300	119	80-120		

Lab Batch #: 727018

Sample: 306383-002 SD / MSD

Batch: 1

Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY					
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags	
Analytes			[D]			
1,4-Difluorobenzene	0.0282	0.0300	94	80-120		
4-Bromofluorobenzene	0.0245	0.0300	82	80-120		

^{**} Surrogates outside limits; data and surrogates confirmed by reanalysis

Surrogate Recovery [D] = 100 * A / B

^{***} Poor recoveries due to dilution





Project Name: Fairway-South Red Lake II Unit # 57

Work Order #: 306755

Project ID:

Lab Batch #: 727018

Sample: 306755-004 / SMP

Batch: Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY					
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags	
Analytes			[D]			
1,4-Difluorobenzene	0.0335	0.0300	112	80-120		
4-Bromofluorobenzene	0.0304	0.0300	101	80-120		

Lab Batch #: 727018

Sample: 511515-1-BKS / BKS

Batch: 1

Matrix: Solid

Units: mg/kg	SURROGATE RECOVERY STUDY					
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags	
Analytes			[D]			
1,4-Difluorobenzene	0.0285	0.0300	95	80-120		
4-Bromofluorobenzenc	0.0328	0.0300	109	80-120		

Lab Batch #: 727018

Sample: 511515-1-BLK / BLK

Batch: i

Matrix: Solid

Units: mg/kg	SURROGATE RECOVERY STUDY					
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags	
Analytes			[D]			
1,4-Difluorobenzene	0.0349	0.0300	116	80-120		
4-Bromofluorobenzene	0.0308	0.0300	103	80-120		

Lab Batch #: 727018

Sample: 511515-1-BSD / BSD

Batch: 1

Matrix: Solid

Units: mg/kg	SURROGATE RECOVERY STUDY					
BTEX by EPA 8021B	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags	
Analytes		, ,	[D]			
1,4-Difluorobenzene	0.0283	0.0300	94	80-120		
4-Bromofluorobenzene	0.0329	0.0300	110	80-120		

Lab Batch #: 727132

Sample: 306754-001 S / MS

Batch: 1

Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY				
TPH by SW8015 Mod	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags
Analytes			[D]		
1-Chlorooctane	92.6	100	93	70-135	
o-Terphenyl	49.0	50.0	98	70-135	

^{**} Surrogates outside limits, data and surrogates confirmed by reanalysis

Surrogate Recovery [D] = 100 * A / B

^{***} Poor recoveries due to dilution





Project Name: Fairway-South Red Lake II Unit # 57

Work Order #: 306755

Project ID:

Lab Batch #: 727132

Sample: 306754-001 SD / MSD

Matrix: Soil Batch:

Units: mg/kg	SURROGATE RECOVERY STUDY					
TPH by SW8015 Mod	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags	
Analytes		,	[D]			
1-Chlorooctane	82.5	100	83	70-135		
o-Terphenyl	45.1	50.0	90	70-135		

Lab Batch #: 727132

Sample: 306755-001 / SMP

Batch: 1

Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY					
TPH by SW8015 Mod	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags	
Analytes			[D]			
1-Chlorooctanc ·	79.4	100	79	70-135		
o-Terphenyl	44.2	50.0	88	70-135		

Lab Batch #: 727132

Sample: 306755-002 / SMP

Batch: 1

Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY					
TPH by SW8015 Mod Analytes	Amount Found [A]	True Amount [B]	Recovery %R [D]	Control Limits %R	Flags	
I-Chlorooctane	78.8	100	79	70-135		
o-Terphenyl	44.1	50.0	88	70-135		

Lab Batch #: 727132

Sample: 306755-003 / SMP

Batch: 1

Matrix: Soil

Units: mg/kg	SURROGATE RECOVERY STUDY								
TPH by SW8015 Mod	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags				
Analytes		,	[D]						
1-Chlorooctane	79.4	100	79	70-135					
o-Terphenyl	44.2	50.0	88	70-135					

Lab Batch #: 727132

Sample: 306755-004 / SMP

Batch: 1

Matrix: Soil


Units: mg/kg	SU	SURROGATE RECOVERY STUDY Amount True Control								
TPH by SW8015 Mod Analytes	Amount Found [A]	True Amount [B]	Recovery %R [D]	Control Limits %R	Flags					
1-Chlorooctane	78.4	100	78	70-135						
o-Terphenyl	44.4	50.0	89	70-135						

^{**} Surrogates outside limits; data and surrogates confirmed by reanalysis

Surrogate Recovery [D] = 100 * A / B

^{***} Poor recoveries due to dilution



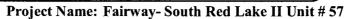



Work Order #: 306755

Project ID:

Lab Batch #: 727132

Sample: 511576-1-BKS / BKS

Matrix: Solid Batch:

TPH by SW8015 Mod Analytes	SU	SURROGATE RECOVERY STUDY Amount True Control									
TPH by SW8015 Mod	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags						
Analytes	11	(2)	[D]	, , , ,							
1-Chlorooctane	91.7	100	92	70-135							
o-Terphenyl	50.3	50.0	101	70-135							

Lab Batch #: 727132

Sample: 511576-1-BLK / BLK

Batch: 1

Matrix: Solid

Units: mg/kg	SU	RROGATE R	ECOVERY	STUDY	
TPH by SW8015 Mod Analytes	Amount Found [A]	True Amount [B]	Recovery %R [D]	Control Limits %R	Flags
1-Chlorooctane	89.2	100	89	70-135	
o-Terphenyl	49.2	50.0	98	70-135	

Lab Batch #: 727132

Sample: 511576-1-BSD / BSD

Batch: 1

Matrix: Solid

Units: mg/kg	SU	RROGATE R	ECOVERY	STUDY	SURROGATE RECOVERY STUDY									
TPH by SW8015 Mod	Amount Found [A]	True Amount [B]	Recovery %R	Control Limits %R	Flags									
Analytes			[D]											
1-Chlorooctane	95.4	100	95	70-135										
o-Terphenyl	52.0	50.0	104	70-135										

^{**} Surrogates outside limits; data and surrogates confirmed by reanalysis

^{***} Poor recoveries due to dilution Surrogate Recovery [D] = 100 * A / B



Blank Spike Recovery



Project Name: Fairway-South Red Lake II Unit # 57

Work Order #: 306755

Project ID:

Lab Batch #: 726918

Sample: 726918-1-BKS

Matrix: Solid

Date Analyzed: 07/01/2008

Date Prepared: 07/01/2008

Analyst: LATCOR

Reporting Units: mg/kg	Batch #: 1	BLANK/I	K/BLANK SPIKE RECOVERY STUI							
Inorganic Anions by EPA 300	Blank Result	Spike Added	Blank Spike	Blank Spike	Control Limits	Flags				
Analytes	[A]	[B]	Result [C]	%R [D]	%R					
Chloride	ND	10.0	10.8	108	75-125					

Blank Spike Recovery [D] = 100*[C]/[B]All results are based on MDL and validated for QC purposes.



BS / BSD Recoveries



Project Name: Fairway-South Red Lake II Unit # 57

Work Order #: 306755 Analyst: BRB

Date Prepared: 06/27/2008

Project ID:

Date Analyzed: 06/29/2008

Lab Batch ID: 726690

Sample: 511311-1-BKS

Batch #: 1

Matrix: Solid

Units: mg/kg	<u>L</u>	BLANK /BLANK SPIKE / BLANK SPIKE DUPLICATE RECOVERY STUDY										
BTEX by EPA 8021B	Blank Sample Result [A]	Spike Added	Blank Spike Result	Blank Spike %R	Spike Added	Blank Spike Duplicate	Blk. Spk Dup. %R	RPD %	Control Limits %R	Control Limits %RPD	Flag	
Analytes		[B]	[C]	[D]	[E]	Result [F]	[G]					
Benzene	ND	0.1000	0.0953	95	0.1	0.1024	102	7	70-130	35		
Toluene	ND	0.1000	0.0913	91	0.1	0.0978	98	7	70-130	35		
Ethylbenzene	ND	0.1000	0.0977	98	0.1	0.1057	106	8	71-129	35		
m,p-Xylenes	ND	0.2000	0.1962	98	0.2	0.2122	106	8	70-135	35	<u> </u>	
o-Xylene	ND	0.1000	0.0982	98	0.1	0.1063	106	8	71-133	35		

Analyst: BRB

Date Prepared: 07/02/2008

Date Analyzed: 07/02/2008

Lab Batch ID: 727018

Sample: 511515-1-BKS

Batch #: 1

Matrix: Solid

Units: mg/kg	BLANK /BLANK SPIKE / BLANK SPIKE DUPLICATE RECOVERY STUDY										
BTEX by EPA 8021B	Blank Sample Result [A]	Spike Added	Blank Spike Result	Blank Spike %R	Spike Added	Blank Spike Duplicate	Blk. Spk Dup. %R	RPD %	Control Limits %R	Control Limits %RPD	Flag
Analytes		[B]	[C]	[D]	[E]	Result [F]	[G]		1		
Benzene	ND	0.1000	0.0850	85	0.1	0.0874	87	3	70-130	35	
Toluene	ND	0.1000	0.0829	83	0.1	0.0853	- 85	3	70-130	35	
Ethylbenzene	ND	0.1000	0.0942	94	0.1	0.0968	97	3	71-129	35	
m,p-Xylenes	ND	0.2000	0.1919	96	0.2	0.1974	99	3	70-135	35	
o-Xylene	ND	0.1000	0.0933	93	0.1	0.0961	96	3	71-133	35	

Relative Percent Difference RPD = 200*|(D-F)/(D+F)|
Blank Spike Recovery [D] = 100*(C)/[B]
Blank Spike Duplicate Recovery [G] = 100*(F)/[E]
All results are based on MDL and Validated for QC Purposes



BS / BSD Recoveries



Project Name: Fairway-South Red Lake II Unit # 57

Work Order #: 306755

Project ID:

Analyst: ASA

Date Prepared: 07/01/2008

Date Analyzed: 07/03/2008

Lab Batch ID: 727132

Sample: 511576-1-BKS

Batch #: 1

Matrix: Solid

Units: mg/kg		BLANK BLANK SPIKE / BLANK SPIKE DUPLICATE RECOVERY STUDY									
TPH by SW8015 Mod Analytes	Blank Sample Result [A]	Spike Added [B]	Blank Spike Result [C]	Blank Spike %R [D]	Spike Added	Blank Spike Duplicate Result [F]	Blk. Spk Dup. %R [G]	RPD %	Control Limits %R	Control Limits %RPD	Flag
C6-C12 Gasoline Range Hydrocarbons	ND	1000	822	82	1000	846	85	3	70-135	35	
C12-C28 Diesel Range Hydrocarbons	ND	1000	803	80	1000	830	83	3	70-135	35	

Relative Percent Difference RPD = 200*|(D-F)/(D+F)|Blank Spike Recovery [D] = 100*(C)/[B]Blank Spike Duplicate Recovery [G] = 100*(F)/[E]All results are based on MDL and Validated for QC Purposes



Form 3 - MS Recoveries

Project Name: Fairway-South Red Lake II Unit # 57



Work Order #: 306755

Lab Batch #: 726918

Date Prepared: 07/01/2008

Project ID:

Date Analyzed: 07/01/2008

Analyst: LATCOR

QC-Sample ID: 306754-001 S

Batch #:

Matrix: Soil

Reporting Units: mg/kg	MATRIX / MATRIX SPIKE RECOVERY STUDY							
Inorganic Anions by EPA 300 Analytes	Parent Sample Result [A]	Spike Added [B]	Spiked Sample Result [C]	%R [D]	Control Limits %R	Flag		
Chloride	413	1160	1840	123	75-125			



Form 3 - MS / MSD Recoveries

Project Name: Fairway-South Red Lake II Unit # 57



Work Order #: 306755

Project ID:

Lab Batch ID: 726690 Date Analyzed: 06/29/2008

QC- Sample ID: 306745-009 S

Matrix: Soil Batch #:

Date Prepared: 06/27/2008

Analyst: BRB

Reporting Units: mg/kg	MATRIX SPIKE / MATRIX SPIKE DUPLICATE RECOVERY STUDY										
BTEX by EPA 8021B	Parent Sample Result	Spike Added	Spiked Sample Result [C]	Spiked Sample %R	Spike Added	Duplicate Spiked Sample Result [F]	Spiked Dup. %R	RPD %	Control Limits %R	Control Limits %RPD	Flag
Analytes	[A]	[B]		[D]	[E]	Result [1]	[G]	/0	/•••	/ortin	
Benzene	ND	0.1014	0.0645	64	0.1014	0.0286	28	78	70-130	78	Х
Toluene	ND	0.1014	0.0572	56	0.1014	0.0275	27	70	70-130	70	Х
Ethylbenzene	ND	0.1014	0.0537	53	0.1014	0.0254	25	72	71-129	72	Х
m,p-Xylenes	ND	0.2028	0.1066	53	0.2028	0.0489	24	75	70-135	75	Х
o-Xylene	ND	0.1014	0.0532	52	0.1014	0.0301	30	54	71-133	54	Х

Lab Batch ID: 727018

QC- Sample ID: 306383-002 S

Batch #:

Matrix: Soil

Date Analyzed: 07/02/2008

Date Prepared: 07/02/2008

Analyst: BRB

Reporting Units: mg/kg	MATRIX SPIKE / MATRIX SPIKE DUPLICATE RECOVERY STUDY										
BTEX by EPA 8021B	Parent Sample	Spike	Spiked Sample Result	Sample	Spike	Duplicate Spiked Sample	-	RPD	Control Limits	Control Limits	Flag
Analytes	Result [A]	Added [B]	[C]	%R [D]	Added [E]	Result [F]	%R [G]	%	%R	%RPD	
Benzene	0.0014	0.1062	0.0712	66	0.1062	0.0583	54	20	70-130	35	XF
Toluene	ND	0.1062	0.0630	59	0.1062	0.0493	46	25	70-130	35	XF
Ethylbenzene	0.0012	0.1062	0.0589	54	0.1062	0.0398	36	40	71-129	35	Х
m,p-Xylenes	0.0023	0.2124	0.1176	54	0.2124	0.0709	32	51	70-135	35	Х
o-Xylene	0.0012	0.1062	0.0601	55	0.1062	0.0432	40	32	71-133	35	XF

Matrix Spike Percent Recovery [D] = 100*(C-A)/B Relative Percent Difference RPD = 200*(D-G)/(D+G) Matrix Spike Duplicate Percent Recovery [G] = 100*(F-A)/E



Form 3 - MS / MSD Recoveries

Project Name: Fairway- South Red Lake II Unit # 57

Work Order #: 306755

Project ID:

Lab Batch ID: 727132

QC- Sample ID: 306754-001 S

Batch #:

Matrix: Soil

Date Analyzed: 07/03/2008

Date Prepared: 07/01/2008

Analyst: ASA

Deporting United marks

Reporting Units: mg/kg		M	IATRIX SPIKI	RIX SPIKE / MATRIX SPIKE DUPLICATE RECOVERY STUDY													
TPH by SW8015 Mod	Parent Sample	Spike	Spiked Sample Result	Sample		Duplicate Spiked Sample		RPD	Control Limits	Control Limits	Flag						
Analytes	Result [A]	Added [B]	[C]	%R [D]	Added [E]	Result [F]	%R [G]	%	%R	%RPD							
C6-C12 Gasoline Range Hydrocarbons	ND	1160	949	82	1160	861	74	10	70-135	35							
C12-C28 Diesel Range Hydrocarbons	ND	1160	911	79	1160	831	72	9	70-135	35							

Matrix Spike Percent Recovery [D] = 100*(C-A)/B Relative Percent Difference RPD = 200*(D-G)/(D+G) Matrix Spike Duplicate Percent Recovery [G] = 100*(F-A)/E



Sample Duplicate Recovery



Project Name: Fairway-South Red Lake II Unit #57

Work Order #: 306755

Lab Batch #: 726918

Project ID:

Date Analyzed: 07/01/2008

Date Prepared: 07/01/2008

Analyst: LATCOR

QC-Sample ID: 306754-001 D

Batch #:

Matrix: Soil

Reporting Units: mg/kg	SAMPLE /	SAMPLE / SAMPLE DUPLICATE RECOVERY										
Inorganic Anions by EPA 300	Parent Sample Result [A]	Sample Duplicate Result	RPD	Control Limits %RPD	Flag							
Analyte		[B]										
Chloride	413	407	1	20								

Lab Batch #: 726607

Date Analyzed: 06/27/2008

Date Prepared: 06/27/2008

Analyst: JLG

QC- Sample ID: 306745-015 D

Batch #: 1

Matrix: Soil

Reporting Units: %

SAMPLE / SAMPLE DUPLICATE RECOVERY

Percent Moisture Analyte	Parent Sample Result [A]	Sample Duplicate Result [B]	RPD	Control Limits %RPD	Flag
Percent Moisture	1.07	ND	NC	20	

œ.
9
_
œ
₫,
_
~

Environmental Lab of Texas

CHAIN OF CUSTODY RECORD AND ANALYSIS REQUEST

12800 West I-20 East Odessa, Texas 79765 Phone: 432-563-1906 Fax: 432-863-1713

	Project Manager Curt Stanley			PAGE 01 C	0F 01										P	rojec	t Na	me:_	Fair	way	<u>- s</u>	out	h R	ed l	<u>ak</u>	<u> </u>	Unit :	#57	
	Company Name Basin Environment	al Service	Techno	logine, LLC											-	Pi	rojec	a ø.											
	Company Address: 2800 Plains Hwy										_					Proj	ect L	oc.	Eddy	Cou	inty.	NM	_						
	City/State/Zip. Lovington, NM 8820	50					_		_								PC) #·_											
	Telephone No (805) 441-9244 Sampler Signature	P.			Fax No:		_			429	ası	nen	IV C	om.	Repo	nt Fo	rmai	. [X e	itand	ard			TR	RP		□ N	PDE:	s
(lab use		7					-			7	<u> </u>			2711						_	\nai	/Ze l	or	_	_	_		T .	1
ORDER																F		_	TOTA		Ė	t	X	1				5	1
AB # (tab use only)	(W) (W) (W)	Seginning Depth	Ending Depth	Sampled	Time Sampled	old Filtered	of Contamers			123		of Co.		Other (Specify)	DW-Combrig Wester St. «Studge CW - Groundwater St. SoarSald IRPHIGE PROSPER X	١	TX 1005 TX 1008	Z.	Amoras (Ci. BO4 Alkalmety)	Metals. As An Ba Cd Cr. Ph No Se		Serrivolatiles	BTEX 80215/8039 AF BTEX 8280		2	bpe E 300		RUSH TAT (Pre-Belocke) 24. 48.	Standard TAT
3	FIELD CODE	je Page	Endir	Date	Tume	pied F	Totale	2	HNO	HCI (NOA)	4,50,	¥ \$	į	8	D-MO	Ĕ	₫.	g g		1 4	Votaties	Sentity	A S	1₽	NORM	Chloridge		<u>8</u>	Stand
01	NE-1			6/26/2008	1100		1	х		х	\perp	1			Soil	X	П	\Box	Ţ	I	Γ		x	L		x	\perp	I	X
02	SE-1		_	6/26/2008	1105	L	1	×	_	Х	4	1	1	L,	Soil	х	Ц	4	\perp	\perp	_	L	X	Ļ	Ш	X	4	╀	X
03	NW-1		├	6/26/2008	1110		1	×	_	×	4	\perp	↓_	L	Soll	X	Ц		4	_	↓-	_	×	╄	\sqcup	X	+	+	X
104	SW-1		┼	6/26/2008	1115	Н	1	X	4	×	+	+	+	Н	Soil	×	H	4	+	1	╀	├-	×	-	Н	×	-	╀	X
			┼	-		Н	Н	Н	\dashv	+	+	+	╁	Н		╀	Н	\dashv	+	+	╀	┝	H	⊦	Н	H	-+	╀	H
			 				\vdash	Н			╁	+	╁	Н			Н	+	┿	╁	╂╌	┞	L	Н	Н	\vdash	+	十	Н
			-			H	_		-+	+	+	+	-	Н		╁		-+	+	╁	╁╴	-	_	H		П	十	十	H
								П	T	1	T	T		П				┪	十	T	Г	T						T	
											Ι	I							I	Ι	L						I		
Special i	Bill to Basin Enviro	nmental													•			Sam	ple C	ry Co ontai e of i	ners	Inte	ď7			8	9	N N	
Felhquish	42	102 9	™• ბკ	Received by				_						Da		Time	·]	Labe Cust Cust	is on ody s ody s	cont cals cals	eine: on c	r(s) ontai ooler	iner(r(s)			((A. (B. (B. (B. (B. (B. (B. (B. (B. (B. (B	N 2 0	,
Reinquish	ed by Dati	' "	me .	Received by				_			-			Da	te	Time	'	ь	y Sar	end (npter mer?	Kile	nt Re	0 ?	DHI				N N onsSi	tar
Relinquish	ed by Date	1	m e	Received by ELO		يرا	<u>~</u>						6	77		Time	3	Tem	erati		Z 9 pon	Rec	<u> </u>			_	٠. د	*C	

Environmental Lab of Texas

Variance/ Corrective Action Report- Sample Log-In

, u . • •

Client:	Basin bow.			
Date/ Time	6.17.08 9.03			
Lab ID#	304155			
Initials	<u>ar</u>			
	Sample Receipt	Checkilst		
				Client Initials
	sture of container/ cooler?	Y BE	No	5.5 °C
	container in good condition?	Yes	No	
	Seals intact on shipping container/ cooler?	Yes	No	MoLPresent
	Seals intect on sample bottles/ container?	(e)	No	Not Present
	Custody present?	(es	No	
	instructions complete of Chain of Custody?	Ve2	No	
	Custody signed when relinquished/ received?	(es)	No	
	Custody agrees with sample label(s)?	(es	No	ID written on Cont / Ltd
	er label(s) legible and intact?	(es	No	Not Applicable
#10 Sample	matrix/ properties agree with Chain of Custody?	Xes	No_	
	iers supplied by ELOT?	tes	No	
#12 Sample	s in proper container/ bottle?	Ves	No	See Below
	s properly preserved?	Yes	No	See Below
	bottles intact?	Yes	No	
#15 Preserv	vations documented on Chain of Custody?	(6)	No	
#16 Contain	ners documented on Chain of Custody?	(B)	No	
#17 Sufficie	nt sample amount for indicated test(s)?	Yas	No	See Below
#18 All sam	ples received within sufficient hold time?	Yes	No	See Below
#19 Subcor	ntract of sample(s)?	Yes	No	Not Applicable
#20 VOC sa	amples have zero headspace?	Yes	No	Not Applicable
	Variance Docu	mentation		
Contact:	Contacted by			Date/ Time:
COMBO!	January Sy			Date: Time.
Regarding				
Corrective A	cuon Taken:			
			,	
Check all tha	et Appty See attached e-mail/ fax Client understands and wou	ld like to proc	ceed with	n analysis
	Cooling process had begun	shortly after	sampling	g event