

Submit 1 Copy To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
October 13, 2009

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-005-60689
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Yates Petroleum Corporation		6. State Oil & Gas Lease No. V-5650
3. Address of Operator 105 South Fourth Street, Artesia, NM 88210		7. Lease Name or Unit Agreement Name Hook AWX State
4. Well Location Unit Letter <u>G</u> : <u>1980</u> feet from the <u>North</u> line and <u>1980</u> feet from the <u>East</u> line Section <u>8</u> Township <u>10S</u> Range <u>26E</u> NMPM Chaves County		8. Well Number 1
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3800' GR		9. OGRID Number 025575
		10. Pool name or Wildcat Foor Ranch Pre-Perm, SW

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including anticipated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. MIRU WSC. Rig up any safety equipment needed. No casing recovery will be attempted.
2. Set a CIBP @ 6136' and top with 35' cement. This will place a plug over the Ordovician perforations.
3. Set a CIBP @ 5924' and top with 35' cement. This will place a plug over the Mississippian perforations.
4. Set a CIBP @ 5080' and top with 35' cement. This will place a plug over the Wolfcamp perforations.
5. Spot a 25 sx Class "C" cement plug from 4366'-4466'. This will place a 100' plug across the top of the Abo.
6. Perforate and spot a 30 sx Class "C" cement plug from 2152'-2252'. This will place a 100' plug across the top of the Glorieta. -tag
7. Perforate and spot a 30 sx Class "C" cement plug from 876'-976'. This will place a 100' plug across the Surface Casing shoe. WOC and tag plug.
8. Spot a 15 sx Class "C" cement plug from 60' up to the surface.
9. Remove all surface equipment, weld dry hole marker & clean location as per regulations.

Spud Date:

Rig Release Date:

RECEIVED

APR 21 2011

NMOCD ARTESIA

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Craig Aton TITLE Regulatory Compliance Technician DATE April 21, 2011


Type or print name Craig Aton E-mail address: caton@yatespetroleum.com PHONE: 575-748-4385

For State Use Only

APPROVED BY: [Signature] TITLE Approval Granted providing work is complete by 7/25/2011 DATE 4/25/2011
Conditions of Approval (if any):

WELLNAME: Hook "A" State 1 FIELD: Fair Ranch
 LOCATION: 1980' EN & 1980' EE G 8-105-26E Chaves County
 GL: 3800' ZERO: _____ AGL: _____ KB: 3809'
 SPUD DATE: _____ COMPLETION DATE: _____
 COMMENTS: (Formerly: Sinkhole NR. State Com 1)

CASING PROGRAM	
SIZE/WT/GR/CONN	DEPTH SET
8 5/8" 24# J55	(926')
5 1/2" 14# K55	1936'
5 1/2" 15.50 #14, J-55, ST&C	6580'

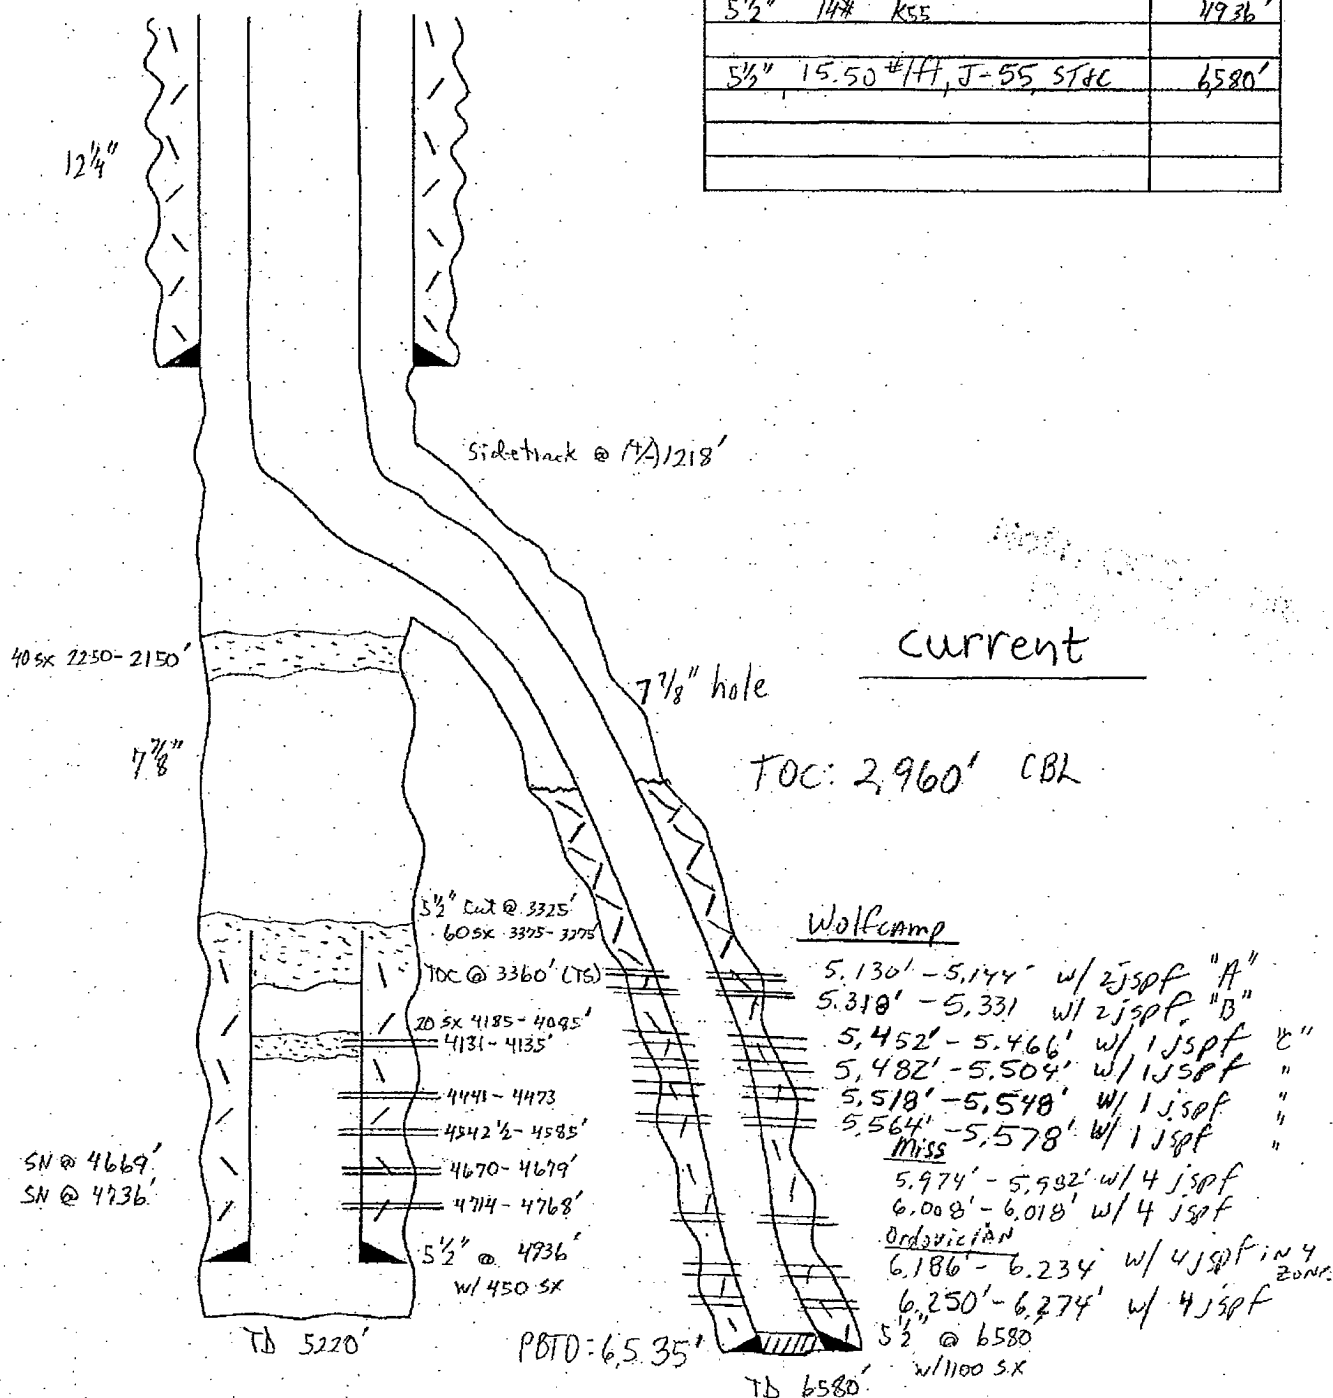

- SKETCH NOT TO SCALE -

DATE: 12-28-00 JD
1/31/01 JWP

WELLNAME: Hook "A" State 1 FIELD: Farm Ranch
 LOCATION: 1980' EN & 1980' EE G 8-105-26E Chaves County
 GL: 3800 ZERO: _____ AGL: _____ KB: 3809'
 SPUD DATE: _____ COMPLETION DATE: _____
 COMMENTS: (Formerly: Sinkhole NR State Com 1)

CASING PROGRAM		
SIZE/WT/GR/CONN		DEPTH SET
8 5/8" 24# J55		(926')
5 1/2" 14# K55		4936'
5 1/2" 15.50 #11T, J-55 ST&C		6580'

60' surface plug, 15sxs

12 1/4"


100' cmt plug

876' - 976', 30sxs

40 SX 2250' - 2150'

7 7/8"

SN @ 4669'
SN @ 4736'

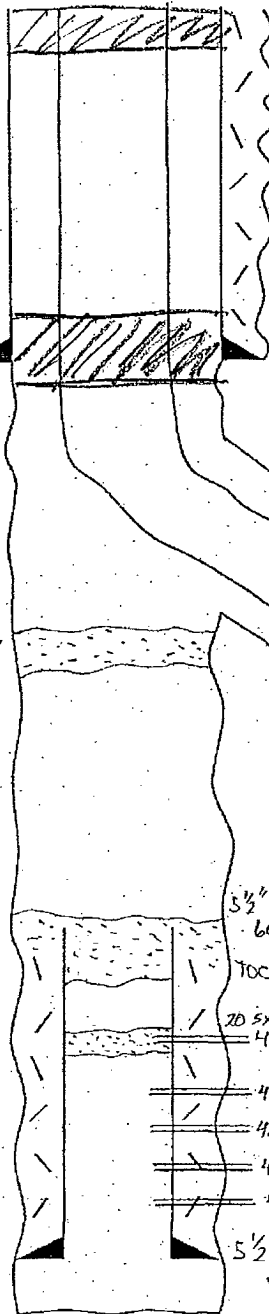

Sinkhole @ 1980' / 218'

FORMATION TOPS		
San Andres	1003'	WC 5129'
Glorieta	2202'	Cisco 5706'
Yeso	2270'	Penn Clastics 5836'
Abo	4416'	Miss 5930'
		Ordovician 6122'
		Granite Wash 6426'

100' cmt plug, 30sxs After
2152' - 2252', 7 7/8" hole

TOC: 2,960' CBL

100' cmt plug 4366' - 4466', 25sxs

Clupe Wolfcamp

5080' ±
35' cmt
5,130' - 5,144' w/ 2 JSPF "A"
5,310' - 5,331' w/ 2 JSPF "B"
5,452' - 5,466' w/ 1 JSPF "C"
5,482' - 5,504' w/ 1 JSPF "
5,518' - 5,548' w/ 1 JSPF "
5,564' - 5,578' w/ 1 JSPF "
Miss
5,974' - 5,982' w/ 4 JSPF
6,008' - 6,018' w/ 4 JSPF
Ordovician
6,186' - 6,234' w/ 4 JSPF in 4 zone
6,250' - 6,274' w/ 4 JSPF
5 1/2" @ 6580'
w/ 1100 SX

5 1/2" cut @ 3325'
60 SX 3375' - 3375'

TOC @ 3360' (TS)

20 SX 4185' - 4045'
4131' - 4135'

4441' - 4473'

4542 1/2' - 4585'

4670' - 4679' Clupe

4714' - 4768' 5924' ±

5 1/2" @ 4936' Clupe

6136' ±

w/ 450 SX 35' cmt

TB 5220'

PBTD: 6,535'

TB 6580'

- SKETCH NOT TO SCALE -

DATE: 12-28-00 80
1/31/01 JWP