


Submit 3 Copies to Appropriate District Office

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

CISF
Op

DISTRICT I
P.O. Box 1980, Hobbs NM 88241-1980
DISTRICT II
P.O. Drawer DD, Artesia, NM 88210
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

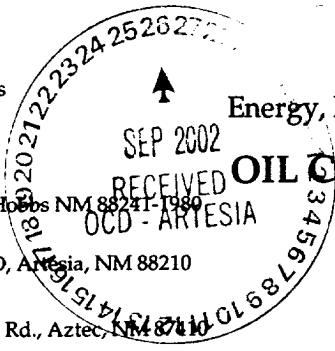

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO.
30-015-01711

5. Indicate Type of Lease
STATE FEE

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name
EMPIRE ABO UNIT "G"

1. Type of Well:
OIL WELL GAS WELL OTHER

8. Well No.
33

2. Name of Operator
BP America Production Company

9. Pool name or Wildcat
EMPIRE ABO

3. Address of Operator
P.O. Box 1089 Eunice, NM 88231

4. Well Location
Unit Letter L : 330 Feet From The W Line and 1965.6 Feet From The S Line
Section 34 Township 17S Range 28E NMPM EDDY COUNTY County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3662' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING OTHER:
SUBSEQUENT REPORT OF: REMEDIAL WORK ALTERING CASING COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT CASING TEST AND CEMENT JOB OTHER: Workover

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
TD: 6340' PBD: 6050' CIBP PERFS: 5802-5990'
07.25.02: MIRUPU. NDWH. NUBOP. Unset pkr. POH.
07.26.02: RIH w/bit, scraper, & tbg. Test tbg in hole to 5000# psi below slips.
07.29.02: RIH w/CIBP. Set @ 6050'. RIH w/bailer. Dump 15' cmt on top of plug.
07.30.02: Perf 2 JSPF 5802-06', 5832-34', 5838-50', 5854-60', 5866', 5877-5900', 5905-5948', 5972-90'. RIH w/pkr & SN.
07.31.02: Pmp 500 gals 7.5% HCL w/additives to pickle tbg. Wait 30 mins. Swab back acid. Fish SV. Spot acid @ 5993'. Spot 2 bbls 15% HCL followed by 10 bbls. Set pkr @ 5700'. Pmp 6000 gals 15% HCL w/additives. Dropping 251 ball sealers.
08.01.02: RIH w/bailer. CO to 6040'. POH.
08.02.02: RIH w/prod. assy. NDBOP. Set TAC. NUWH. Swab well.
08.13.02: RTP. In 24 hrs pmp 0 BO, 82 BW, 12 MCF.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.
SIGNATURE Kellie D. Murrish TITLE Sr. Administrative Assistant DATE 09.23.02
TYPE OR PRINT NAME Kellie D. Murrish TELEPHONE NO. 505-394-1649

Accepted for record - NMOCD

(This space for State Use)
APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: