

DISTRICT I
P. O. Box 1980, Hobbs, NM 88240

DISTRICT II
P. O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P. O. Box 2088
Santa Fe, NM 87504-2088

WELL API NO. 30-015-05163
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B-1565
7. Lease Name or Unit Agreement Name State "AZ"
8. Well No. 1
9. Pool name or Wildcat Grayburg Jackson 7-Rivers QN-GB-SA
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3760' DF

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator The Wiser Oil Company	3. Address of Operator P.O. Box 2568 Hobbs, New Mexico 88241 (505) 392-9797
4. Well Location Unit Letter <u>M</u> : <u>990</u> Feet From The <u>South</u> Line and <u>990</u> Feet From The <u>West</u> Line Section <u>16</u> Township <u>17S</u> Range <u>31E</u> NMPM <u>Lea</u> County	10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3760' DF	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <u>Squeeze, add perms. & acidize</u> <input checked="" type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

7/17/00 MIRU Tyler Well Service. POH w/rods. NU BOP's. POH w/2-7/8" tbg. RIH w/6-1/8" bit to 3194'. POH.

7/18/00 RIH w/7" pkr. & RBP. Set RBP @ 2150'. Flow stopped. Test csg. to 500#. Held. Moved RBP to 3000'. Flow stopped. Test csg. to 300# & csg. held. POH. Ran DSL & Temperature Survey f/TD to 1700'. Flow coming f/approx. 2900'.

7/19/00 Spot 8 sks. sand. RIH w/2-7/8" EUE tbg. Tag @ 3174'. 10' fill in hole. POH. Dump 87 sks. sand in hole. Total of 95 sks. RU Computalog. Tag sand @ 2975'. Shot 4 holes @ 2963'. RD WL.

7/20/00 RIH w/pkr. on 2-7/8" tbg. to 2848'. Set pkr. Pressure up to 2500#. Could not pump into perms. Release pkr. Tag sand @ 3886'. Wash sand to 3976'. Pull up & set pkr. Pump into perms. w/600# @ 1.22 bpm. RIH w/cmt. retainer & set @ 2838'. Halliburton squeezed perf. 2963' w/100 sks. Class "C" neat & 100 sks. Class "C" w/3% CaCl. Final squeeze pressure 2075#. POH w/2-7/8" tbg. RIH w/6-1/8" bit, bit sub, DC's & 2 jts. 2-7/8" tbg.

7/21/00 Tag @ 2836'. RU reverse unit. Drill cmt. to 2838'. Drill retainer to 2842'. Circulate clean.

7/24/00 Drill cmt. f/2842'-2980'. Fell out of cmt. Wash sand to 2881'. Circulate clean. No flow.

7/25/00 Wash sand f/2981'-3196'. Drill & wash gravel to 3298'. Drill cal-seal to 3301'. Circulate clean. POH. LD collars & bit. Dump 6 sks. sand.

7/26/00 RU Computalog. Tag sand @ 3268'. Dump 1 sk. cmt. on top of sand. PBTD @ 3264'. Perforate Middle Grayburg f/3013', 14', 20'-24', 29', & 30' w/4 SPF

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mary Jo Turner TITLE Production Tech II DATE October 8, 2001

TYPE OR PRINT NAME Mary Jo Turner

(This space for State Use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

ORIGINAL SIGNED BY TIM W. GUM
DISTRICT II SUPERVISOR

DATE OCT 30 2001

DISTRICT I
P. O. Box 1980, Hobbs, NM 88240

DISTRICT II
P. O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P. O. Box 2088
Santa Fe, NM 87504-2088

WELL API NO.

30-015-05163

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil & Gas Lease No.

B-1565

7. Lease Name or Unit Agreement Name

State "AZ"

8. Well No.

1

9. Pool name or Wildcat

Grayburg Jackson 7-Rivers QN-GB-SA

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL

WELL ☒

GAS

WELL ☐

OTHER

2. Name of Operator

The Wiser Oil Company

3. Address of Operator

P.O. Box 2568 Hobbs, New Mexico 88241 (505) 392-9797

4. Well Location

Unit Letter M : 990 Feet From The South Line and 990 Feet From The West Line

Section 16 Township 17S Range 31E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3760' DF

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐


OTHER: Squeeze, add perms. & acidize ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. (continued)

(36 holes) RD WL. RIH w/7 jts. 2-3/8" tbg., 7" pkr. 95 jts. 2-7/8" tbg. RU Cudd Well Service & acidize Vacuum-Grayburg (open hole) f/3034'-3264' & Grayburg 3013'-3030' w/3000 gals. 15% NE-FE acid w/3500# rock salt in 13 stages. Good block action. ATP 2019# @ 3.9 bpm. MTP 2650# @ 4.4 bpm. ISIP 2000#. 5 min. 1975#. 10 min. 1970#. 15 min 1950#. SI 1 hr. Tbg. 1500#. Released pkr. & POH. RIH w/2-3/8" tbg. Tbg. @ 3255'. SN @ 3254'. ND BOP. NU WH.

7/27/00 RIH w/3/4" rods & pump. Hit paraffin @ 1500'. POH. Ran paraffin knife. RIH w/rods. Hot watered csg. & tbg. into reverse pit.

7/28/00 RIH w/rods & 2" x 1-1/2" x 12' RWBC pump. Left well pumping to Battery.

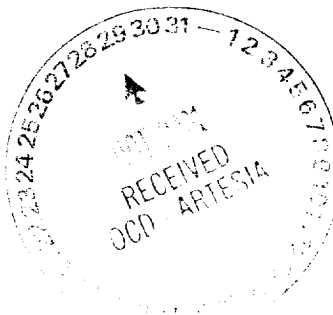

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mary Jo Turner TITLE Production Tech II DATE October 8, 2001

TYPE OR PRINT NAME Mary Jo Turner

(This space for State Use)

APPROVED BY

ORIGINAL SIGNED BY TIM W. GUM
DISTRICT II SUPERVISOR

DATE OCT 30 2001

CONDITIONS OF APPROVAL, IF ANY: