

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN 7
(Other instru
verse side)LICATE*
s on reForm approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

Las Cruces 029426 (a)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

H. E. West "A"

9. WELL NO.

13

10. FIELD AND POOL, OR WILDCAT

Grayburg-Jackson

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

3-T17S-R31E

12. COUNTY OR PARISH

Eddy

13. STATE

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ Water Injection	2. NAME OF OPERATOR SINCLAIR OIL CORPORATION Sinclair Oil & Gas Company	3. ADDRESS OF OPERATOR P. O. Box 1920, Hobbs, New Mexico	4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 900' from North line and 2310' from West line of Section 3-T17S-R31E	14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3976' GR
---	--	---	--	----------------	---

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☒(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

2-22-65 Acidised with 500 gallons of mud acid using iron stabilizing agent and .5% HXK Sinclair BIA. Pumped acid down and allowed to soak for 15 min. Treated perms. 3419' to 3686' with first 250 gallons @ 1/4 BPM 2200# to 2350#. Increased rate to 1 BPM and 2600#. Formation broke to 2200# and rate increased to 3 BPM @ end of treatment. ISIP 1800#. Swabbed 20 HLW and 12 BAW. Upon completion injected 550 BAFD @ 2000 psi. Previous injection rate was 3 BAFD @ 2300 psi.

RECEIVED

MAR 15 1965

O. C. C.
ARTESIA OFFICE

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Superintendent

DATE

3-9-65


(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF

TITLE

DATE

Crig200: USGS, Artesia, cc: Mr. R. F. S. cc: file

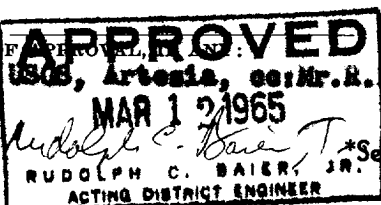

See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1963-O-685229

917-851

