

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRI-SCAPE
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		2. NAME OF OPERATOR Phillips Petroleum Company ✓		3. ADDRESS OF OPERATOR 4001 Penbrook Street, Odessa, TX 79762		4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface Unit O, 660' FSL & 1980' FEL		5. LEASE DESIGNATION AND SERIAL NO. LC-28784-A		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
14. PERMIT NO. API No. 30-015-20372		15. ELEVATIONS (Show whether SF, ST, OR, etc.) 3620' GL		7. UNIT ASSIGNMENT NAME		8. FARM OR LEASE NAME Keely A Fed		9. WELL NO. 17		10. FIELD AND POOL, OR WILDCAT Gb Jackson-SR-Q-SR-SA	
11. SEC., T., R., M., OR BLM AND SURVEY OR AREA Sec. 13, 17-S, 30-E		12. COUNTY OR PARISH Eddy		13. STATE NM		16. FIELD AND POOL, OR WILDCAT Gb Jackson-SR-Q-SR-SA		17. SEC., T., R., M., OR BLM AND SURVEY OR AREA Sec. 13, 17-S, 30-E		18. COUNTY OR PARISH Eddy	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:				SUBSEQUENT REPORT OF:			
TEST WATER SHUT-OFF	☐	FILL OR ALTER CASING	☐	WATER SHUT-OFF	☐	REPAIRING WELL	☐
FRACTURE TREAT	☐	MULTIPLE COMPLETS	☐	FRACTURE TREATMENT	☐	ALTERING CASING	☐
SHOOT OR ACIDIZE	☐	ABANDON*	☐	SHOOTING OR ACIDIZING	☐	ABANDONMENT*	☐
REPAIR WELL	☐	CHANGE PLANS	☐	(Other) Set CIBP & TA wellbore.	☒		☒
(Other)	☐		☐	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)			

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

- 03-25-92: MI & RU DDU. GIH w/bit & scraper on 2-3/8 workstring. Tag plug at 1700' from surface. Circulate oil off top of plug. Could not clean out or drill thru. Lack of tubing weight. COOH. Ran 4 3-1/4 J. collar and bit. Tag plug at 1700' again, started cleanout. Fell thru plug at 1706'. Ran down to 3145' with bit and found no other obstructions downhole. COOH and lay down collars.
- 03-26-92: GIH with CIBP on w/string. Set CIBP at 2455'. Come up and circulate hole with fresh water mix with Tretolite KW-132. Press up on casing to 500#. held OK. No leak off. COOH with w/string. Shut well head valves. RD DDU. Don Early w/BLM witness test. Complete drop from report. Request permit to TA well for 1 year.

This Approval of Temporary
Abandonment Expires

3/26/97

NMOCD

18. I hereby certify that the foregoing is true and correct

SIGNED

L. M. Sanders

TITLE

Supv., Reg/Proration

DATE

03-30-92

(This space for Federal or State office use)


APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See Instructions on Reverse Side

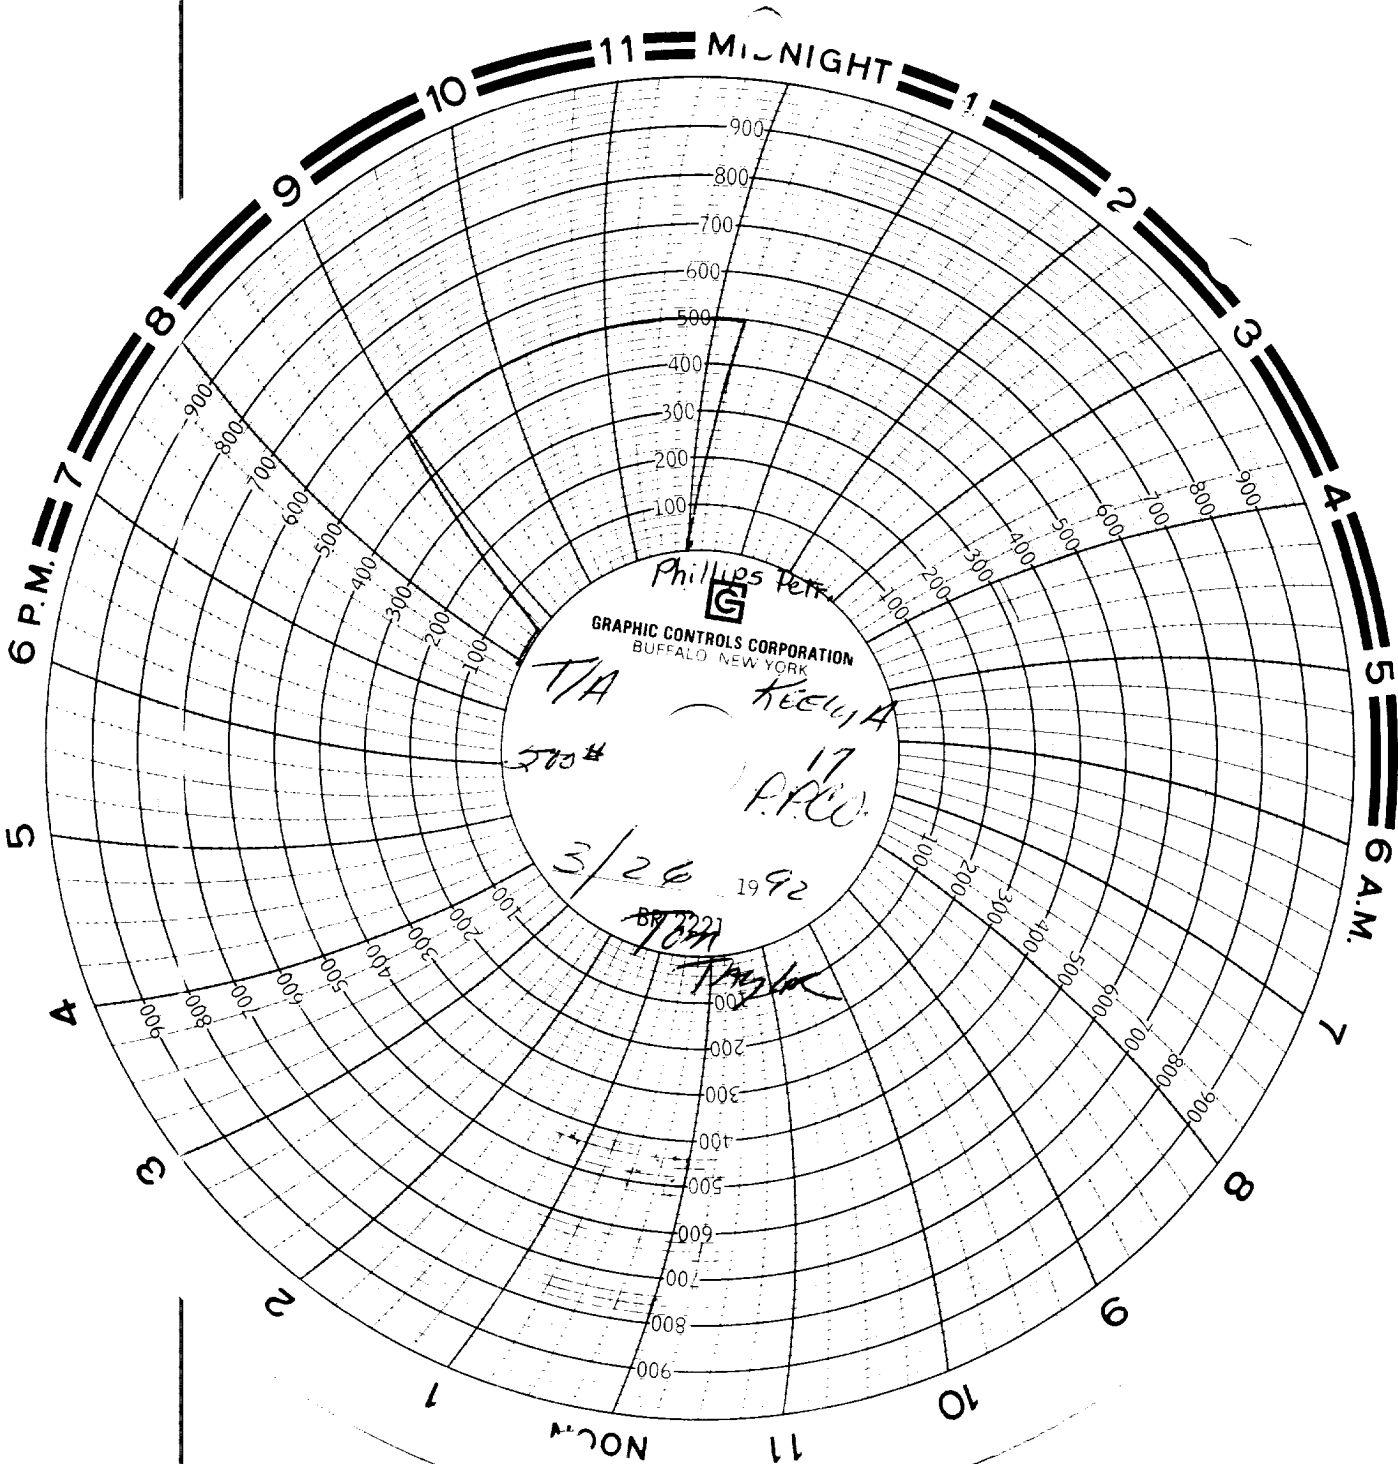

RECEIVED
APR - 2 1992
O.C.D.
-STANDARD OFFICE-