

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLI
(Other Instructions
verse side)

BY
NO.

Form approved
Budget Bureau No. 42-31424
E. LEASE DESIGNATION AND SERIAL NO.

NM-14996

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>		7. UNIT AGREEMENT NAME	
2. NAME OF OPERATOR Cotton Petroleum Corporation ✓		8. FARM OR LEASE NAME Federal 11	
3. ADDRESS OF OPERATOR 420 Wall Towers West, Midland, Texas 79701		9. WELL NO. 1	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1880' FSL & 1980' FWL		10. FIELD AND POOL, OR WILDCAT Boyd Morrow	
14. PERMIT NO.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 11, T-19-S, R-25-E	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) RKB 3451'		12. COUNTY OR PARISH Eddy	
		13. STATE NM	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:


TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input checked="" type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input checked="" type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

Propose to plug and abandon as follows; as per instruction of Mr. George Stewart, USGS, Roswell.

1. Set CIBP @ 9000'. Cap w/50' cem.
2. Cut pipe @ est. 5400'. Set 150' cem plug, (75' in and out of 4-1/2" stub).
3. Set 100' cem plug 4331-4431'.
4. Set 100' cem plug 2450-2550'.
5. Set 100' cem plug 1164-1264' (50' in and out of 8-5/8" csg shoe).
6. Set 10 sx plug @ surface.

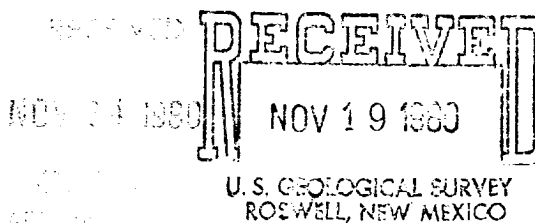

18. I hereby certify that the foregoing is true and correct

SIGNED Tom Olle /Tom Olle TITLE Engineer DATE 11-18-80

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: