

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89


OIL CONSERVATION DIVISION

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

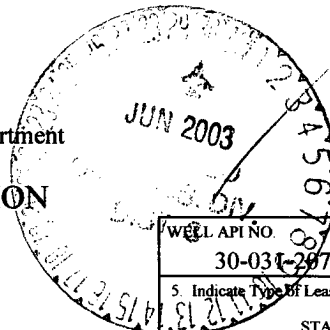

WELL API NO. 30-031-28762
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. LH-3667
7. Lease Name or Unit Agreement Name STATE
8. Well No. 6
9. Pool name or Wildcat North Miguel Creek Field

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER:	
2. Name of Operator ROBERT L. BAYLESS	
3. Address of Operator P.O. BOX 168 FARMINGTON, NM 87499	
4. Well Location Unit Letter M : 990 Feet from the SOUTH Line and 330 Feet from The WEST Line Section 16 Township 16N Range 6W NMPM MCKINLEY County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 6572' GL	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO :		SUBSEQUENT REPORT OF :	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Robert L. Bayless plugged and abandoned this well 6/5/03. The procedure is attached.

I hereby certify that the information above is true and correct to the best of my knowledge and belief.			
SIGNATURE		TITLE	ENGINEER
DATE	6/25/03	TELEPHONE NO.	(505) 327-2659
TYPE OR PRINT NAME	Tom McCarthy		
(This space for State Use)		TITLE	DEPUTY OIL & GAS INSPECTOR, DIST. 4
APPROVED BY	H. Villanueva	DATE	SEP - 1 2004
CONDITIONS OF APPROVAL, IF ANY:	9-1-04		

Robert L. Bayless
Plug and Abandon Report
State No. 6

990' FSL & 330' FWL, Section 16, T16N, R6W
McKinley County, NM

6/4/2003: Rig up JC Well Service. Trip out with rods and pump. Trip in tubing and tag PBD at 1184'. Roll hole with water. Mix and spot 16 sack bottom plug at 1184'. Trip out tubing and WOC.

6/5/2003: Trip in and tag plug at 1043'. Pressure test casing to 200 PSI, OK. Perforate squeeze holes at 160'. Could not pump into perms. Trip in to 220.50'. Spot 30 sack surface plug. Trip out with tubing. Rigged down. Class B cement was used.

Top off cement in both casings. Installed abandonment marker and backfilled pit. Cleaned up location.