

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENTFORM APPROVED  
OMB NO. 1004-0135  
Expires: July 31, 2010**SUNDRY NOTICES AND REPORTS ON WELLS**  
**Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.**5. Lease Serial No.  
NMSF078336B

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No

**SUBMIT IN TRIPLICATE - Other instructions on reverse side.**

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other8 Well Name and No.  
BARRETT A 13

2. Name of Operator

BP AMERICA PRODUCTION CO.

Contact: RANAD ABDALLAH

E-Mail: ranad.abdallah@bp.com

9. API Well No

30-045-26972-00-S1

3a. Address

200 ENERGY COURT  
FARMINGTON, NM 87401

3b. Phone No (include area code)

Ph: 281-366-4632

10. Field and Pool, or Exploratory  
BLANCO MESAVERDE

4 Location of Well (Footage, Sec., T., R., M., or Survey Description)

Sec 20 T31N R9W NENE 0930FNL 1035FEL  
36.888214 N Lat, 107.797394 W Lon

11. County or Parish, and State

SAN JUAN COUNTY, NM

**12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA**

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

BP America respectfully requests permission to plug and abandon the subject well. We have evaluated this well and find no further potential. Please see the attached P&A procedure and wellbore diagrams.

**RCVD OCT 31 '12  
OIL CONS. DIV.  
DIST. 3****Notify NMOCD 24 hrs  
prior to beginning  
operations**

14. Thereby certify that the foregoing is true and correct.

**Electronic Submission #155367 verified by the BLM Well Information System  
For BP AMERICA PRODUCTION CO., sent to the Farmington  
Committed to AFMSS for processing by STEVE MASON on 10/24/2012 (13SXM0347SE)**

Name (Printed/Typed) RANAD ABDALLAH

Title AUTHORIZED REPRESENTATIVE

Signature (Electronic Submission)

Date 10/18/2012

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved By STEPHEN MASON

Title PETROLEUM ENGINEER

Date 10/24/2012

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon

Office Farmington

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

**\*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\*****NMOCD**



## BP - San Juan Wellwork Procedure

### BARRET A LS13-PC

30-045-26972-00

Unit letter Unit A - Sec 20 - T31N - R09W

San Juan, NM

PC

OGRID Number: 0778

P&A date – December 2012


#### **Basic Job Procedure:**

1. Kill well. Circulate well clean with fresh water.
2. POOH with tubing.
3. RIH with bit and scraper to 3150 ft
4. RIH and set CIBP ~3,100 ft and PT to 500 psi.
5. Balance cement plug from CIBP to 1,700 ft
6. RIH and set CIBP ~~~3,500~~<sup>3,400</sup> ft and PT to 500 psi.
7. Balance cement plug from CIBP to surface
8. Cut off well head and install well marker and identification plate per regulatory requirements. RD MO Location


#### **Policy Reminder**

Any changes to the written procedure requires an approved MoC

## Current Wellbore Diagram

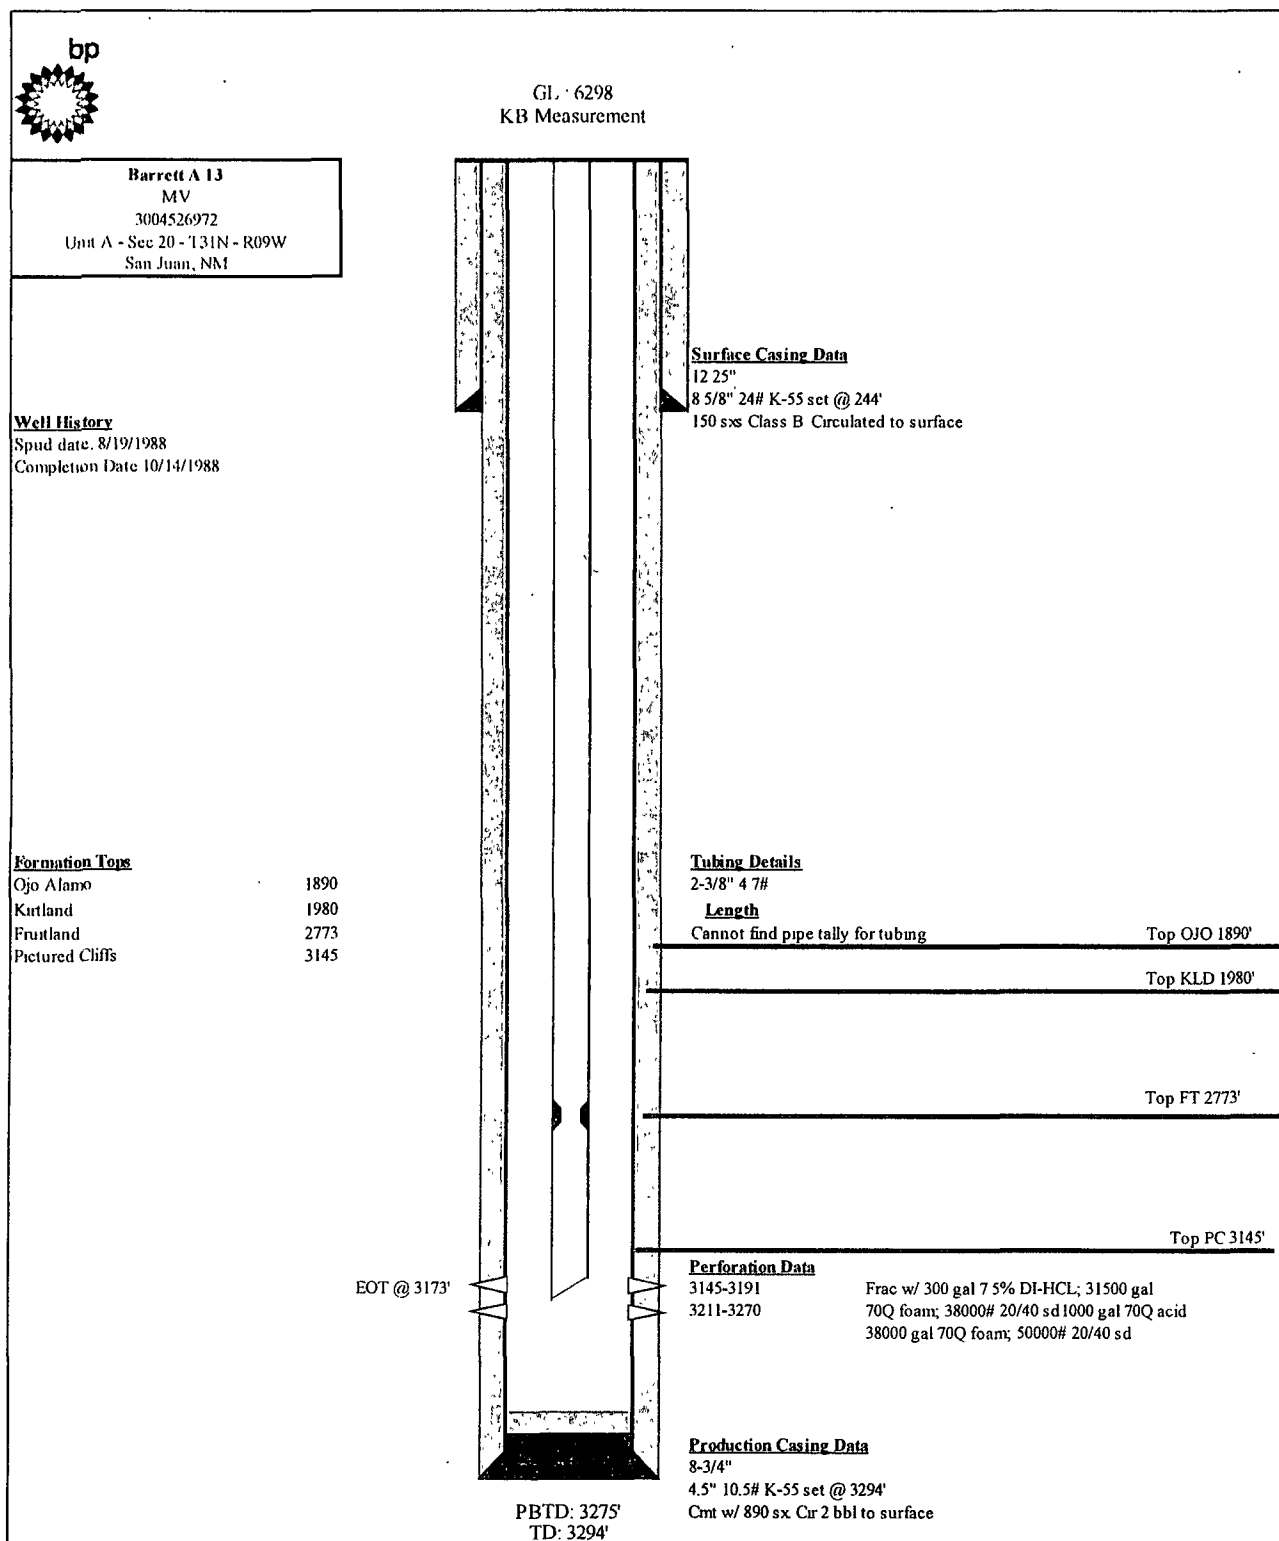

## Proposed Wellbore Diagram

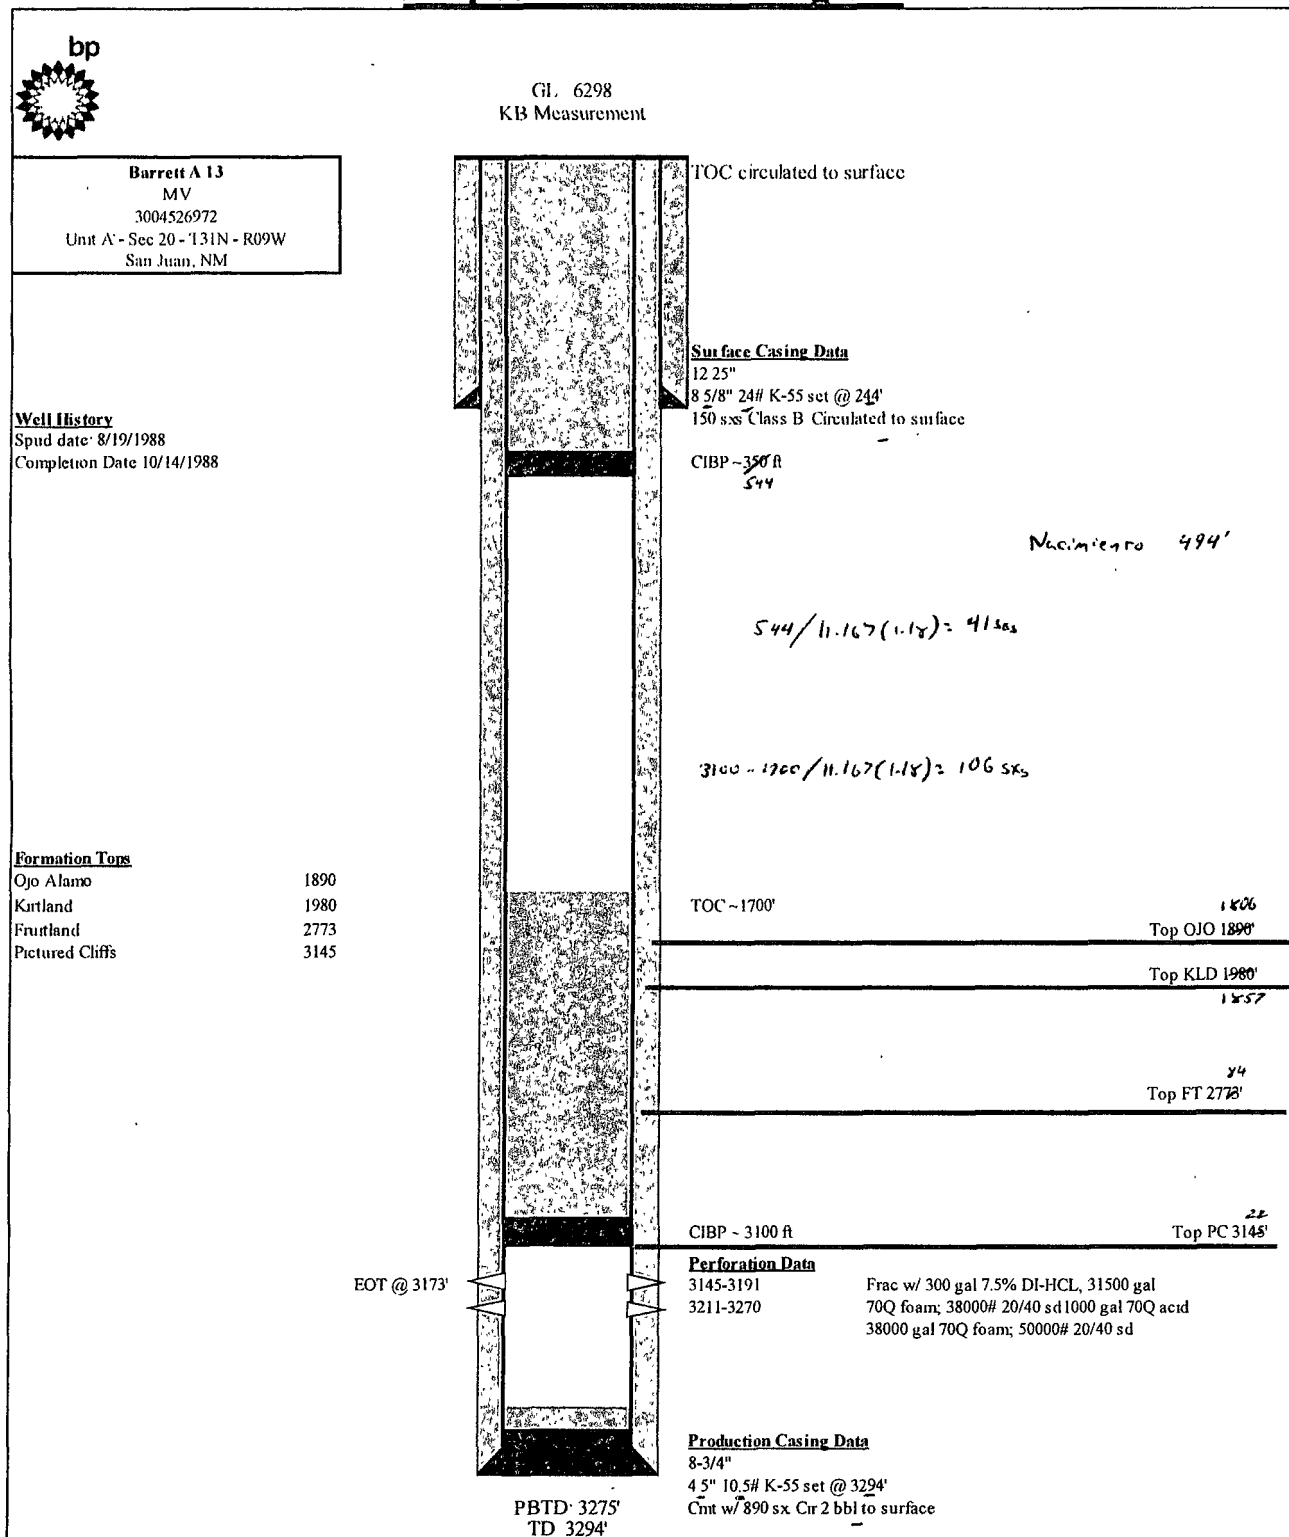

**UNITED STATES DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT  
FARMINGTON DISTRICT OFFICE  
6251 COLLEGE BLVD.  
FARMINGTON, NEW MEXICO 87402**

Attachment to notice of  
Intention to Abandon:

Re: Permanent Abandonment  
Well: 13 Barrett A

**CONDITIONS OF APPROVAL**

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.
3. The following modifications to your plugging program are to be made:
  - a) Place the Nacimiento/Surface plug from 544' to surface.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.