Form'3160-5 (June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NOG13121862 6. If Indian, Allottee or Tribe Name			
SUBMIT IN TRIPLICATE - Other instructions on page 2					EASTERN NAVAJO 7. If Unit or CA/Agreement, Name and/or No. NMNM135216A			
1. Type of Well					8. Well Name and No.			
Oil Well Gas Well Other     Contact: LACEY GRANILLO					9. API Well No.			
ENDURING RESOURCES LLC E-Mail: Igranillo@enduringresources.com					30-045-35810-00-X1			
3a. Address 1050 17TH STREET SUITE 2 DENVER, CO 80265		8b. Phone No. (include area code) Ph: 505-636-9743		10. Field and Pool or Exploratory Area LYBROOK MANCOS W				
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State			
Sec 23 T23N R9W NWSE 2633FSL 2101FEL 36.212399 N Lat, 107.756905 W Lon					SAN JUAN COUNTY, NM			
12. CHECK THE AF	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE,	REPORT, OR OTH	IER I	DATA	
TYPE OF SUBMISSION	TYPE OF ACTION							
Notice of Intent	□ Acidize		Deepen		Production (Start/Resume)		Water Shut-Off	
Subsequent Report	Alter Casing		draulic Fracturing	Reclamation		_	Well Integrity	
	Casing Repair	_	w Construction	Recomp			Other	
Final Abandonment Notice	<ul> <li>Change Plans</li> <li>Convert to Injection</li> </ul>	Plug and Abandon Plug Back		<ul> <li>Temporarily Abandon</li> <li>Water Disposal</li> </ul>				
Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.  P&A SHL PREVIOUSLY SET Enduring Resources is requesting to plug and abandon the surface hole associated to the API #30-045-35810 per procedure and attached wellbore diagram.  MIRU cement equipment (no rig is required). Hold pre-job safety meeting. Comply with all NMOCD, BLM Safety and environmental regulations. Check casing pressure. Ensure there is no pressure on the well. Remove existing piping on casing valve. Cut-off wellhead. RIH with 2 in. poly pipe to PBTD (9-5/8 float collar). Rig up to pump cement down poly pipe. Pump water to establish rate down poly pipe. Pump Cement Plug 1: 9-5/8 surface casing float collar to surface, 190 Sacks Class G Cement (15.8) Notify NMOCD 24 hrs prior to beginning operations (14. 1 hereby certify that the foregoing is true and correct.								
Electronic Submission #504860 verified by the BLM Well Information System         For ENDURING RESOURCES         LLC, sent to the Farmington         Committed to AFMSS for processing by ALBERT A WETHINGTON on 03/02/2020 (20AMW0079SE)         Name (Printed/Typed)       LACEY GRANILLO								
Signature (Electronic Submission) Date 02/27/2020								
THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
_Approved By_JOE KILLINS							Date 03/05/2020	
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Office Farmington								
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.								
(Instructions on page 2) ** BLM REV	ISED ** BLM REVISE	D ** BLM R	EVISED ** BLN		) ** BLM REVISE	D **		

NNOCDPY

dy dy


\*

# Additional data for EC transaction #504860 that would not fit on the form


#### 32. Additional remarks, continued

Ib/gal, 1.17 cuft/sx, 5.03 gal/sx water, 2% calcium chloride, 50% excess). Establish circulation with cement down 2 in. poly pipe and back to surface. Ensure that good cement is circulated to surface.

Cut off casing and poly pipe below grade and install P&A marker to comply with regulations. Record GPS coordinates for P&A marker on EOW report. Photograph P&A marker in place. RDMO cement equipment.

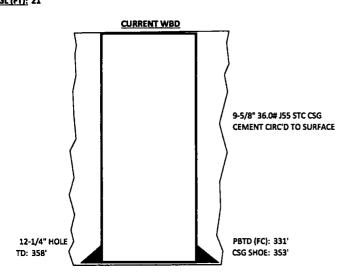

.

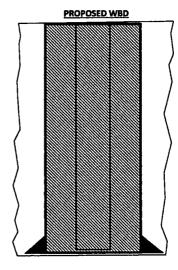

RIH W 2" POLY PIPE TO TD CEMENT W/ 190 SX CMT CLASS G, 15.8 PPG, 1.17 CUFT/SX

<u>WELL:</u> W LYBROOK UNIT 758Y <u>API:</u> 30-045-35810 <u>GL (FT):</u> 6,719 <u>KB (FT):</u> 6,740 <u>KB - GL (FT):</u> 21

.

,

•

L

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE 6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment API: 30-045-35810

١,

#### **CONDITIONS OF APPROVAL**

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."

2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

## GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.

- 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
- 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)

3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.

3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.

4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.

- 4.1 The cement shall be as specified in the approved plugging plan.
- 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
- 4.3 Surface plugs may be no less than 50' in length.
- 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
- 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
- 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

Page 1

5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.

6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.

- 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
- 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.

7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain  $H_2S$ .

8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show <u>date</u> well was plugged.

9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.

10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.