


UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Sundry Notices and Reports on Wells

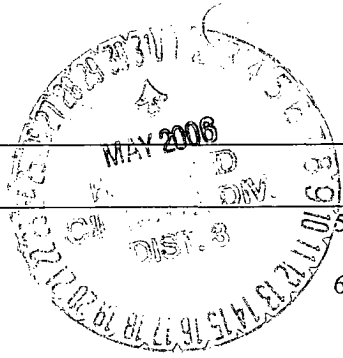

1. Type of Well
GAS

2. Name of Operator
CDX RIO, LLC

3. Address & Phone No. of Operator

2010 Afton Place, Farmington, New Mexico 87401 (505) 326-3003

4. Location of Well, Footage, Sec., T, R, M
2365' FNL, 790' FEL, Sec.18, T-26-N, R-5-W, NMPM

DHC-440A

5. Lease Number
Jicarilla Contract 110
6. If Indian, All. or
Tribe Name
Jicarilla Apache
7. Unit Agreement Name

8. Well Name & Number

Jicarilla A #8
9. API Well No.

30-039-08163
10. Field and Pool

Blanco MV/Basin DK/
Tapacito Gallup
11. County and State

Rio Arriba Co, NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission	Type of Action
☐ Notice of Intent	☐ Abandonment ☐ Change of Plans
☒ Subsequent Report	☒ Recompletion ☐ New Construction
☐ Final Abandonment	☐ Plugging ☐ Non-Routine Fracturing
	☐ Casing Repair ☐ Water Shut off
	☐ Altering Casing ☐ Conversion to Injection
	☐ Other

13. Describe Proposed or Completed Operations

5-3-06 MIRU. ND WH. NU BOP. TIH, tag up @ 7591'. TOOH w/237 jts 2 3/8" tbg. SDON.
5-4-06 TIH w/gauge ring to 5600'. TOOH. TIH w/CIBP, set @ 5520'. Load hole w/2% KCl wtr. PT csg to 1500 psi, OK. TIH w/4 1/2" csg scraper to CIBP @ 5520'. Circ hole clean. TOOH w/csg scraper. TIH, ran CBL @ 4000-5520', TOC @ 4700'. Good bond @ 4700-5520'. SDON.
5-5-06 TIH, perf Point Lookout w/1 SPF @ 5272, 5278, 5303, 5306, 5318, 5330, 5340, 5351, 5410, 5430' w/10 0.38" diameter holes total. TOOH. TIH w/pkr, set @ 5121'. Acidize w/1000 gal 15% HCL. Frac Point Lookout w/1045 bbl 30# borate x-link gel, 97,000# 16/30 Brady sd. Release pkr, TOOH. SDON.

Continued on back

14. I hereby certify that the foregoing is true and correct.

Signed Nancy Oltsmanns Title Agent Date 5-25-06

(This space for Federal or State Office use)

APPROVED BY _____ Title _____ Date _____

CONDITION OF APPROVAL, if any:

- 5-6-06 TIH w/CIBP, set @ 5250'. TOO. PT CIBP to 2000 psi/10 min, OK. TIH, perf Menefee w/1 SPF @ 5158, 5161, 5166, 5170, 5185, 5190, 5198, 5202, 5206' w/9 0.38" diameter holes total. TOO. TIH w/pkr, set @ 4937'. Acidize w/1000 gal 15% HCl. Frac Menefee w/29,000 gal 30# borate x-link wtr, 67,000# 16/30 Brady sd. TOO. w/pkr. SD for Sunday.
- 5-8-06 TIH w/4 1/2" CIBP, set @ 4960'. TOO. PT CIBP to 2000 psi, OK. TIH, perf Cliff House w/1 SPF @ 4820, 4824, 4828, 4832, 4836, 4840, 4844, 4848, 4852, 4856' w/10 0.38" diameter holes total. TOO. TIH w/pkr, set @ 4680'. SDON.
- 5-9-06 Acidize w/1000 gal 15% HCl. Frac Cliff House w/25,000 gal 30# x-link gel, 53,987# 16/30 Brady sd. SDON.
- 5-10-06 Release pkr, TOO. TIH w/4 1/2" CIBP, set @ 4750'. ND BOP. Replace csg spool. SDON.
- 5-11-06 Repair WH. PT seals to 3000 psi, OK. NU BOP. SDON.
- 5-12-06 PT 4 1/2" csg, failed. Open bradenhead valve. Bradenhead leaking. Repair bradenhead & 4 1/2" csg. ND BOP. PT 4 1/2" csg to 1500 psi/5 min, OK. Bradenhead not leaking. TOO. NU BOP. SD for weekend.
- 5-15-06 Circ hole clean. TIH w/3 7/8" mill to CIBP @ 4750'. Circ hole clean. Mill out CIBP @ 4750'. Circ hole clean. SDON.
- 5-16-06 TIH, circ hole clean. TIH to CIBP @ 4960'. Circ hole clean. SDON.
- 5-17-06 Circ hole clean. Mill out CIBP @ 4960'. Circ hole clean to CIBP @ 5250'. SDON.
- 5-18-06 Circ hole clean. Mill out CIBP @ 5250'. Circ hole clean to CIBP @ 5520'. SDON.
- 5-19-06 Circ hole clean. SDON.
- 5-20-06 Circ hole clean. Mill out CIBP @ 5520'. Circ hole clean. SD for Sunday.
- 5-22-06 Circ hole clean to 7591'. SDON.
- 5-23-06 Circ hole clean. TOO. w/mill. TIH w/231 jts 2 3/8" 4.7# J-55 EUE tbg, landed @ 7307'. (SN @ 7306'). ND BOP. NU WH. RD. Rig released.

Well will produce as a Mesaverde/Gallup/Dakota commingle under DHC-440A.