

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-039-29989
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Celso Gomez
8. Well Number 3
9. OGRID Number 232512 RCVD MAY 4 2007 OIL CONS. DIV.
10. Pool name or Wildcat Wildcat DIST. 3

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☒ Other Dry Hole

2. Name of Operator
Lone Wolf New Mexico, LLC

3. Address of Operator
1125 17th Street, Ste. 2290 Denver, CO 80202

4. Well Location
Unit Letter C : 845 feet from the North line and 2110 feet from the West line
Section 25 Township 32N Range 02E NMPM Count Rio Arriba

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____

Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Lone Wolf New Mexico, LLC proposes to plug & abandon this well according to the following procedure:

- 1) Move on location and rig up completion rig. Nipple up an 8 5/8" x 5 1/2" swedge and 5 1/2" tubinghead. Nipple up the BOP.
- 2) Pick up a 4 3/4" bit and bit sub on 2 3/8" tubing and clean out to 1920' (50' below Entrada top). Mix mud to 50-60 visc. to keep hole open. TOH and lay down the bit and bit sub.
- 3) TIH with open-ended 2 3/8" tubing to 1920'. Spot a balanced plug from 1920'-683" (50' below the Entrada top to 100' above the Dakota top) with 370sx (437cu.ft.) of Type 5 cement with 1/4#/sk celloflake.
- 4) POH to 500' and circulate the tubing clean. WOC 3 hrs. TIH and tag the cement top. Pump another plug as necessary.
- 5) POH to 182'. Fill the open hole 50' below the casing shoe and the 8 5/8" casing to surface w/ 65sx (77cu.ft.) of Type 5 neat cement. TOH and fill the hole with cement as necessary.
- 6) Install dryhole marker. Reclaim loc. per surf. owner & NMOCD spec.

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.


SIGNATURE  TITLE Operations Manager DATE 5/2/07

Type or print name Mike Benetatos

E-mail address: mike@lonewolfop.com Telephone No (720) 904-6949

For State Use Only

DEPUTY OIL & GAS INSPECTOR, DIST. 4

APPROVED BY: 


TITLE DATE 5/15/07

Conditions of Approval (if any):

LONEWOLF OPERATING
CELSD GOMEZ #3

CURRENT STATUS

P&A STATUS

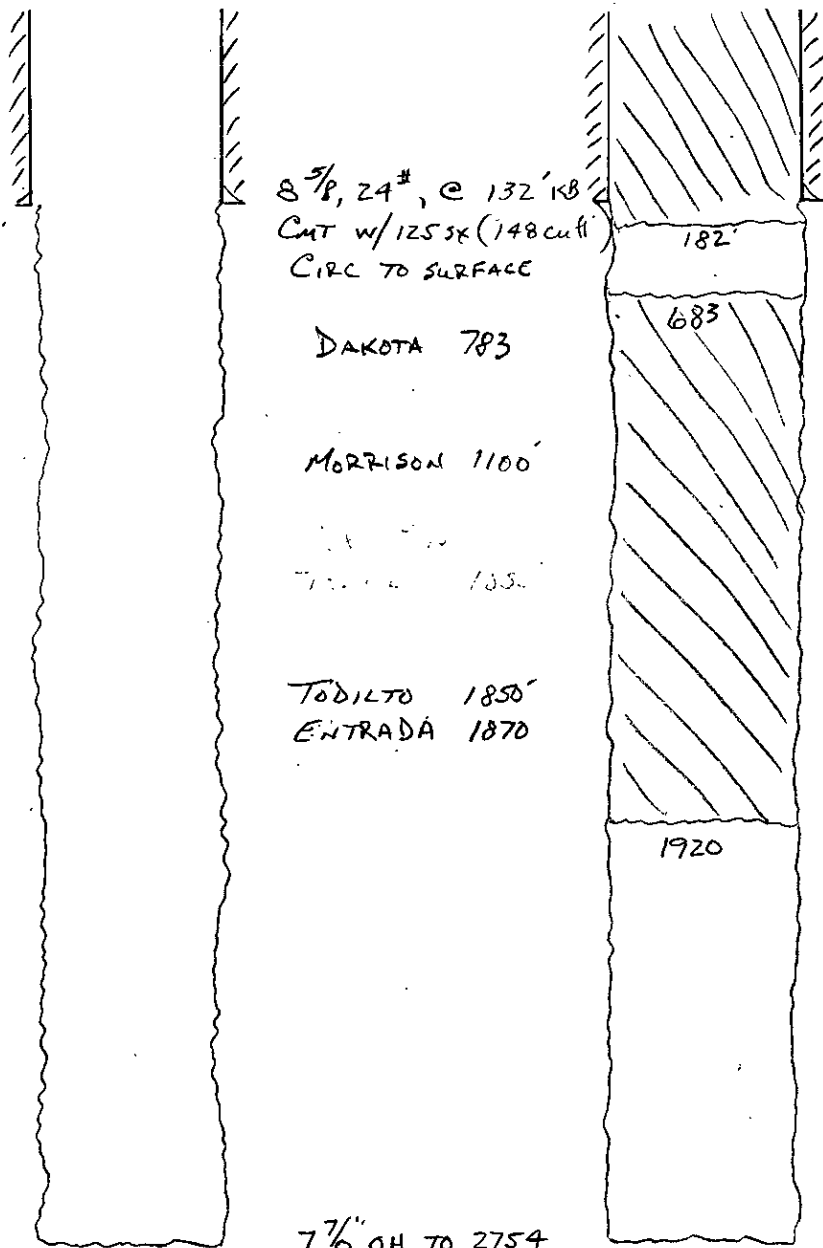

Plug #2 (0'-182')
65 SK (77 cu ft)

Plug #1 (1920-683')
370 SK (437 cu ft)

7 7/8" OH TO 2754

RT 4/25/07

42.381 50 SHEETS 5 SQUARE
42.382 100 SHEETS 5 SQUARE
42.383 200 SHEETS 5 SQUARE

