

Submit 3 Copies To Appropriate District Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

PN  
Form C-103  
Revised May 08, 2003

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		<b>WELL API NO.</b> 30-031-20640
<b>1. Type of Well:</b> Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		<b>5. Indicate Type of Lease</b> STATE <input type="checkbox"/> FEE <input type="checkbox"/>
<b>2. Name of Operator</b> Warren E&P		<b>6. State Oil &amp; Gas Lease No.</b> LG 7435
<b>3. Address of Operator</b> 123 W. First #505, Casper, WY 82601		<b>7. Lease Name or Unit Agreement Name</b> Chittum Penestaja S/W
<b>4. Well Location</b> Unit Letter <u>P</u> : <u>990</u> feet from the <u>South</u> line and <u>990</u> feet from the <u>East</u> line Section <u>36</u> Township <u>20N</u> Range <u>5W</u> NMPM County <u>Mckinley</u>		<b>8. Well Number</b> #1
<b>11. Elevation (Show whether DR, RKB, RT, GR, etc.)</b>		<b>9. OGRID Number</b>
<b>10. Pool name or Wildcat</b>		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐  
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS ☐ PLUG AND ABANDONMENT ☒  
CASING TEST AND CEMENT JOB ☐  
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

See attachment

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Randy Blackmon TITLE P&A Supervisor (Key Energy) DATE 9/10/03

Type or print name Randy Blackmon

Telephone No. (505) 320-3738

(This space for State use)

DEPUTY OIL & GAS INSPECTOR, DIST. 99

APPROVED BY H. Villanueva TITLE

DATE

Conditions of approval, if any:

9-15-03

SEP 15 2003

**KEY ENERGY SERVICES  
P&A OPERATION  
CEMENT SERVICE REPORT**

**WELL NAME: CHITTUM PENISTAJA #1**

**TOTAL PLUGS: 6**

**DATE STARTED: 12-4-02**

**TOTAL SACKS: 227**

**DATE COMPLETED: 12-10-02**

**WITNESS: H. VILLENUEVA  
STATE OF NM**

MOL. RU. WELL FLOWING 2" STREAM OF WATER OUT OF TBNG. PUMP 20 BBLS H2O.

PLUG #1: 3578'-3170'. 31 SX. SHUT IN W/400 PSI. WOC. STILL HAVE 2" WATER FLOW.

PLUG #2: 3578'-3070'. 80 SX. (2% CACL<sub>2</sub>) SHUT IN W/550 PSI. WOC. ND WELL HEAD.  
NU BOP. TOO H W/PLASTIC LINED TBNG. TIH W 2 3/8" TBNG. TAG CEMENT  
@ 3070'. CIRC & PRESS TEST 500 PSI. GOOD TEST. LD TBNG TO 2965'.


PLUG #3: 2965'-2815'. 24 SX. LD TBNG TO 2371'.

PLUG #4: 2371'-2221'. 28 SX. POOH STANDING 825' TBNG. PERF @ 850'. RET SET @ 819.  
NO RATE.

PLUG #5: 819'-669'. 28 SX. LD TBNG. PERF @ 276'.

PLUG #6: 276'-SURFACE. 128 SX.

ND BOP & CLEAN OUT CELLAR. CUT OFF WELL HEAD. TOP OFF CASING W/8 SX. INSTALL  
DRY HOLE MARKER.

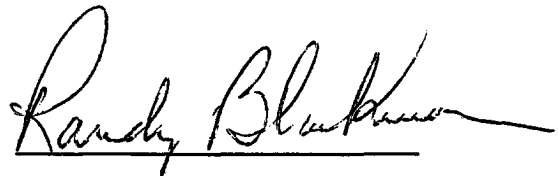

**RANDY BLACKMON  
P&A SUPERVISOR**