

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Sundry Notices and Reports on Wells

1. Type of Well
GAS

2. Name of Operator

BURLINGTON

RESOURCES OIL & GAS COMPANY

3. Address & Phone No. of Operator

PO Box 4289, Farmington, NM 87499 (505) 326-9700

4. Location of Well, Footage, Sec., T, R, M

1725' FSL, 1850' FEL, Sec. 7, T-30-N, R-8-W, NMPM

Lease Number
NMSF-078596

If Indian, All. or
Tribe Name

7. Unit Agreement Name

Well Name & Number
Pump Canyon SWD #1

9. API Well No.
30-045-26970

10. Field and Pool
Morrison Bluff Entrada

11. County and State
San Juan Co, NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission

Type of Action

☐ Notice of Intent	☐ Abandonment	☐ Change of Plans
☒ Subsequent Report	☐ Recompletion	☐ New Construction
☐ Final Abandonment	☐ Plugging Back	☐ Non-Routine Fracturing
	☐ Casing Repair	☐ Water Shut off
	☐ Altering Casing	☐ Conversion to Injection
	☒ Other -	

13. Describe Proposed or Completed Operations

9/18/03 MIRU. ND WH. NU BOP. SDON.
9/19/03 TOOH w/156 jts 4-1/2" IPC csg, & 24 jts 4-1/2" IPC csg w/Cplugs. SDON.
9/22/03 (Approval from Charlie Perrin, OCD, and Jim Lovato, BLM to repair casing). TIH w/5-13/16" swedge to 7505'. Circ hole clean. SDON.
9/23/03 TOOH w/5-13/16" swedge. TIH w/pkr, set @ 7503'. Dump 16' sand & 12' cmt on top of pkr @ 7503'. TIH w/pkr, set @ 7029'. SDON.
9/24/03 Reset pkr @ 7060'. PT 7" annulus to 2000 psi/15 mins, OK. Rls pkr & TOOH w/pkr. TIH open ended w/2-7/8" tbg to 7246'. Batch mix 10 bbls Micro-mix cmt, spot across hole, PUH above cmt, reverse out tbg capacity, set pkr @ 60'. Sqz 4.5 bbls cmt into formation, w/pressure increase to 3150 psi noticed trickle of wtr around surface equipment, broke to 1400 psi. Cmt displaced to top of csg patch. SDON.
9/26/03 Rls pkr & TOOH w/pkr. PT 7" csg @ surface to 2000 psi. TOOH. TIH w/bit, tag cmt @ 7117'. Mill cmt @ 7117' to top of csg patch @ 7127'. TOOH w/bit. TIH w/blade bit to 7127'. CO cmt to 7213'. Circ hole clean. PT csg to 2000 psi, held OK. TOOH w/bit.
9/27/03 TIH w/pilot mill. Mill csg patch @ 7127-7147'. Circ hole. TOOH w/mill. SDON.
9/28/03 TIH w/mill to 7147'. Mill csg patch to 7155'. Circ hole. TOOH w/mill. SDON.
9/29/03 TIH w/mill to 7151'. Wash to 7213'. Circ clean. TOOH w/mill. TIH w/mill to 7151-7164'. PT csg to 1000 psi, OK. SDON.
9/30/03 Mill csg patch @ 7164-7166'. Circ hole clean. TOOH w/mill. TIH w/mill, mill csg patch @ 7164-7169'. SDON.

14. I hereby certify that the foregoing is true and correct.


Signed Tammy Williams Title Regulatory Specialist

(This space for Federal or State Office use)

APPROVED BY _____ Title _____

CONDITION OF APPROVAL, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

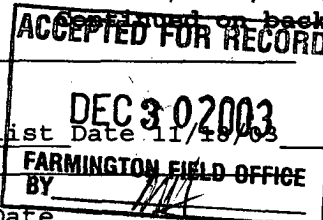

NMOCD

10/1/03 Mill csg patch @ 7169-7175'. TOOH w/mill. TIH w/mill. Mill csg patch @ 7175-7177'. SDON.
 10/2/03 Mill csg patch @ 7177-7189'. Circ hole clean. TOOH, lost 3.5" DCS in hole. SDON.
 10/3/03 TIH w/overshot, catch fish @ 6990'. TOOH w/fish & overshot. TIH w/mill to 7177'. Mill @ 7177-7182', mill csg patch @ 7182-7190'. SDON.
 10/4/03 Mill csg patch @ 7190-7195'. Circ hole clean. TOOH w/mill. SDON.
 10/6/03 TIH w/mill. Mill csg patch @ 7195-7200'. Circ hole clean. TOOH, lost mill. SDON.
 10/7/03 TIH w/overshot to fish @ 6826'. Latch fish, jar loose. TOOH w/fish & overshot. SDON.
 10/8/03 TIH w/mill to 7196'. Mill csg patch @ 7196-7201'. Circ clean. SDON.
 10/9/03 Mill csg patch @ 7201-7207'. TOOH w/mill. TIH w/washover shoe to 5400'. SDON.
 10/10/03 TIH w/washover shoe, tag up @ 7207'. Washover & ream csg patch & 7" csg @ 7207-7214' w/2% KCL wtr, fell out @ 7214'. PT 7" csg @ 7234 to 1000 psi, bled off 500 psi in 5 mins. TOOH w/washover shoe. SDON.
 10/11/03 TIH w/cmt retainer, set @ 7034'. PT 7" csg @ 7034' to surf w/2000 psi/15 mins, OK. (Notified BLM & OCD of sqz job on 10/10/03). Pump 200 sxs Class H cmt w/0.2% CD-32 (232 cu. ft.). Reverse circ 3 bbls cmt to surface. WOC.
 10/13/03 TIH w/bit, tag TOC @ 6994'. Drill out 40' cmt @ 6094-7034'. Drill out cmt retainer. Circ hole clean. SDON.
 10/14/03 Drill out hard cmt & junk @ 7038-7060'. Circ hole clean. SDON.
 10/15/03 Drill out hard cmt @ 7060-7220'. Circ hole clean. TIH w/pkr, set @ 64'. PT 7" csg @ 7220' to surface w/2000 psi/15 mins, good test. TOOH w/pkr. Drill out Micro-mix cmt @ 7220-7222'. Circ hole clean. SDON.
 10/16/03 Drill hard cmt @ 7222-7324', fell out of cmt @ 7324'. TIH, tag @ 7441'. Circ wellbore clean. SDON.
 10/17/03 TOOH w/bit. TIH w/pkr, set @ 7133'. PT 7" csg @ 7377-7441' to 2500 psi/15 mins, good test. Rls pkr & TOOH w/pkr. TIH w/tbg to 7471'. Circ wellbore clean. SDON.
 10/18/03 TOOH. TIH w/washover shoe, tag junk @ 7471'. Circ & CO. SDON.
 10/20/03 Tag junk @ 7474'. Mill junk @ 7474-7479'. Circ clean. SDON.
 10/21/03 Circ clean. TOOH w/washover shoe. TIH w/bit to 7479'. Reverse circ. SDON.
 10/22/03 Circ hole clean. TOOH w/bit. TIH w/magnet to 7479'. Circ, work mill w/cut-lip guide, over junk. TOOH w/magnet full of metal cuttings. SDON.
 10/23/03 TIH w/notched collar to 7479', unable to circ w/full returns. TOOH. SDON.
 10/24/03 TIH w/globe basket to 7480'. Mill @ 7480-7484', plugged off. Set basket down @ 7479'. TOOH w/globe basket, no recovery. SDON.
 10/27/03 TIH w/magnet, recovered small amount of fine cuttings. TIH w/impression block, no marks on block. TIH w/bailer. SDON.
 10/28/03 Tag fish @ 7480'. Push junk to 7519'. Set down solid, push to 7523'. TOOH w/bailer. Recovered some junk. SDON.
 10/29/03 TIH w/globe basket to 7560'. Close & open bailer four times. SDON.
 10/30/03 TOOH w/bailer, globe basket, & junk. TIH w/bailer to 7560'. SDON.
 10/31/03 Bail out to 7571'. TOOH w/bailer. TIH open ended w/2-7/8" tbg. SDON.
 11/3/03 RU slickline, bail clean off top of equalizing prong. Run lead impression block. TOOH w/tbg to 6500'. PT csg to 1100 psi/30 mins, good test. SDON.
 11/4/03 TOOH w/tbg. TIH w/pkr, set @ 7548'. SDON.
 11/5/03 TIH w/Baker seal assembly on 4-1/2" csg to 7548'. Sting into pkr, pull out of pkr. SDON.
 11/6/03 Run seal assembly inside pkr, latch up, pull 10K over. Land seal assembly in pkr @ 7548' w/173 jts 4-1/2" 10.5# J-55 IPC csg. PT csg to 550 psi/30 mins, good test. ND BOP. NU WH. PT seals in WH to 2000 psi, OK. Bail junk off plug. Pull equalizing prong, latch plug. SDON.
 11/7/03 RU slickline. TIH w/retrieving tool, latch plug, jar plug loose. TOOH. RD. Rig released.