

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

API # 30-045-28357 OPERATOR ☐ Initial Report ☒ Final Report

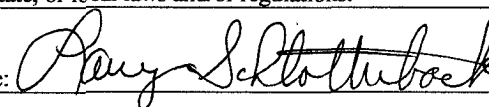

Name of Company BP America	Contact Larry Schlotterback
Address 200 Energy Court	Telephone No. (505) 326-9425
Facility Name Pritchard A 011	Facility Type Gas Well

Surface Owner Federal	Mineral Owner	Lease No
--------------------------	---------------	----------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	LATITUDE	Feet from the	LONGITUDE	County
M	1	30N	9W		36.83628		-107.73806	San Juan

NATURE OF RELEASE

Type of Release: PRODUCED WATER (Coal)	Volume of Release – 15 Barrels	Volume Recovered – 10 Barrels
Source of Release: Wellhead	Date and Hour of Occurrence: 10/27/2008 6:00	Date and Hour of Discovery 10/27/2008 – 10:00
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? NMOCD & BLM	
By Whom? Larry Schlotterback	Date and Hour: October 28, 2008 – 8:30 am	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse. RCUD NOV 7 '08	
If a Watercourse was Impacted, Describe Fully.* OIL CONS. DIV. DIST. 3		
Describe Cause of Problem and Remedial Action Taken.* On October 27, a contractor notified the Coal Team Leader of a water spill on the Pritchard A 11. Approximately 15 barrels of produced water spilled from the wellhead on location. It was discovered that a needle valve, off the pumping tee, was left open after calibration of a high pressure shut-down switch. None of the fluid left location and was contained within a 30' diameter. The fluid was analyzed to contain less than 1000 ppm total chlorides. Approximately 8-10 barrels of water was recovered by vacuum truck. The area will be remediated by mixing with hauled-in clean soil.		
Describe Area Affected and Cleanup Action Taken.* Soil on location and a nearby natural drainage was impacted. The area will be allowed to dry and any salt stain will be removed.		
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.		
Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Larry Schlotterback	Approved by District Supervisor:  For: Charlie Perrin	
Title: Field Environmental Coordinator	Approval Date: 11/7/08	Expiration Date:
E-mail Address: schltn@bp.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 11/4/08	Phone: 505-326-9425	

* Attach Additional Sheets If Necessary

Incident # NMOCD 0928641502