

District I
1625 N French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company	ConocoPhillips Company	Contact	Gwen R. Frost
Address	3401 E. 30 th St., Farmington, NM 87402	Telephone No.	505-326-9549
Facility Name	San Juan 31-6 #213	Facility Type	Gas Well
Surface Owner	Federal	Mineral Owner	Federal
		Lease No.	NM-03404
		API #	30-039-24531

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
K	5	T30N	R06W	1865'	South	1595'	West	Rio Arriba

Latitude 36.83943° N Longitude 107.48935° W

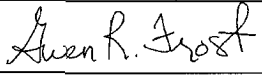

NATURE OF RELEASE

Type of Release - Produced Water	Volume of Release - 30 BBL	Volume Recovered - 25 BBL
Source of Release: Tank Overflow	Date and Hour of Occurrence Unknown	Date and Hour of Discovery 1/27/09 - 11:30 a.m.
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? OCD - Brandon Powell via phone & email BLM - Kevin Schneider via phone & email	
By Whom? Gwen Frost	Date and Hour - 1/28/09 - 12:00 p.m.	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse. ROUND FEB 2 '09 OIL CONS. DIV.	
If a Watercourse was Impacted, Describe Fully.* DIST. 3		

Describe Cause of Problem and Remedial Action Taken.* **On January 27, 2009, a COPC MSO discovered a 30 BBL produced water spill at the SJ 31-6 #213 due to a water pit tank overflow. The pit overflowed as a result of a failed belt (due to a freeze) on the transfer pump to the SWD #310 & the pumping unit "kills" failed to kill engine on high tank level. Upon discovery, the MSO shut in the well and notified water hauler to recover all standing fluid in cribbing & berm.**

Describe Area Affected and Cleanup Action Taken.* **All of the spilled fluids remained on location. Approximately 25 BBL was recovered and all water was contained in the cribbing and berm. COPC will monitor the soils. To prevent reoccurrence, COPC has replaced the "kills" on the pumping unit engine and replaced the belts on the water transfer.**

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	<u>OIL CONSERVATION DIVISION</u>		
Printed Name: Gwen R. Frost	Approved by District Supervisor:  For: Charlie Perrin		
Title: Environmental Engineer	Approval Date: 2-3-09	Expiration Date:	
E-mail Address: gwendolynne.frost@conocophillips.com	Conditions of Approval:	Attached <input type="checkbox"/>	
Date: 2/2/09 Phone: 505-326-9549			

* Attach Additional Sheets If Necessary

hbp0918931907