

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER		5. LEASE DESIGNATION AND SERIAL NO. NM 04083
2. NAME OF OPERATOR El Paso Natural Gas Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR PO Box 990, Farmington, NM 87401		7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1763'N, 1755'W		8. FARM OR LEASE NAME Federal
14. PERMIT NO.		9. WELL NO. 9
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 7204'GL		10. FIELD AND POOL, OR WILDCAT Gavalin Pictured Cliffs
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 22, T-25-N, R-2-W NMMP
		12. COUNTY OR PARISH Rio Arriba
		13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input checked="" type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)
Because of its inability to produce gas,
It is planned to plug and abandon this well in the following manner:

Spot a 50 sk. cement plug in the open hole section which will fill 100' inside the production casing.

Perforate holes at the base of the Ojo Alamo and spot a 75 sk. cement plug, displace some cement into the formation.

Perforate holes at 100', spot a 50 sk. cement plug, displace some cement into the formation.

Pump 50 sks. of cement down the bradenhead.

Place 15 sks. of cement on the surface. Install a dry-hole marker and clean up the location.

18. I hereby certify that the foregoing is true and correct

SIGNED

H. Wood


TITLE Petroleum Engineer

(This space for Federal or State office use)


APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

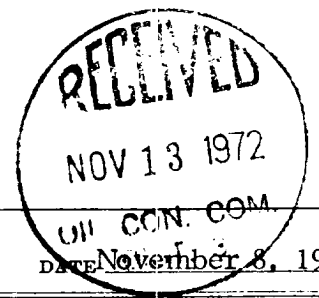

DATE November 8, 1972



NOV 10 1972