

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

**SUNDRY NOTICES AND REPORTS ON WELLS**

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)


1. oil well ☐ gas well ☒ other ☐
2. NAME OF OPERATOR  
Getty Oil Company
3. ADDRESS OF OPERATOR  
P.O. Box 3360, Casper, WY 82602-3360
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
AT SURFACE: 790' FSL & 1720' FEL (SW SE)  
AT TOP PROD. INTERVAL: same  
AT TOTAL DEPTH: same
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

- TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☐  
REPAIR WELL ☐  
PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
CHANGE ZONES ☐  
ABANDON\* ☐

SUBSEQUENT REPORT OF:

(other) Perf, acidize and frac.

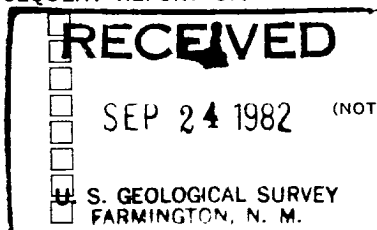

5. LEASE  
Contract #68
6. IF INDIAN, ALLOTTEE OR TRIBE NAME  
Jicarilla Apache
7. UNIT AGREEMENT NAME  
-
8. FARM OR LEASE NAME  
Jicarilla "B"
9. WELL NO.  
27
10. FIELD OR WILDCAT NAME  
Ballard Pictured Cliffs
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
0 Sec. 6-T24N-R5W
12. COUNTY OR PARISH  
Rio Arriba
13. STATE  
New Mexico
14. API NO.  
-
15. ELEVATIONS (SHOW DF, KDB, AND WD)  
6552' GR

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

On 8-26-82 MIRU completion unit. Tagged cement at 2408'. Drilled out cement to FC at 2468'. Ran cement bond log from 2468' to surface. Pressure test casing to 2800 psi - held OK for 15 minutes.

Spotted 60 gal of 10% Acetic acid and perf'd Pictured Cliffs w/ 1 spf, 16 gram charge, 0.40" holes, 27 holes total as follows: 2360'-2366', 2404'-2414', 2418'-2426'.

Acidized Pictured Cliffs perms 2360'-2426' with 1200 gal of 15% HCl at 1200 psi.

On 8-27-82 frac'd Pictured Cliffs perms 2360'-2426' with 31,638 gals of 70 quality foam plus 36,000# 20-40 sand plus 18,000# 10-20 sand.

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_ Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Alw Bower TITLE Area Superintendent DATE 9-21-82

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

TITLE \_\_\_\_\_ DATE **ACCEPTED FOR RECORD**

OCT 1 1982

\*See Instructions on Reverse Side

NM000

FARMINGTON, N. M.  
BY SM

## Instructions

**General:** This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

**Item 4:** If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

**Item 17:** Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.