Form 3160-5 (June 1990)

UNITED STATES


FORM APPROVED Budget Bureau No. 1004-0135

DEPARTMENT BUREAU OF LA	OF THE INTERIOR ND MANAGEMENT	Expires: March 31, 1993
SUNDRY NOTICES A	ND REPORTS ON WELLS or to deepen or reentry to a different reservoir. R PERMIT - " for such proposals	5. Lease Designation and Serial No. JICARILLA CONTRACT 148 6. If Indian, Allottee or Tribe Name
		7. If Unit or CA, Agreement Designation
t. Type of Well Oil Gas Well Other		8. Well Name and No. JICARILLA CONT 148 #34
2. Name of Operator	Attention: WAYNE BRANAM, RM 1220	9. API Well No.
AMOCO PRODUCTION COMPANY	WATNE BRAINAW, HW 1220	3003923685
3. Address and Telephone No. P.O. Box 800, Denver, Colorado 80201		10. Field and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Descri	iption)	WEST LINDRETH GALLUP DAKOTA
1870 FNL 580 FEL	Sec. 14 T 25N R 5W UNITH	11. County or Parish, State RIO ARRIBA NM
	(s) TO INDICATE NATURE OF NOTICE, RE	EPORT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTION	<u> </u>
Notice of Intent Subsequent Report Final Abandonment Notice	Abandonment Recompletion Plugging Back Casing Repair Altering Casing Other	Change of Plans New Construction Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Report results of multiple completion on Well Completion or
subsurface locations and measured and true vertical	all pertinent details, and give pertinent dates, including estimated date of depths for all markers and zones pertinent to this work.)*	starting any proposed work . If well is directionally drilled, g
AMOCO PROPOSES TO REPAIR THIS	WELL PER THE ATTACHED.	
		OM COM, DIV.
14. I hereby certify that the foregoing is true and correct	Title BUSINESS	ANALYST Date 12-21-1994
(This space for Federal or State office use)	fol Chief, Lands and I	Mineral Resources JAN 2 4 1995
Approved by Conditions of approval, if any:	Title	

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, ficticious, or fraudulent statements or representations as to any matter within its jurisdiction.

JICARILLA CONTRACT 148 - 34 SEC 14 - T25N - R5W RIO ARRIBA COUNTY, NM REPAIR WELL PROCEDURE

- 1. TOOH with the 2-3/8" production tbg.
- 2. TIH with bit and scraper for 5-1/2" csg to 7700'. .
- 3. Wireline set a CIBP at 7620'.
- 4. Cap the CIBP with 10' of sand/barite mixture. Bring the mixture up to 7610'. The mixture should be 33% barite and 67% 20/40 sand.
- 5. TIH with muleshoe, SN, and 2-3/8" tbg and land intake at 7558'. Check with Ralph Montoya before running the tbg in the well. Ralph may want to run 2-1/16" tbg rather than the 2-3/8" tbg.
- 6. Swab the well in and RTP.

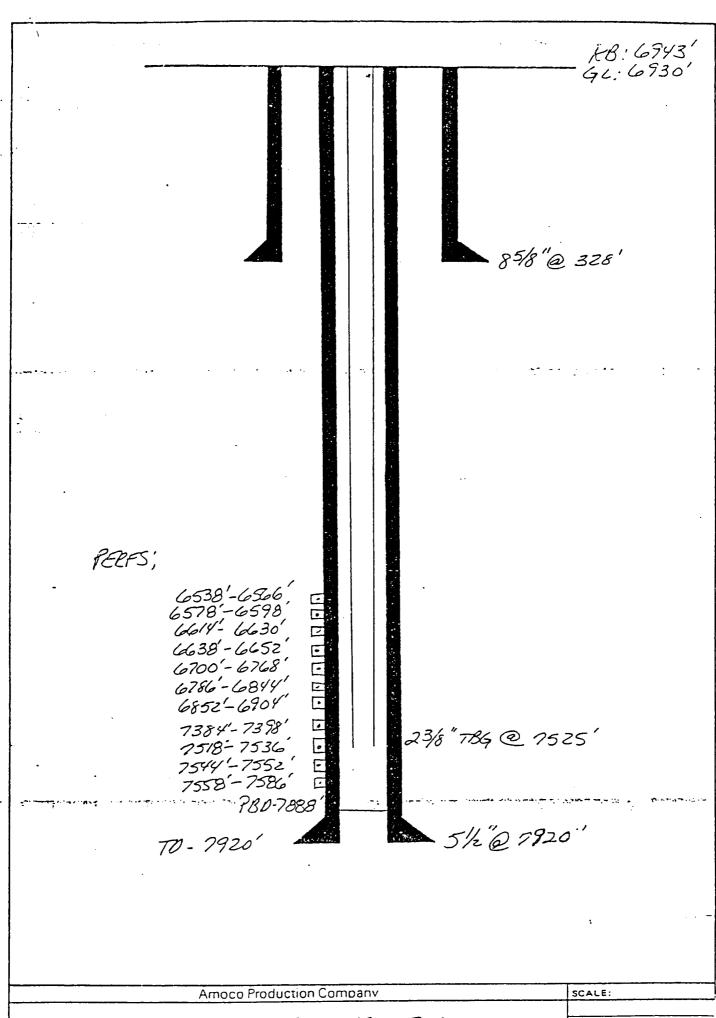

LIAAAIIA AMITAACT 10

149 - 74

lned

