Form 3160-5 (August 1999)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an

FORM APPROVED OMB NO. 1004-0/35 Expires: November 20, 2000

	JIC CONTRACT 148	
6.	If Indian, Allottee or Tribe Name	

abandoned we		6. If Indian, Allottee or Tribe Name JIC APACHE		
SUBMIT IN TRI	PLICATE - Other instruction	ns on reverse side.	7. If Unit or CA	/Agreement, Name and/or No.
1. Type of Well		8. Well Name and No. JIC APACHE 148 37		
Oil Well		9. API Well No. 30-039-23786		
3a. Address P.O. BOX 3092 HOUSTON, TX 77253	10. Field and Po	10. Field and Pool, or Exploratory W. LINDRITH GALLUP-DAKOTA		
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description)		11. County or P	Parish, and State
Sec 13 T25N R05W NENW 99	90FNL 1660FWL		RIO ARRII	BA COUNTY, NM
12. CHECK APPI	ROPRIATE BOX(ES) TO IN	IDICATE NATURE OF I	NOTICE, REPORT, OR O	THER DATA
TYPE OF SUBMISSION		TYPE OI	FACTION	
Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resun	ne) Water Shut-Off
_	☐ Alter Casing	☐ Fracture Treat	□ Reclamation	■ Well Integrity
☐ Subsequent Report	☐ Casing Repair	☐ New Construction	□ Recomplete	☐ Other
☐ Final Abandonment Notice	☐ Change Plans	□ Plug and Abandon	▼ Temporarily Abandon	
	☐ Convert to Injection	□ Plug Back	■ Water Disposal	
On 11/12/2001 Amoco Producto the 4th quarter of 2002. Per our P&A NOI and procedure. BP America Production Compressed integrity test. It is future Saltwater Disposal compressed and procedure.	ermission was granted 11/16/6 eany requests permission to Tour intent to hold the well for version.	01. We respectfully reque emporarily Abandon the v	est to withdraw wellbore and perform a	•
14. I hereby certify that the foregoing is	Electronic Submission #111	63 verified by the BLM Wel	I Information System to the Rio Puerco	
Name(Printed/Typed) CHERRY	HLAVA Cherry H/a	va Title AUTHO	PRIZED REPRESENTATIV	<u>/E</u>
Signature (Electronic	Submission)	Date 05/01/2	2002	
	THIS SPACE FOR	FEDERAL OR STATE	OFFICE USE	
/s/ Patric	ia M. Hester	Landsiand Min	eral Resources	Date MAY 1 4 2002
Conditions of approval, if any, are attache certify that the applicant holds legal or eq which would entitle the applicant to cond	uitable title to those rights in the sub	warrant or oject lease Office		
Fitle 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a crin statements or representations as to a	ne for any person knowingly and any matter within its jurisdiction	willfully to make to any departr	ment or agency of the United


San Juan Basin Well Work Procedure

Well Name: Version: Date: Budget: Repair Type:	Jicarilla Contrac #1 3/25/2002 DRA TXA	t 148- 37		
Objectives:				
1. TXA well SWD cor	bore and perform mechanic oversion.	cal integrity test. Hold for re	ehabilitation of	the GP/DK or future
Pertinent Info Location: County: State: Lease:	rmation: Sec 13 T25N R5W Rio Arriba New Mexico		Horizon: API #: Engr: Phone:	Basin Dakota 30-039-23786 Allen Kutch (281)366-7955
Formation To Nacimento: Ojo Alamo: Kirtland Shale:	ps: (Estimated formation to	ops) Menefee: Point Lookout: Mancos Shale:	5804	
Fruitland: Pictured Cliffs:		Gallup: Graneros:	6998	
Lewis Shale: Chacra: Cliff House:	4540	Dakota: Morrison:	7836	
Bradenhead Test Date:	Test Information: (Tubing:	Casing:	BH:	
Time BH	CSG	INT CSG	_	
5 min 10 min 15 min			_	
Comments:			_	

Temporary abandonment procedure

- 1. Contact Federal and State agencies prior to starting work (NMOCD Charlie Perrin, 505-334-6178 X16, BLM Brian Davis 505-761-8756).
- 2. Check location for anchors. Install if necessary. Test anchors.
- 3. MIRUSU. Check and record tubing, casing and bradenhead pressures.
- 4. Blow down well and kill well, if necessary, with lease water.
- 5. ND wellhead. NU BOP's.
- 6. POOH with 2-7/8" tbg, visually inspecting.
- 7. Make bit x scraper run.
- 8. TIH with CIBP on tbg. Set CIBP at 6950'.
- 9. Load csg with inhibited lease water.
- 10. Attach chart recorder. Test casing to 550 psi for 30 minutes. Fax copy of chart to 281-366-0700, attention Allen Kutch.
- 11. RIH with 2-7/8" tbg. ND BOP, NU WH.
- 12. RDMO SU.

Jicarilla Contract 148-37 - Proposed TXA Configuration 3-25-2002
Rio Arriba County, NM ATK
Unit C Section 13 T25N - R5W
Run 65

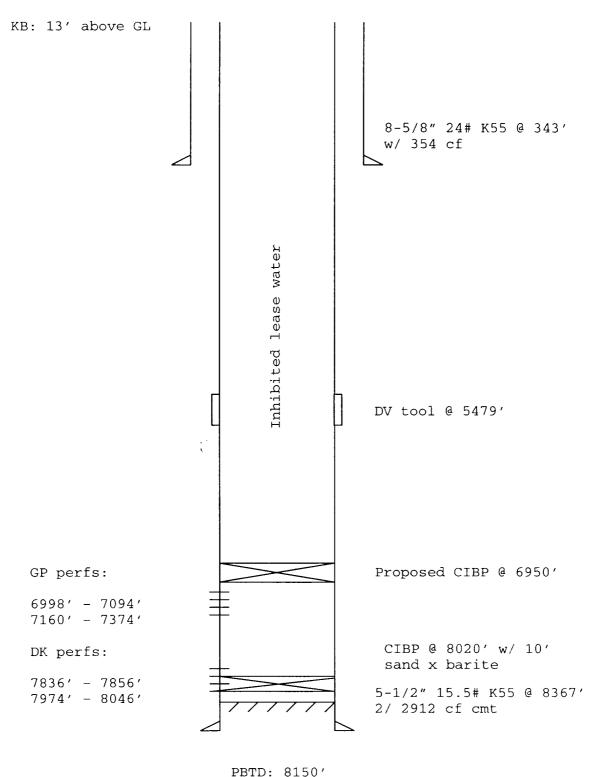

TD: 8367'