

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-		7. Unit Agreement Name
2. Name of Operator El Paso Natural Gas Company		8. Farm or Lease Name Martin
3. Address of Operator PO Box 289, Farmington, NM 87401		9. Well No. 4
4. Location of Well UNIT LETTER _____ 990 _____ FEET FROM THE _____ LINE AND _____ FEET FROM _____ West _____ 3 _____ 29N _____ 11W THE _____ LINE, SECTION _____ TOWNSHIP _____ RANGE _____ N.M.P.M.		10. Field and Pool, or Wildcat Aztec Pic.Cliffs
15. Elevation (Show whether DF, RT, GR, etc.) 5740' GR		12. County San Juan

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>


17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

This well was plugged and abandoned in the following manner:

11-6-81 Moved on location and rigged up.  
11-7-81 Pulled 1" tubing and picked up a 2 3/8" workstring. Spotted a 25 sk (29.5 cu.ft.) cement plug from 2084-1860'. Perforated 4 squeeze holes at 887' (50' below base of Ojo Alamo). Spotted a 45 sk. (53.1 cu.ft.) cement plug from 649' to 887'. Pressure displaced 18 sks. into squeezed holes.  
11-8-81 Perforated 4 squeezed holes 50' below the base of surface pipe at 190'. Circulated out the bradenhead. Spotted a 40 sk. (47.2 cu.ft.) cement plug from 49' to 190'. Pressure displaced 24 sks. into the squeeze holes. Cut off wellhead. Spotted a 10 sk. (11.8 cu.ft.) surface plug and installed dry hole marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Loren W. Feathergill TITLE Sr. Production Engineer DATE 11-12-81

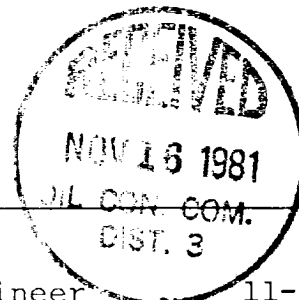

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY: