

3 NMOCD 1 Flag-Redfern 1 File  
OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

5a. Indicate Type of Lease  
State  Fee

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL  GAS WELL  OTHER- \_\_\_\_\_

1. Name of Operator: Flag-Redfern Oil Co.

2. Address of Operator: P O Box 208, Farmington, NM 87401

3. Location of well:  
UNIT LETTER J FEET FROM THE 2310 South LINE AND 2170' FEET FROM  
East LINE, SECTION 33 TOWNSHIP 30 North RANGE 12 West NMPM.

7. Unit Agreement Name

8. Farm or Lease Name: Hargis

9. Well No.: 2

10. Field and Pool, or Wildcat: Fulcher Basin *Kut PC*

15. Elevation (Show whether DF, RT, GR, etc.)

12. County: San Juan


16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
		OTHER _____	<input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Cleaned out to T.D. at 1750'. Set 400' bottom plug from 1750-1350' using 109 cu.ft. cement.
- Set 100' plug seperating the Fruitland and Farmington Formations in and out of casing from 550-650 using 20 sx cement plus 2% calcium chloride.
- Set 200' plug across Ojo Alamo Formation from 250-450 in and out of casing, using 30 sx neat cement.
- Set 20 sk plug at surface.
- Set dry hole marker
- Cleaned and restored location.

Plugged 5-19-82.

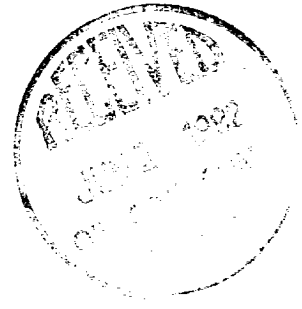

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED: Sherman E. Dugan TITLE: Agent DATE: 5-26-82

Original Signed by CHARLES GHOLSON DEPUTY OIL & GAS INSPECTOR, DIST. #3 DATE: JUN 1982

APPROVED BY: \_\_\_\_\_ TITLE: \_\_\_\_\_ DATE: \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: