

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 078387-A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Kernaghan

9. WELL NO.

1 (OWW0)

10. FIELD AND POOL, OR WILDCAT

Blanco Mesa Verde

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 33, T-31-N, R-8-W
N.M.P.M.

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

1. OIL ☐ WELL GAS ☒ WELL OTHER ☐

2. NAME OF OPERATOR

El Paso Natural Gas Company

3. ADDRESS OF OPERATOR

Box 990, Farmington, New Mexico

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)

At surface
990'S, 1650'W

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6387' GL, 6397'DF

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

PULL OR ALTER CASING ☐

FRACTURE TREAT ☐

MULTIPLE COMPLETE ☐

SHOOT OR ACIDIZE ☐

ABANDON* ☐

REPAIR WELL ☐

CHANGE PLANS ☐

(Other) ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

REPAIRING WELL ☐

FRACTURE TREATMENT ☒

ALTERING CASING ☐

SHOOTING OR ACIDIZING ☐

ABANDONMENT* ☐

(Other) ☐

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

On 8-15-65 tested casing w/3500#. G. K. Perforated Point Lookout 5490-98 w/2 SPF, 5530-34' w/4 SPF; 5554-58' w/4 SPF; 4479-87' w/2 SPF, fraced w/50,000# 20/40 sand and 50,240 gallons water, 2# FR-8/1000 gallons. Flush 4000 gallons. I.R. 50 BPM, Max. pr. 3500#, BDP none, tr. pr. 2600-2800-2100-2500#. Dropped 3 sets of 16 balls each. ISIP 0#. Set GO magnesium bridge plug at 5300'. Tested w/3500# O. K. Perforated Cliff House 5116-20, 5130-34' w/4 SPF; 5144-52' w/2 SPF, fraced w/30,000# 20/40 sand and 29,300 gallons water, 2# FR-8/1000 gallons. Max. pr. 3500#, BDP 0#, tr. pr. 2700-3900-3300#. Dropped 2 sets of 16 balls each. Flush 600 gallons. I.R. 40 BPM.

RECEIVED

AUG 19 1965

U. S. GEOLOGICAL SURVEY
FARMINGTON, N. M.

18. I hereby certify that the foregoing is true and correct

SIGNED OR. G. MAL SIGNED E. S. OBERLY

TITLE Petroleum Engineer

DATE 8-17-65


(This space for Federal or State office use)

APPROVED BY _____

TITLE _____

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

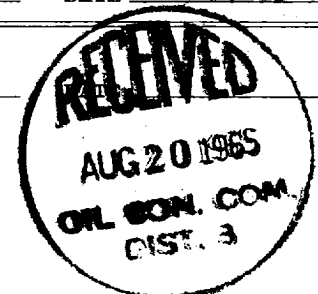

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local areas or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.