

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPlicate  
(Other instructions on reverse side)

Form approved  
Budget Bureau No. 1004-0135  
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> X - Water Injection		5. LEASE DESIGNATION AND SERIAL NO. 14-20-604-1951
2. NAME OF OPERATOR ARCO Oil and Gas Company, a Division of Atlantic Richfield Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME Ute Mountain
3. ADDRESS OF OPERATOR 707- 17th Street, P.O. Box 5540, Denver, Colorado 80217		7. UNIT AGREEMENT NAME Horseshoe Gallup Unit
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface  Unit "L", 2140' FSL & 735' FWL, Section 34 (No API # Assigned)		8. FARM OR LEASE NAME Horseshoe Gallup Unit
14. PERMIT NO.		9. WELL NO. 201
15. ELEVATIONS (Show whether OF, HT, OR, etc.) 5370'		10. FIELD AND POOL, OR WILDCAT Horseshoe Gallup
		11. SEC., T., R., N., OR S.E., AND SURVEY OR AREA Sec. 34-31N-16W
		12. COUNTY OR PARISH San Juan
		13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐  
☐  
☐  
☐

PULL OR ALTER CASING

☐  
☐  
☒ X  
☐

FRACTURE TREAT

MULTIPLE COMPLETION

SHOOT OR ACIDIZE

ABANDON\*

REPAIR WELL

CHANGE PLANE

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐  
☐  
☐

FRACTURE TREATMENT

REPAIRING WELL

☐  
☐  
☐

SHOOTING OR ACIDIZING

ALTERING CASING

ABANDONMENT\*

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

ARCO Oil and Gas Company, Operator, proposes to plug and abandon the subject well, as per the attached P & A Procedure.  
A review of this well indicates that the expected incremental recovery would not justify the cost of activation.

RECEIVED

MAY 29 1985

OIL CON. DIV.  
DIST. 3

(This is in compliance with the requirements set forth in a letter from the Bureau of Land Management, Durango, Colorado, dated March 13, 1985, copy attached.)

18. I hereby certify that the foregoing is true and correct

SIGNED

Stephen Rose  
S.C. Rose / BRS

TITLE Dist. Prod. Supt.

DATE May 8, 1985

(This space for Federal or State office use)

APPROVED BY

Jerry D. Kendrick

TITLE Acting AREA MANAGER

DATE MAY 28 1985

CONDITIONS OF APPROVAL, IF ANY:

## HORSESHOE GALLUP #201

### CURRENT WELL STATUS

#### History

The HGU #201 located in San Juan County, New Mexico was drilled to a depth of 2050' and completed as a Gallup oil well in July 1958. This well was converted to a water injection well in May 1963 as part of the Unit "D" secondary recovery program and was shut-in during October 1972 due to an uneconomical operation.

#### Existing Well Status

##### Casing:

Surface: 9-5/8", set @ 100' cemented to surface w/125 sx cement.

Production: 7", set @ 1334' cemented with 100 sx. Temp survey indicated TOC @ 800.

Tubing: 2-3/8", J-55, EUE 8rd

Packer: Baker 2-3/8" x 7" Model "A" type packer set @ 1182'.

Perforations: 1214' - 1254' @ 2 SPF within the Gallup formation.

Proposed Plugs: 1st Plug: 1110' - 1275'  
2nd Plug: 50' - 150'  
3rd Plug: 0' - 30'

MBS  
JED 5-16-85  
gmm 5/17

HORSESHOE GALLUP UNIT #201  
PLUGGING AND ABANDONMENT PROCEDURE

1. MIRU.
2. Release packer and pull tubing and packer out of hole.
3. RIH with tbg open-ended to below the bottom perforation and pump sufficient cement to cover top perforation by 100' inside the casing.
4. POH w/tbg. GIH w/wireline and shoot enough holes in production casing opposite a point 50' below the surface casing shoe to allow squeezing cement.
5. RIH w/tbg open-ended and perform a braden-head squeeze of the perforations. Use sufficient cement for a 100' column behind the casing and a 100' plug inside the casing.
6. POH, cut casing one foot below ground level, place a 30' cement plug inside casing, weld on a steel plate, weld a dry hole marker on the steel plate, fill hole and move off.
7. Rehabilitate location and access road using stipulations supplied by the surface management agency.

NOTE: BOPs will not be needed in most cases because expected reservoir pressure of the Gallup in the area of abandonment is very low. If pressure does exist on any of the subject wells, bleed it off, install BOPs if needed, and commence with above procedure.



# United States Department of the Interior

BUREAU OF LAND MANAGEMENT  
San Juan Resource Area  
Federal Building  
701 Camino del Rio  
Durango, Colorado 81301

IN REPLY  
REFER TO

3160 (163)

MAR 13 1985

CERTIFIED--RETURN RECEIPT REQUESTED

ARCO Oil and Gas Company  
P. O. Box 5540  
Denver, Colorado 80217

Re: Horseshoe Gallup Unit Wells  
San Juan County, New Mexico  
Lease No. 14-20-604-1951

Dear Sir:


The below mentioned wells have been temporarily abandoned for an extended period of time. Please send to this office five copies of Sundry Notices (Form No. 3160-5) for each well, entitled Notice of Intent to Abandon, within 60 days from receipt of this letter. Plugging operations must commence within 60 days of approval of the Sundry Notices.

Well No. 162, Sec. 27, T.31N., R.16W  
Wells No. 149, 160, 169, Sec. 28, T.31N., R.16W.  
Wells No. 179, 190, Sec. 33, T.31N., R.16W.  
Wells No. 180, 192, 201, 212, 214, Sec. 34, T.31N., R.16W.

If you have any questions, please contact Dennis Carpenter at (303) 247-4082.

Sincerely yours,

*David J. Miller*  
for David J. Miller  
Area Manager

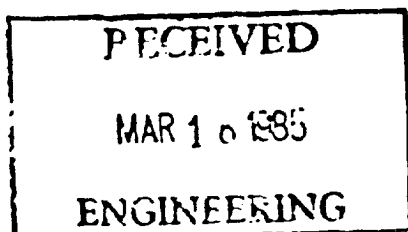

MAR 18 1985  
R.D. Miller