


(SUBMIT IN TRIPLICATE)

Indian Agency Elk Indian

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Allottee Elk Indian Tribal

Lease No. Contract No. 11-  
23-152-46

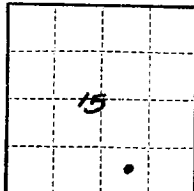

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

March 26, 1959

Well No. 1-15 Indian is located 727 ft. from S line and 200 ft. from E line of sec. 15  
N. 1/4, Sec. 15 1 N 15 S. E. P. M.  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Verde Valley San Juan New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5327 ft. S. L.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

1. Run 71 lbs. 5 1/2" J-55, 15.5' casing on February 13, 1959. Casing landed at 1369' A.K.B. Cemented with 700 lbs. regular cement with 25 gal. Set Baker stage collar at 1325' A.K.B.
2. Cemented second stage thru Baker stage collar with 50 lbs. regular cement with 25 gal on February 13, 1959.
3. Run temperature survey on February 20, 1959. Top of cement at 1104' A.K.B.
4. Run 13 lbs. 2", J-55, 112' tubing on February 23, 1959. Landed at 2322 A.K.B.

ILLEGIBLE

I understand that this plan of work must receive approval in w

enced.

Company Southern Union Gas Company

Address 1001 Hurt Building

Dallas, Texas

By

Title Drilling Superintendent