

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

14-20-603-2033

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Havajo

7. UNIT AGREEMENT NAME

-

8. FARM OR LEASE NAME

Havajo Tribe of Ind. "G"

9. WELL NO.

216

10. FIELD AND POOL, OR WILDCAT

Mary Rocks

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

1-31N-17W

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL ☐ WELL GAS ☒ WELL ☐ OTHER ☐ **Water Injection Well**
2. NAME OF OPERATOR
Humble Oil & Refining Company
3. ADDRESS OF OPERATOR
P. O. Box 120, Denver, Colorado
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
1980' FWL and 1980' FWL of Section 1

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5310' Ground

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)


17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Step 1: Inj. 20 bbl. water w/23 gal. Hume acids, inj. rate 1 bbl./min. Max. psi 1000#. Shut in 1 hr., flowed back 2 bbls. acids water in 45 minutes, died. Tried to /inj. acid, could not pump into well.

Step 2: Clean paraffin and sand from casing, tried paraffin knife and bailer, note successful. Ran 1-1/4" tubing and hot watered paraffin from well. Circulated 39' free sand from well, cleaned to FBTD 1290'. Perforations 1291-1341'.

Step 3: Pumped 1250 gal. 15% HCL w/FE additive. Max. psi 1700#, inj. rate 8 bbl./min. Average injection rate 7-3/4 bbl./min @ 1500#. Flushed with 8 bbl. water. Immed. shut in 800#, 5 min. shut in 700#. Left shut in 2 hours before opening well for water injection.

Job completed: January 30, 1963.

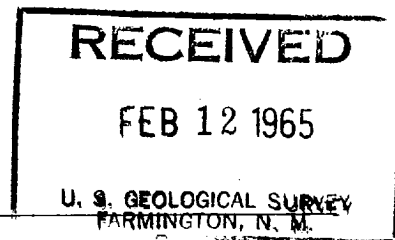

18. I hereby certify that the foregoing is true and correct

SIGNED **COPY (ORIGINAL) B. M. BRADLEY**

TITLE **Area Oper. Supt.**

DATE **2-10-63**

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE _____

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.