

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 078244

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

LEA

9. WELL NO.

1-M

10. FIELD AND POOL, OR WILDCAT

BLANCO MESA VERDE

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

SEC. 30 T-31N R-12W

1. OIL ☐ GAS ☒ OTHER ☐
WELL WELL

2. NAME OF OPERATOR

CONDOLIDATED OIL AND GAS, INC.

3. ADDRESS OF OPERATOR

P.O. BOX 2038 FARMINGTON, NEW MEXICO 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

790' FNL AND 1680' FWL SEC. 30 T-31N R-12W

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5899 GL

12. COUNTY OR PARISH

SAN JUAN

13. STATE

N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

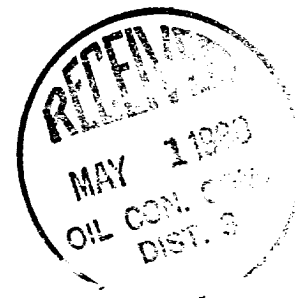
ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

FRAC IN 3 STAGES

1ST STAGE IN 3-16-80 PERF IN, 4707-12-20-56-60-72-76-80-86-95-4828-35-48-65. ACIDIZED
W/1000 GAL 15% N.E. ACID.3-16-80 FRAC W/60,500 GAL. 70 QUALITY FOAM & 35,120# 20-40 SAND. MAX PRES. 4000#.
avg. PRES. 3100#. AVG. INJ. RATE, 30 BPM.2ND STAGE IN 3-18-80 PERF IN, 4585-90-96-4600-07-12-16-20-24-28-32-36-40-45-50-54-60-
65. ACIDIZED W/1000 GAL 15% N.E. ACID.FRAC W/124,500 GAL., 70 QUALITY FOAM AND 100,000# 20-40 SAND AND 40,000# 10-20 SAND.
MAX. PRES. 2550#. AVG. PRES. 2500#. AVG. INJ. RATE 30 BPM.3RD STAGE IN 3-21-80 PERF IN, 4180-83-86-4214-16-56-60-63-66-4394-99-4402-06-10.
ACIDIZED W/1700 GAL 15% N.E. ACID.3-22-80- FRAC W/67,150 GAL. 70 QUA. FOAM AND 33,000# 20-40-SAND. MAX PRES. 4000#.
AVG. PRES. 3200#. AVG. INJ. RATE, 30 BPM.

18. I hereby certify that the foregoing is true and correct

SIGNED

Caryl Moore

TITLE

PROD. SUPT.

DATE

4-22-80

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

TOPS:
DK--- 6721'
NW--- 3000'