

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION FOR PERMIT--" for such proposals

5. Lease Designation and Serial No.
14-20-603-585

6. If Indian, Allottee or Tribe Name
Navajo

7. If Unit or CA, Agreement Designation

8. Well Name and No.
Navajo AA No. 4

9. API Well No.
30-045-11459

10. Field and Pool, or Exploratory Area
North Many Rocks Gallup

11. County or Parish, State
San Juan, NM.

SUBMIT IN TRIPLICATE

1. Type of Well
☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator
21st Century Investment Corp.

3. Address and Telephone No. **C/O Walsh Engineering & Production Corp.**
7415 East Main Farmington, NM 87402 505-327-4892

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
2310' FNL & 330' FWL, Sec. 17, T32N, R17W

CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water
(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

21st Century Investment Corp. plans to plug and abandon the above mentioned well as per the attached procedure.

RECEIVED
DEC 1 9 1996
OIL GAS DIV
BOL 8

14. I hereby certify that the foregoing is true and correct

Signed *John C. Thompson* (John C. Thompson) Title Agent Date 12/05/96

(This space for Federal or State office use)

Approved by _____
Conditions of approval, if any:

Title _____

Date _____

APPROVED


DEC 1 2 1996

DISTRICT MANAGER

RECEIVED


Navajo AA No. 4
2310' FNL & 330' FWL
Sec 17 T32N R17W

P&A Status

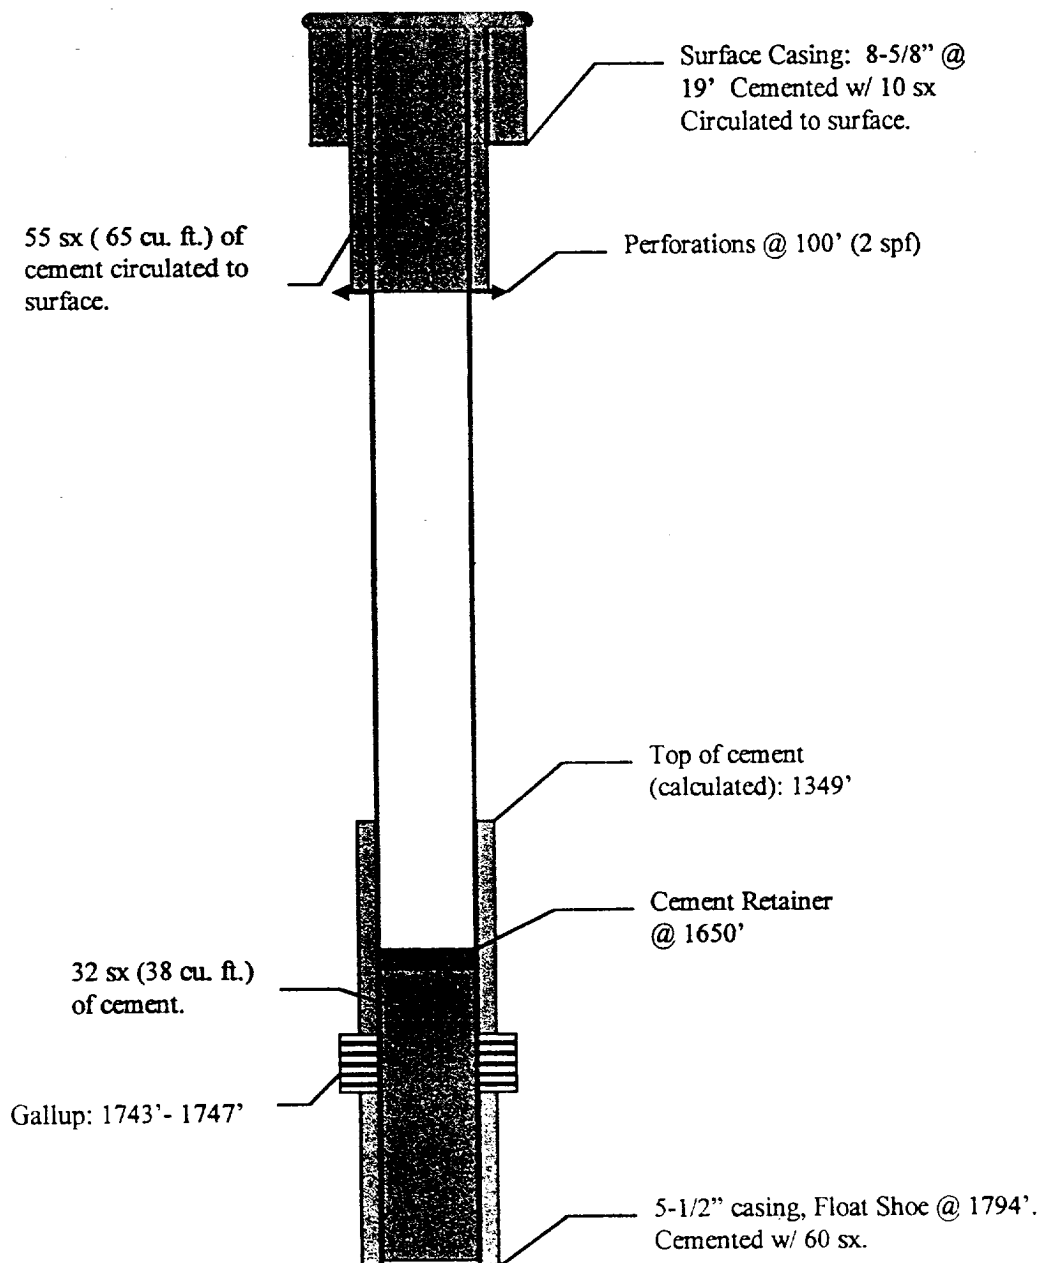

Navajo AA No. 4
2310' FNL & 330' FWL
Sec 17 T32N R17W

Current Status

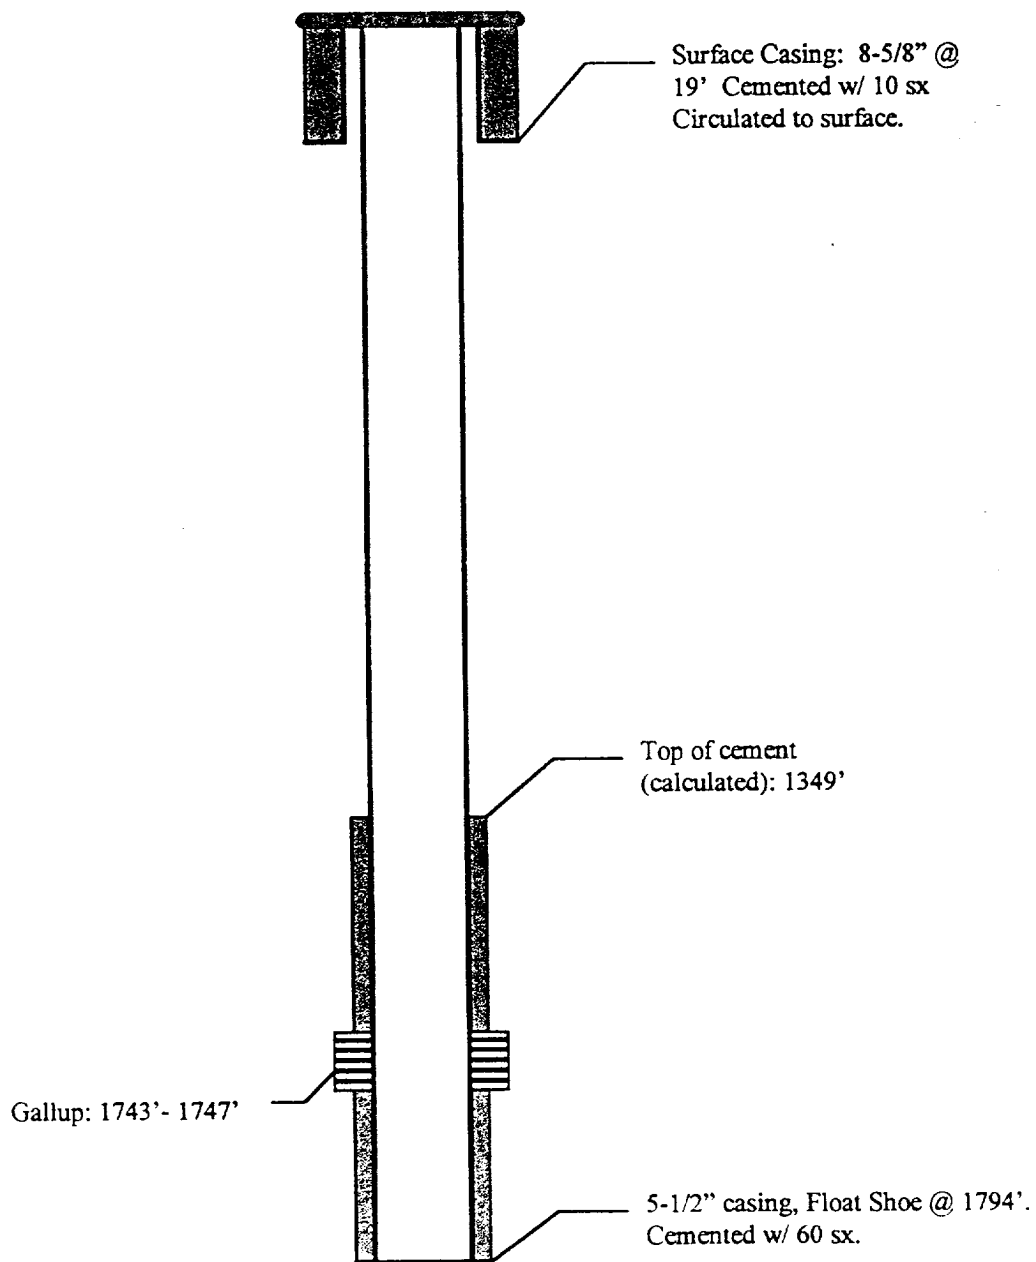



ENGINEERING & CONSTRUCTION CORP.

RECEIVED
BLM

06 DEC -9 PM 1:53

070 FARINGTON, NM

**Plug & Abandon Procedure for
21st Century Investment Corp.
Navajo AA #4**

Location: Section 17 T32N R17W
San Juan County, New Mexico

Date: December 5, 1996

Procedure:

1. MOL & RU pulling unit. Haul in 2-3/8" work string. Hold safety meeting.
2. Blow well down and ND tubing head and NU BOP. Lay 2-3/8" flow line to pit. Pressure test BOP.
3. Lay down rods and/or tubing. Note: Records do not indicate what type of production strings are currently in the hole, ie. tubing, rods, pumps, etc.
4. PU cement retainer & TIH on 2-3/8" tubing. Set cement retainer at 1650' (100' above Gallup perforations).
5. Mix and pump 32 sx (38 cu.ft.) of cement. Sting out of cement retainer & TOH.
6. Perforate 2 holes in 5-1/2" casing at 100'.
7. Circulate 55 sx (65 cu. ft.) of cement down 5-1/2" and up 8-5/8" x 5-1/2" annulus through perfs at 100'.
8. ND BOP and cut off well head below surface casing. Install P&A marker. Rig down & release rig.
9. Clean location and restore as per BLM requirements.

Note: All cement volumes are calculated w/ 100% excess.

John C. Thompson
Engineer