# Fasken Oil and Ranch, LTD. Denton SWD #5 Delineation Plan Unit N, Section 2, Township 15S, Range 37E Lea County, New Mexico

August 8, 2007



Prepared for:

Fasken Oil and Ranch, LTD. 303 W. Wall Suite 1800 Midland, Texas 79701-5116

By:

Safety & Environmental Solutions, Inc. 703 E. Clinton Suite 102 Hobbs, New Mexico 88240 (505) 397-0510

### TABLE OF CONTENTS

COMPANY CONTACTS1
BACKGROUND1
SURFACE AND GROUND WATER1
SOILS1
ACTION PLAN1
FIGURES & APPENDICES

### I. Company Contacts

NAME	Company	Telephone	E-mail
Jimmy Davis	Fasken	432-818-0267	jimmyd@forl.com
Jimmy Carlile	Fasken	432-818-0210	jimmyc@forl.com

### II. Background

Safety and Environmental Solutions, Inc. (SESI) was engaged by Fasken Oil and Ranch, LTD. to perform cleanup services at the Denton SWD #5 Tank Battery. The facility was affected by an overflow in the tanks caused by an injection pump failure. Approximately 205 barrels of produced fluid were released, 195 barrels were recovered. The spill was contained inside the bermed area.

#### III. Surface and Ground Water

The closest groundwater of record listed with the New Mexico office of the state engineer is located in the same section, range and township. The depth of water in this well was 47' in 1974. SESI has a monitor well installed approximately 3,634 northeast of this site. The depth of water in this well was 69.41' in March of this year

#### IV Soils

The surface soils in the area are predominantly sand and sandy loam.

#### V. Action Plan

Four (4) soil borings will be installed inside the spill area to determine the vertical extent of contamination. The soil borings will be drilled to a depth where the TPH and Chloride concentrations in the soil are less than 100 ppm and 250 ppm respectively.

Grab samples will be retrieved every 5' in each soil boring. The samples collected will be properly preserved and transported along with Chain of Custody to Argon Laboratories of Hobbs, New Mexico for analysis. Laboratory samples will be analyzed for Total Petroleum Hydrocarbons (EPA Method 418.1), BTEX (EPA Method SW-846-8260), and Chlorides (EPA Method 4500-Cl<sup>-</sup>B).

After samples are retrieved the soil borings will be backfilled from total depth to surface with bentonite.

Upon completion of the delineation, a work plan for the cleanup will be submitted to the NMOCD.

### VI. Figures & Appendices

Figure 1 – Vicinity Map Figure 2 – Site Plan Appendix A – C-141 Appendix B - Site Photos Figure 1 Vicinity Map


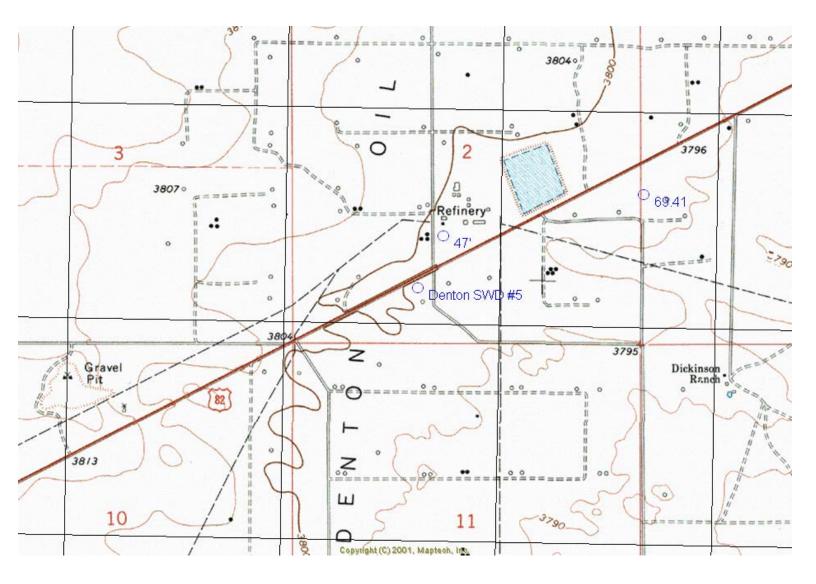


Figure 2 Site Plan

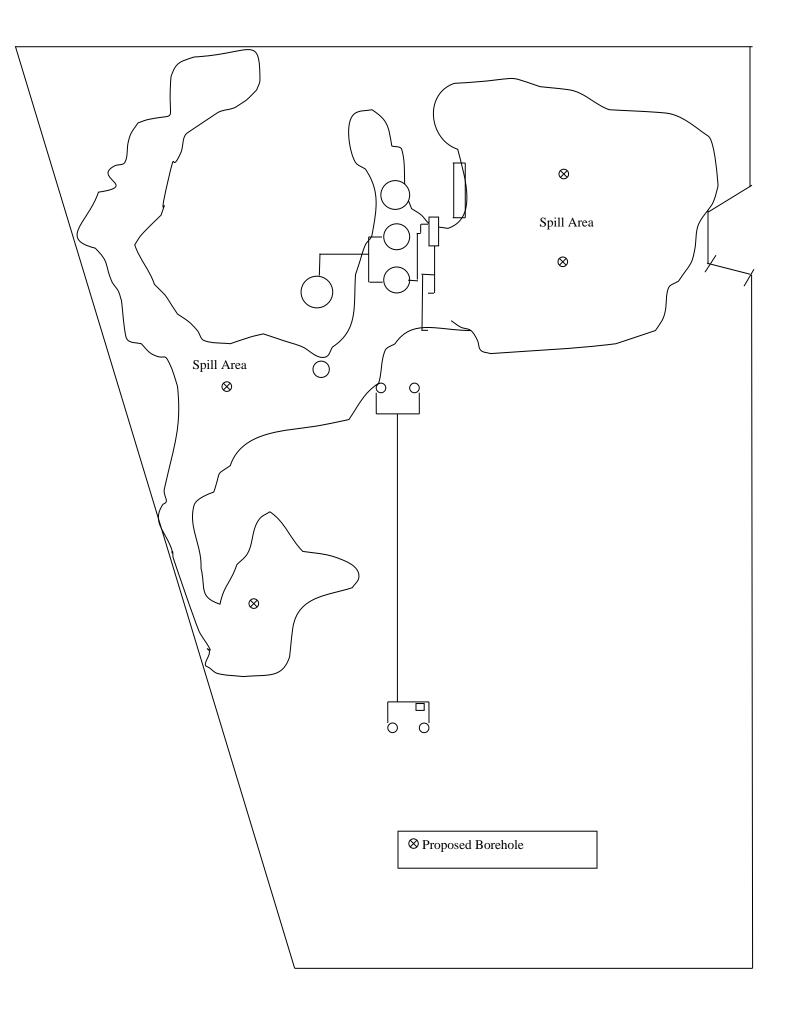

Appendix A C-141 FASKEN ENG

図001 Conested 10550

Form C-141 Revised October 10, 2003

side of form

Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 <u>District III</u> 1301 W. Grand Avenue, Artesia, NM 88210 <u>District III</u> 1000 Rio Brazos Road, Aztec, NM 87410 <u>District IV</u> 1220 S. St. Francis Dr., Santa Fe, NM 87505 State of New Mexico Energy Minerals and Natural Resources

> Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

## Fe, NM 87505

#### **OPERATOR** X Initial Report **Final Report** П Contact Name of Company Fasken 011 and Ranch, Ltd. Jimmy D. Carlile Telephone No. Address 303 W. Wall, Ste 1800 Midland, TX 432.687-1777 Facility Type Salt Water Disposal Facility Name Denton SWD No. 5 Lease No. Mineral Owner Surface Owner Darr Ange11 Fee LOCATION OF RELEASE East/West Line County North/South Line | Feet from the Township Feet from the Unit Letter Section Range 1980 Lea 2 158 37E 660 south west N Longitude Latitude 15 BW NATURE OF RELEASE 20 BW Volume of Release 185 BO Volume Recovered salt water/oil 180 ጽስ Type of Release Date and Hour of Discovery Date and Hour of Occurrence Source of Release stock tank If YES, To Whom? 4/26/07 1 am Was Immediate Notice Given? 4/26/07 1 am K Yes 🔲 No 🗌 Not Required Datc and Hour By Whom? Jimmy D. Carlile If YES, Volume Impacting the Watercourse. Was a Watercourse Reached? 🗋 Yes 🖾 No If a Watercourse was Impacted, Describe Fully.\* NA ć Describe Cause of Problem and Remedial Action Taken.\* Injection pump failed. Pump to be repaired. Describe Area Affected and Cleanup Action Taken.\* Area affected inside of bermed facility. Fluids picked up by vacuum trucks, I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations. OIL CONSERVATION DIVISION Signatore: Approved by District Supervisor: Carlile Jimmy D. Printed Name: Regulatory Affairs Coor. **Expiration Date:** Approval Date: Title: Conditions of Approval: Attached E-mail Address: jimmyc@forl.com Phone: 432 687-1777 4/26/07 Date

\* Attach Additional Sheets If Necessary

### Release Notification and Corrective Action

Appendix B Site Photos























