

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT


Oil Cons.
N.M. Div. Dist. 2
1301 W. Grand Avenue
Artesia, NM 88210

Hobbs

FORM APPROVED
OMB No. 1004-0135
Expires July 31, 1996

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

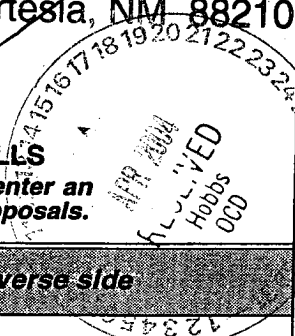

Lease Serial No.
031621B

If Indian, Allottee or Tribe Name

If Unit or CA/Agreement, Name and/or No.

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well
 Oil Well Gas Well Other Injection

2. Name of Operator
ConocoPhillips Co.

3a. Address 4001 Penbrook St., Odessa, TX 79762
3b. Phone No. (include area code) (432) 368-1667

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
2280' FSL & 2020' FWL, Sec. 15, T-20-S R-37-E

8. Well Name and No.
Britt B #28

9. API Well No.
30-025-30470

10. Field and Pool, or Exploratory Area
Monument Tubb/Skaggs Abo

11. County or Parish, State
Lea County, New Mexico

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other Stuck Pump
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

(1) 1/20/2004: HELD PJSM. MIRU PULLING UNIT, UNHANG WELL. LONG STROKE PUMP, PUMP STICKING ON UP STROKE. TRIED TO UNSEAT PUMP, PUMP STUCK. JARRED ON PUMP, PUMP STILL STUCK. SHUT WELL IN, SION.

(2) 1/21/2004: HELD PJSM. JAR ON PUMP, PUMP STUCK. BACK RODS OFF. COOH WITH RODS. MIRU PUMP TRUCK, KILL WELL. ND WELLHEAD, NU BOP. PULL TUBING TO RODS. CONTINUE STRIPPING WELL OOH. SHUT WELL IN, SION.

ACCEPTED FOR RECORD
APR 12 2004

*** CONTINUED ON BACK ***

14. I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

GARY GOURLEY
PETROLEUM ENGINEER

Regulatory Analyst

Signature Celeste G. Dale

Date 2/12/2004

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by	Title	Date
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Office	

Continued:

RECEIVED

2004 APR -7 AM 7:29

BUREAU OF LAND MGMT.
ROSWELL OFFICE

Britt B #28

- (3) **1/22/2004:** HELD PJSM. OPEN WELL, FINISH COOH WITH TUBING AND RODS. PICK UP DEBRIS TOOL, RAN IN HOLE WITH DEBRIS TOOL ON SAND LINE. MADE 4 RUNS, RECOVERED SCALE AND IRON. SHUT WELL IN, SION.
- (4) **1/23/2004:** HELD PJSM. OPEN WELL, PICKUP BIT AND BAILER. RIH WITH 6-1/4 BIT AND BULLDOG BAILER ON TUBING. RAN TO 6084', HIT BUILD UP ON SIDE WALLS AT 6084'. TAGGED UP AND HIT FILL AT 7045'. CLEANED OUT FILL TO 7088'. COOH WITH TUBING AND BAILER. DUMP BAILER. RIH WITH HALF OF PRODUCTION STRING, OPEN ENDED SN 25 JTS POLY LINED TUBING, TAC AND 102 JTS 2-3/8 TUBING. SHUT WELL IN, SION.
- (5) **1/26/2004:** HELD PJSM. TOO WINDY TO WORK, SHUT DN.
- (6) **1/27/2004:** HELD PJSM. OPEN WELL, FINISH RIH WITH TUBING. MIRU PUMP TRUCK, KILL WELL, ND BOP, NU WELLHEAD. PUMP 500 GAL XYLENE FOLLOWED WITH 10 BBLS FLUSH TREATED BW DN TUBING. WAIT 3 HRS. PUMP 500 GAL 15% ACID FOLLOWED WITH 10 BBLS TREATED BW DN TUBING. SHUT WELL IN, SION.
- (7) **1/28/2004:** HELD PJSM. OPEN WELL AND MADE 5 SWAB RUNS. FLUID CLEANED UP. PICKUP PUMP, RIH WITH PUMP AND RODS. SPACE WELL OUT, MIRU HOT OILER, LOAD AND TEST, 500 PSI, OK. PUMP WOULD NOT PUMP. UNSEAT PUMP, RESEAT PUMP, LONG STROKE PUMP. RE LOAD PUMP, PUMP WOULD STILL NOT PUMP. UNSEAT PUMP AND LEFT IT HANGING. SHUT DN, SION.
- (8) **1/29/2004:** HELD PJSM. OPEN WELL, MIRU PUMP TRUCK, DISPLACE 15 BBLS FW WITH CORROSION INHIBITOR, PARAFFIN DISPERSANT, AND RN 211 DN TUBING. SEAT PUMP, LOAD TUBING HELD 500 PSI, BUT WOULD NOT PUMP. LONG STROKE PUMP, NO PUMP ACTION. RD PUMP TRUCK. UNSEAT PUMP, COOH WITH PUMP, NO PUMP ACTION. RD PUMP TRUCK. UNSEAT PUMP, COOH WITH PUMP. R&R PUMP. SWAB ON WELL. PUMP TEAR DN, FOUND POLY LINE SHAVING ON TOP OF PLUNGER. FOUND IRON AND SCALE PACKED BELOW PLUNGER IN PUMP BARREL AND STANDING VALVE. HAD CHAMPION CHEMICAL REP ANALYZE. MIRU PUMP TRUCK DISPLACE 27.5 GAL DT-78 AND 165 GAL TA-25 DN TUBING FOLLOWED WITH 30 BBLS FW TREATED WITH RN-211. OPEN CASING AND DISPLACE 50 BBLS FW TREATED WITH RN-211 DN CSG. SHUT WELL IN, SION.
- (9) **1/30/2004:** HELD PJSM. OPEN WELL, RIH WITH PUMP, SPACE WELL OUT. MIRU PUMP TRUCK, LOAD AND TEST, 500 PSI, OK. PUMP WOULD NOT PUMP, LONG STROKE PUMP. STILL NO PUMP ACTION. COOH WITH PUMP. SHUT WELL IN.
- (10) **2/2/2004:** HELD PJSM. OPEN WELL, MIRU PUMP TRUCK, KILL WELL. ND WELLHEAD, NU BOP. RIG PUMP TRUCK. RIH TFF, TAGGED FILL WITH 4' OF TUBING. FILL AT 7066'. COOH WITH TUBING. LAY DN BOTTOM 25 JTS 2-7/8 POLY LINED TUBING. FOUND 4 JTS WITH POLY LINED COLLAPSE INSIDE TUBING. DECIDED TO LEAVE ALL 25 JTS OUT AND SEND IN FOR INSPECTION. WAIT ON REPLACEMENT TUBING, (23 JTS 2-7/8 POLY LINED). PICK UP REPLACEMENT TUBING, RIH WITH PRODUCTION TUBING, LANDING SEAT NIPPLE AT 7006' WITH BOTTOM OF SOPMA AT 7033'. MIRU PUMP TRUCK, KILL WELL. ND BOP, NU WELLHEAD. RIG DN PUMP TRUCK. SHUT WELL IN SION.
- (11) **2/3/2004:** HELD PJSM. OPEN WELL, AND RIH WITH PUMP AND RODS. MIRU PUMP TRUCK, LOAD AND TEST, 500 PSI, OK. HANG WELL ON, RIG DN PULLING UNIT. WILL MOVE PULLING UNIT OFF LOCATION.