

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-11666
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Justis, V.H.
8. Well No. #002
9. Pool name or Wildcat Jalmat Tansill Yates 7 Rivers

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐ **Injection**

2. Name of Operator
Bettis, Boyle & Stovall

3. Address of Operator
P.O. Box 1240, Graham, Texas 76450

4. Well Location
Unit Letter **D** : **370** feet from the **North** line and **420** feet from the **West** line

Section **20** Township **25-S** Range **37-E** NMPM County **Lea**

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3,084 DF

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

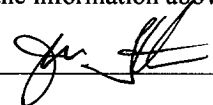
12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

04/15/04 Notified OCD. MIRU Triple N rig #23 and plugging equipment. Dug working pit. ND wellhead, NU BOP. RIH w/ 2 3/4" workstring tbg and tagged CIBP @ 3,000'. RU cementer and circulated hole w/ mud, pumped 25 sx C cmt 3,000 - 2,753'. POOH w/ tbg to 1,030'. Pumped 25 sx C cmt @ 1,030'. POOH w/ tbg, SDFN. OCD Buddy Hill on location.

04/16/04 RU wireline. RIH w/ wireline to 367' and perforated. POOH w/ wireline. NU wellhead. Squeezed 70 sx C cmt @ 367', displaced w/ 6 bbl brine. WOC and tagged plug @ 259'. RIH w/ tbg and pumped 10 sx C cmt 60' to surface. RDMO.

Cut off wellhead and anchors, capped well, installed marker. Backfilled pit and cellar.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE engineer DATE 04/28/04

Type or print name James F. Newman, P.E. Triple N Services, Inc. Telephone No. 432-687-1994

(This space for State use)

APPROVED BY  TITLE OC FIELD REPRESENTATIVE II / STAFF MANAGER DATE MAY 11 2004

Conditions of approval, if any:

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.