

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
August 1, 2011

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-23127
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator J M Cox Resources, LP		6. State Oil & Gas Lease No. 300982
3. Address of Operator P O Box 2217, Midland, TX 79702		7. Lease Name or Unit Agreement Name Shell B State Com
4. Well Location Unit Letter A : 510 feet from the N line and 660 feet from the E line Section 5 Township 12S Range 33E NMPM County Lea		8. Well Number 1
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 4259 GR		9. OGRID Number 230601
		10. Pool name or Wildcat Bagley; Permo Penn North

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		E-PERMITTING <SWD INJECTION>	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REM ☐	CONVERSION ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	CON ☐	RETURN TO ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CAS ☐	CSNG ☐
DOWNHOLE COMMINGLE ☐			INT TO P&A NR ☐
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- MIRU plugging equipment. TAG CIBP @ 9720'. CAP w/CMT IF NECESSARY
- Set 4 1/2 CIBP @ 9400'. Circulate hole w/ mud laden fluid and Spot 20 sx cement on top of CIBP.
- Perf & Sqz 45 sx cement @ 7800-7900. WOC & TAG
- Perf & Sqz 45 sx cement @ 5100-5000. WOC & TAG
- Cut and POH 4 1/2 csg @ 3750'.
- Spot 45 sx cement @ 3800-3700. WOC & Tag. (stub and shoe)
- Perf & Sqz 65 sx cement @ 2420-2320'. (salt)
- Perf & Sqz 65 sx cement @ 427-327. WOC & Tag (shoe)
- Perf & Sqz 65 sx cement @ 60' to surface.
- Cut off well head and weld on Dry Hole Marker.

The Oil Conservation Division

MUST BE NOTIFIED 24 Hours

Prior to the beginning of operations

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ben Montgomery TITLE Agent DATE 6-3-15

Type or print name Ben Montgomery E-mail address: benmontgomery@nmsr.com PHONE: 432-580-7161

For State Use Only


APPROVED BY: Mary Brown TITLE Dist Supervisor DATE 6/3/2015

Conditions of Approval (if any):

JUN 08 2015

NB

JM Cox Resources
 Shell B State Com #1
 30-025-23127

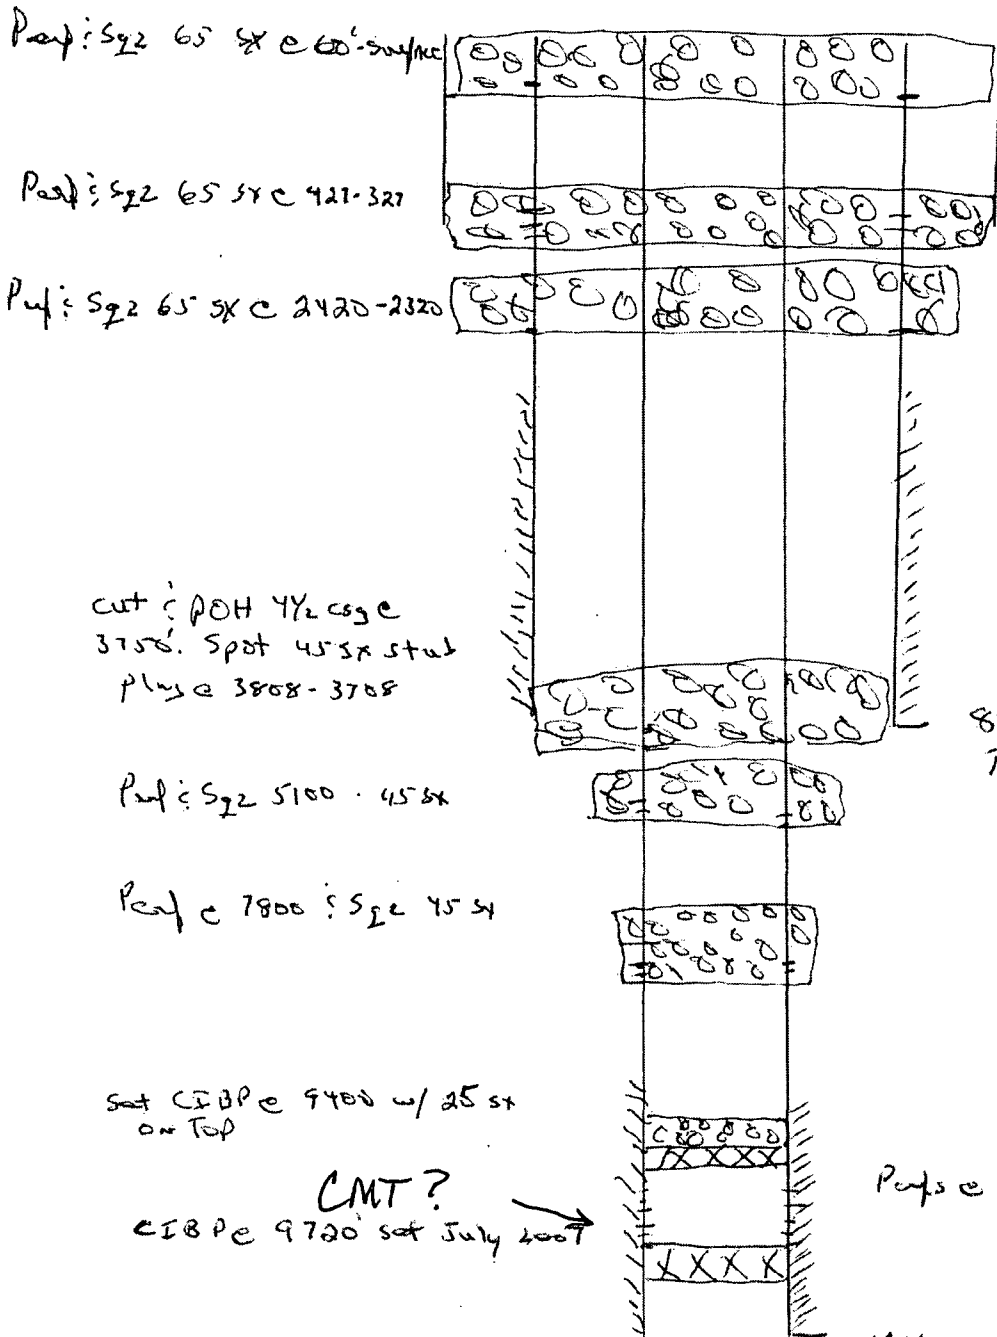

13 3/8 c 377 w/ 325 5x
 cinc

8 5/8 c 3758 w/ 400 st
 TOC 185-0

Perf c 9430 - 9685

4 1/2 c 10,200 w/ 500 5x
 TOC 8400