

Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

October 13, 2009

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-27664
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Justis Christmas
8. Well Number 1
9. OGRID Number 2175
10. Pool name or Wildcat Jalmat Tansill Yates Seven Rivers

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☒ Other

2. Name of Operator
Bettis, Boyle, & Stovall, Inc.

3. Address of Operator
PO Box 1240, Graham, TX 76450

4. Well Location

Unit Letter **E** : **2225** feet from the **North** line and **790** feet from the **West** line
Section **20** Township **25S** Range **37E** NMPM County **Lea**

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3053.1 GL

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT F

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING/CEMENT JOB ☐

OTHER: ☐

INT TO PA **AMX**
P&A NR
P&A R

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. MIRU Plugging equipment. ND wellhead, NU BOP

2. RIH w/ workstring & tag CIBP @ 2700'.

3. Circulate hole w/ Mud Laden Fluid.

4. Spot 28 sx cement on top of CIBP @ 2700-2600'.

5. Spot 30 sx cement @ 2350-2510'.

6. Spot 30 sx cement @ 1070-1170'.

7. Spot 30 sx cement @ 680-580'. Tag.

8. Spot 30 sx cement @ 150- Surface.

9. Cut off wellhead & weld on Dry Hole Marker.

Pressure test csg & report
results to OCD
WOC & TAG

Verify cement to surface.

* A closed loop system will be used.

T.SALT 1103'
B.SALT 2586'

Spud Date:

Rig Release Date:

NOTIFY OCD 24 HOURS PRIOR TO BEGINNING
PLUGGING OPERATIONS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Kyle Berend

TITLE

REGULATORY ANALYST

DATE

04/18/16

Type or print name

KYLE BEREND

E-mail address:

kberend@bbsoi.com

PHONE:

940-549-0780

For State Use Only

APPROVED BY:

Mark C. Lintan

TITLE

Petroleum Engr. Specialist

DATE

4-26-2016

Conditions of Approval (if any):

APR 26 2016

WJ

API # 30-025-27664

Lat 32.1169167

Long -103.1908188

Date 05/29/12


BETTIS, BOYLE & STOVALL

Lease JUST IS CHRISTMAS Well No. 1 County LEA

Location Unit E; 2225' FNL 790' FWL State NM


Section 20, Township 25S, Range 37E Spud Date 02/08/82

GL 3053 DF _____ KB _____ Comp. Date _____

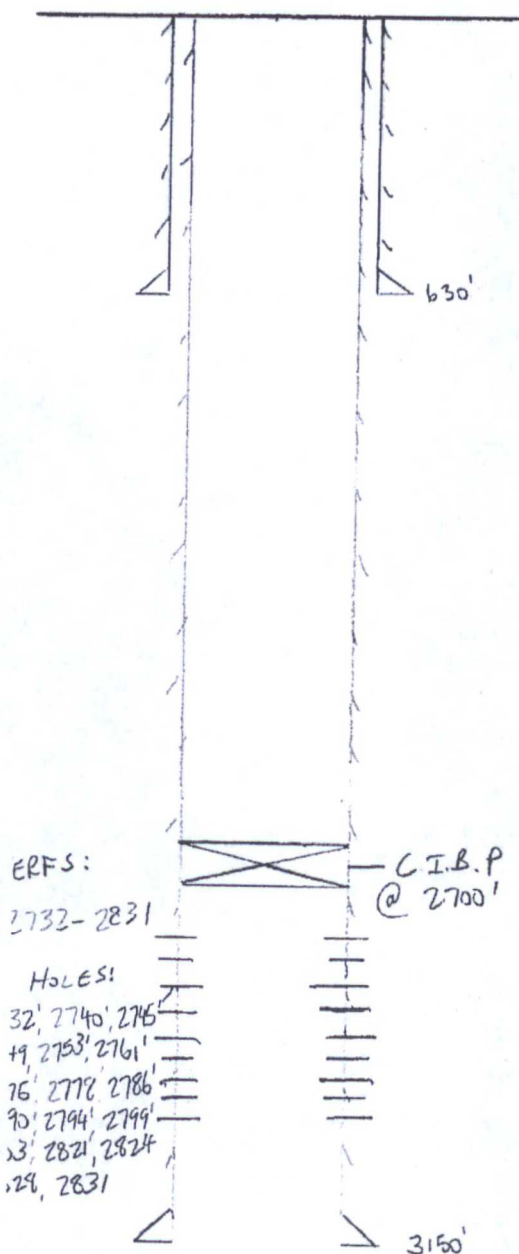

Conductor _____
Hole Size _____
Cement _____

Surface 9 5/8", 40# @ 630'
Hole Size 12-1/4"
Cement 350 sx, CIR to SUR

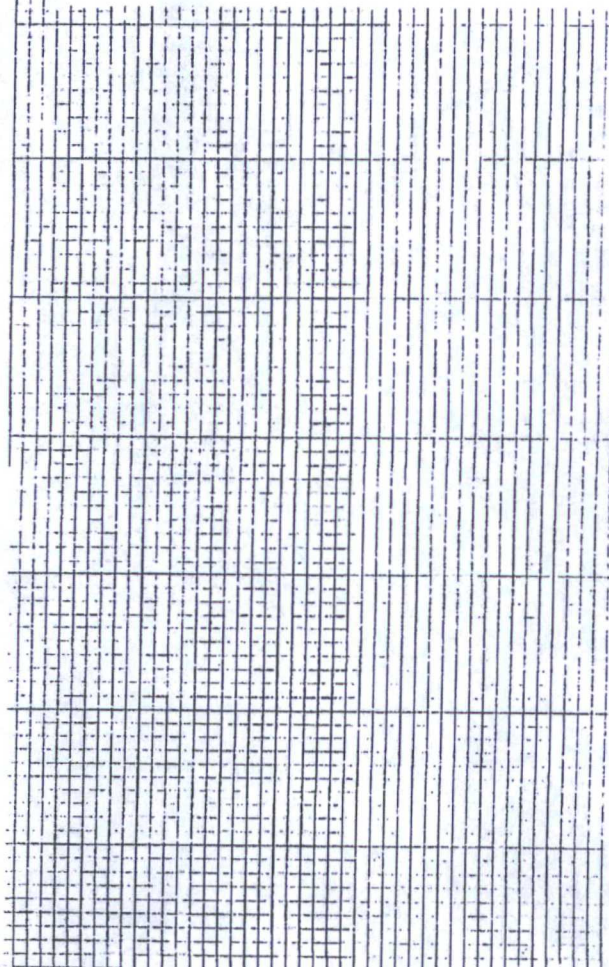

Prod. Csg. 7", 23# @ 3150'
Hole Size _____
Cement 400 sx Class A
200 sx Class C, CIR to SUR
Total Depth 3150 PBTD 3145'