

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB NO. 1004-0137
Expires: January 31, 2018

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.

5. Lease Serial No. NMNM0766 ✓
6. If Indian, Allottee or Tribe Name
7. If Unit or CA/Agreement, Name and/or No. NMNM87877X ✓

SUBMIT IN TRIPLICATE - Other instructions on page 2

HOBBS OCD
SEP 11 2017
RECEIVED

1. Type of Well <input type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other: INJECTION		8. Well Name and No. SJU TR-D 240 ✓
2. Name of Operator LEGACY RESERVES OPERATING LP-Email: jsaenz@legacylp.com		9. API Well No. 30-025-32074-00-S1
3a. Address 303 W WALL SUITE 1600 MIDLAND, TX 79702	3b. Phone No. (include area code) Ph: 432-689-5200	10. Field and Pool or Exploratory Area JUSTIS
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec 26 T25S R37E SENE 2200FNL 1000FEL ✓		11. County or Parish, State LEA COUNTY, NM

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION		
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/I
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Hydraulic Fracturing	<input type="checkbox"/> Reclamation
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abar
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal

INT TO PA **Pm X**
P&A NR _____
P&A R _____

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleation in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

NOTE: All plugs to be minimum 25 sacks of cement.
Casing leak at 4755'-4788'

Proposed P&A Procedure:

- MIRU. Pick up work string.
- RIH and set CIBP at 5020'. Spot 25 sx of cement on top of CIBP.
- Circulate minimum 9.5 ppg P&A mud to surface. Pressure test casing and isolate casing leak.
- TOOH to 4800'. Spot 25 sx of cement plug from 4800' to 4700'. Tag TOC.
- TOOH to 2300'. Spot 25 sx of cement plug from 2300' to 2200'.
- TOOH to 1100'. Spot cement plug from 1100' to 900'.
- TOOH to 100'.
- Circulate cement from 100' to surface.

**SEE ATTACHED FOR
CONDITIONS OF APPROVAL**

**SUBJECT TO LIKE
APPROVAL BY STATE**

WITNESS

14. I hereby certify that the foregoing is true and correct. Electronic Submission #379117 verified by the BLM Well Information System For LEGACY RESERVES OPERATING LP, sent to the Hobbs Committed to AFMSS for processing by PRISCILLA PEREZ on 06/21/2017 (17PP0398SE)	
Name (Printed/Typed) JOHN SAENZ	Title OPERATIONS ENGINEER
Signature (Electronic Submission)	Date 06/19/2017

APPROVED

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By	Title T PET	Date 08/23/17
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.		BUREAU OF LAND MANAGEMENT CARLSBAD FIELD OFFICE

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

**** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ****

FOR RECORD ONLY
MW/OCD 09/12/2017

Additional data for EC transaction #379117 that would not fit on the form

32. Additional remarks, continued


9. POOH, top off casing, remove WH, set P&A marker, clean and reclaim location.

Current & proposed wellbore diagrams attached.

Wellbore Schematic (From Surface to TD)

Printed: 6/9/2017

Page 1

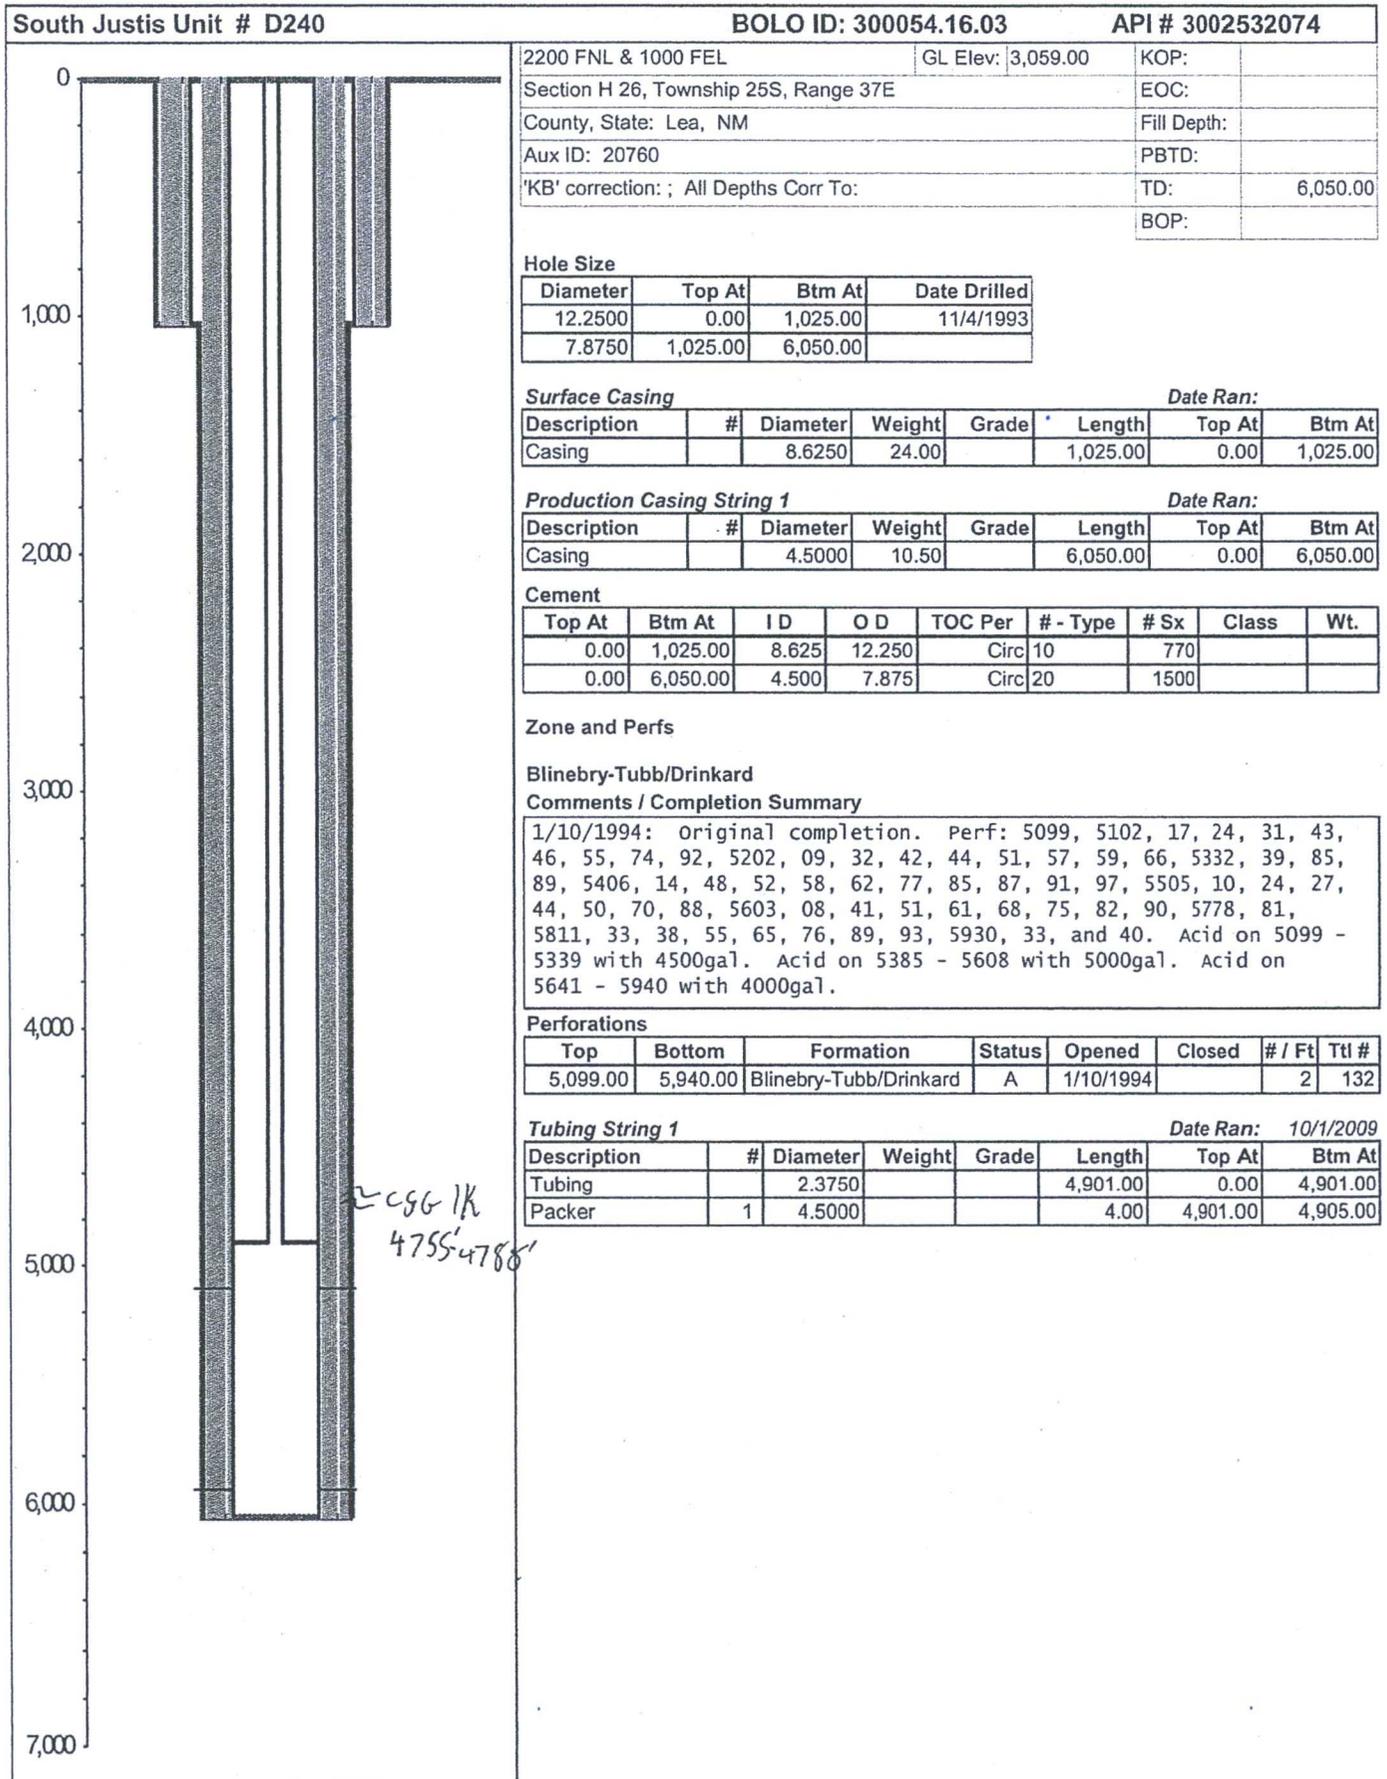

South Justis Unit # D240 BOLO ID: 300054.16.03 API # 3002532074

2200 FNL & 1000 FEL	GL Elev: 3,059.00	KOP:
Section H 26, Township 25S, Range 37E		EOC:
County, State: Lea, NM		Fill Depth:
Aux ID: 20760		PBTD:
'KB' correction: ; All Depths Corr To:		TD: 6,050.00
		BOP:

Hole Size

Diameter	Top At	Btm At	Date Drilled
12.2500	0.00	1,025.00	11/4/1993
7.8750	1,025.00	6,050.00	

Surface Casing Date Ran:

Description	#	Diameter	Weight	Grade	Length	Top At	Btm At
Casing		8.6250	24.00		1,025.00	0.00	1,025.00

Production Casing String 1 Date Ran:

Description	#	Diameter	Weight	Grade	Length	Top At	Btm At
Casing		4.5000	10.50		6,050.00	0.00	6,050.00

Cement

Top At	Btm At	ID	OD	TOC Per	# - Type	# Sx	Class	Wt.
0.00	1,025.00	8.625	12.250	Circ	10	770		
0.00	6,050.00	4.500	7.875	Circ	20	1500		

Zone and Perfs

Blinebry-Tubb/Drinkard

Comments / Completion Summary

1/10/1994: Original completion. Perf: 5099, 5102, 17, 24, 31, 43, 46, 55, 74, 92, 5202, 09, 32, 42, 44, 51, 57, 59, 66, 5332, 39, 85, 89, 5406, 14, 48, 52, 58, 62, 77, 85, 87, 91, 97, 5505, 10, 24, 27, 44, 50, 70, 88, 5603, 08, 41, 51, 61, 68, 75, 82, 90, 5778, 81, 5811, 33, 38, 55, 65, 76, 89, 93, 5930, 33, and 40. Acid on 5099 - 5339 with 4500gal. Acid on 5385 - 5608 with 5000gal. Acid on 5641 - 5940 with 4000gal.

Perforations

Top	Bottom	Formation	Status	Opened	Closed	# / Ft	Ttl #
5,099.00	5,940.00	Blinebry-Tubb/Drinkard	A	1/10/1994		2	132

Tubing String 1 Date Ran: 10/1/2009

Description	#	Diameter	Weight	Grade	Length	Top At	Btm At
Tubing		2.3750			4,901.00	0.00	4,901.00
Packer	1	4.5000			4.00	4,901.00	4,905.00


CG 1K
4755-4780'

Wellbore Schematic (From Surface to TD)

Printed: 6/15/2017

Page 1

PLAN

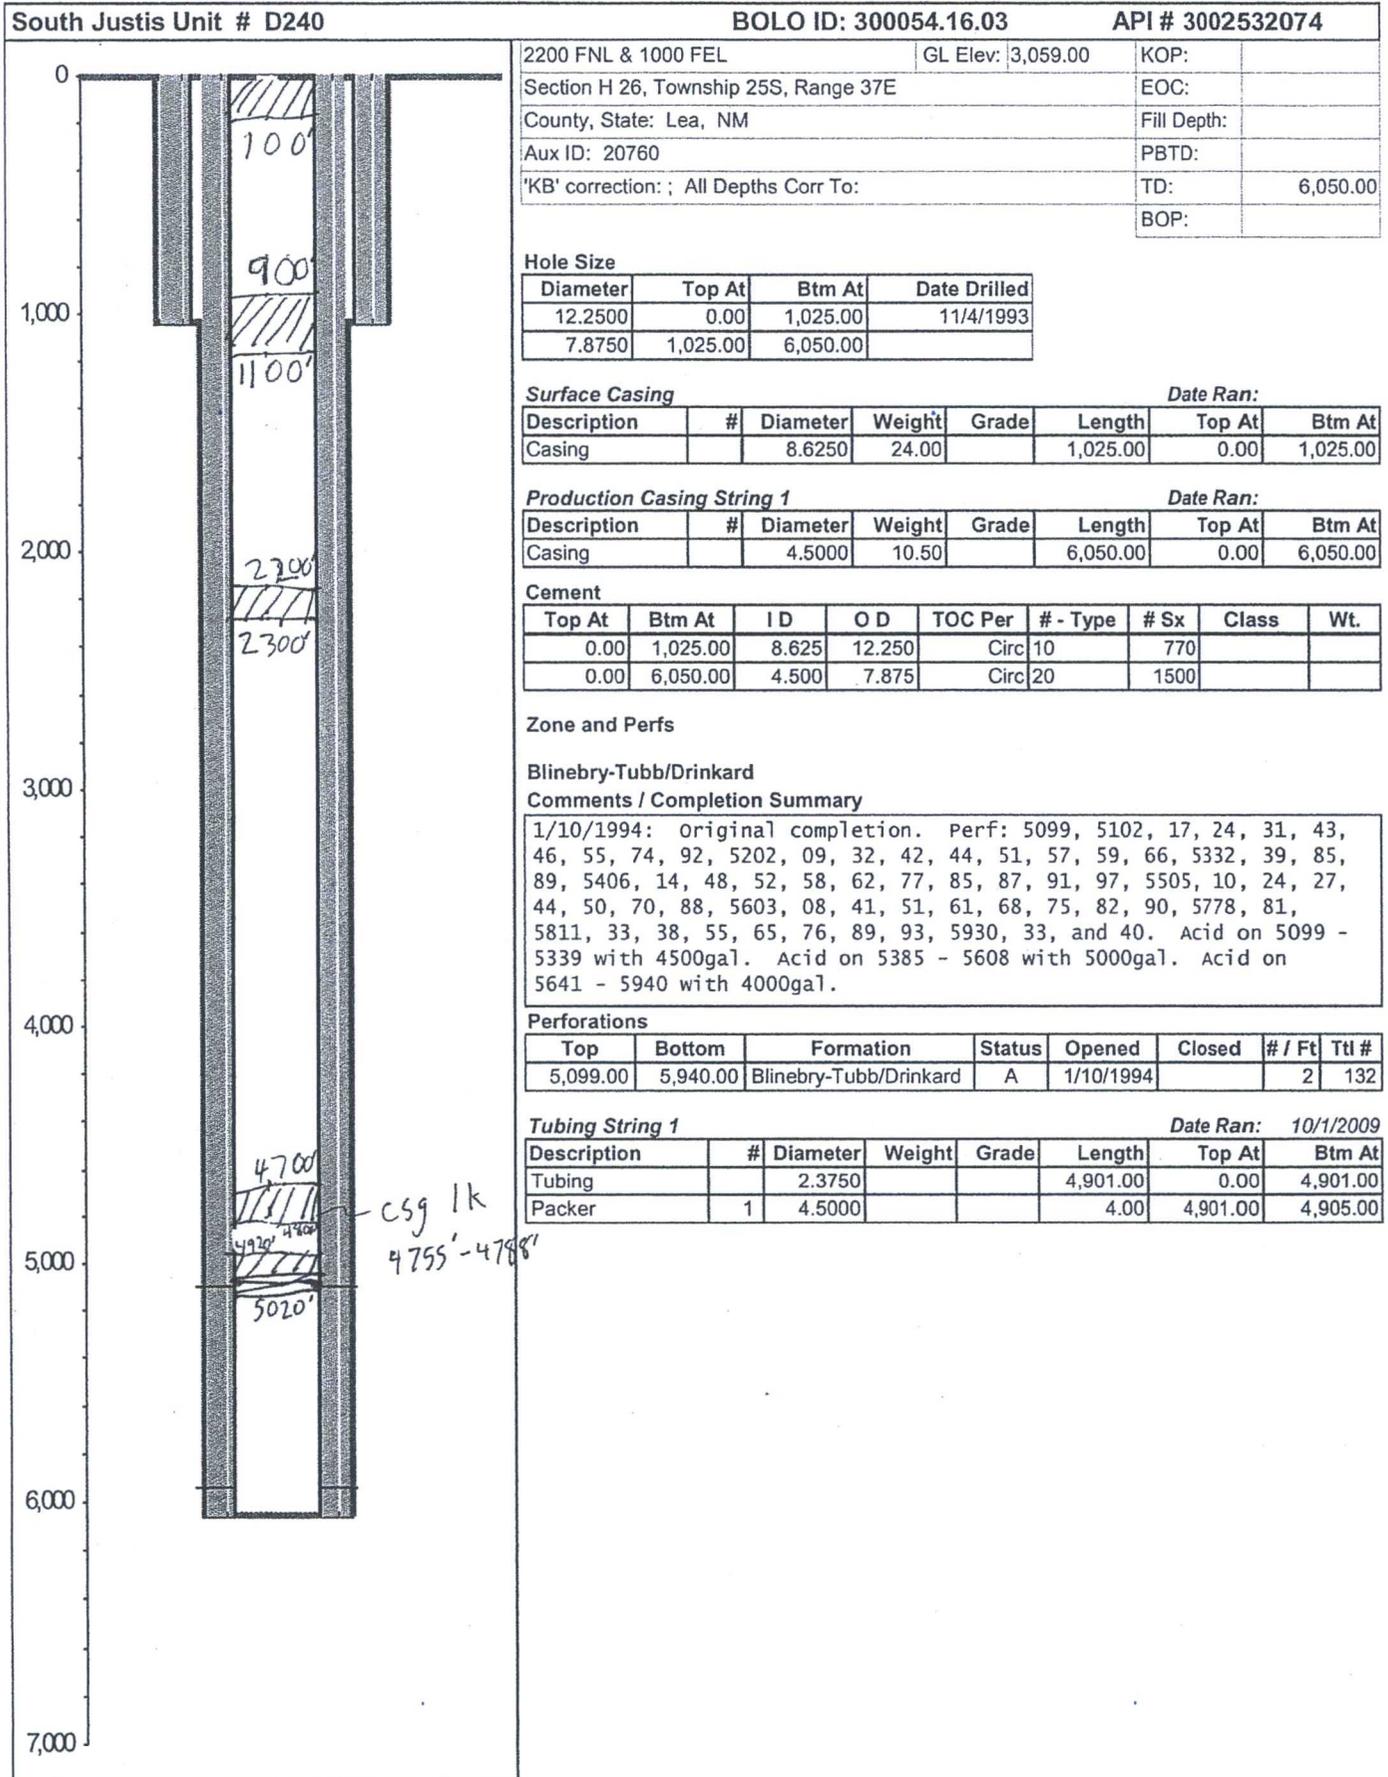

Conditions of Approval

**Legacy Reserves Operating LP
South Justis Unit - 240, API 30015xxxxx
T25S-R37E, Sec 26, 2200FNL & 1000FEL
August 23, 2017**

- 1. Within 90 days of these conditions of approval for the processed Electronic Submission #379117 notice of intent begin wellbore operations or request an extension.**
- 2. Operator is required to have the BLM approved NOI procedure with applicable conditions of approval on location during this workover operation.**
3. Due to being within the Lesser Prairie Chicken habitat, this workover activity will be restricted to the hours of 9:00am through 3:00am for the period of March 1 through June 15.
4. Subject to like approval by the New Mexico Oil Conservation Division.
5. Notify BLM 575-361-2822 Eddy Co as work begins. Plugging procedures are to be witnessed. If there is no response leave a voice mail with the API#, workover purpose, and a call back phone number.
6. Surface disturbance beyond the existing pad must have prior approval.
7. A closed loop system is required. The operator shall properly dispose of drilling/circulating contents at an authorized disposal site. Tanks are required for all operations, no excavated pits.
8. Functional H₂S monitoring equipment shall be on location.
9. 2000 (2M) Blow Out Prevention Equipment to be used. All BOPE and workover procedures shall establish fail safe well control. Ram(s) for the work string(s) used is required equipment. Manual BOP closure system including a blind ram and pipe ram(s) designed to close on all (hand wheels) equipment shall be installed regardless of BOP design. Function test the installed BOPE to 500psig when well conditions allow. Related equipment, (choke manifolds, kill trucks, gas vent or flare lines, etc.) shall be employed when needed for reasonable well control requirements.
10. All waste (i.e. trash, salts, chemicals, sewage, gray water, etc.) created as a result of work over operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area. Porto-johns and trash containers will be on-location during any other crew-intensive operations.
11. The BLM PET witness is to run tbg tally and agree to cement volumes and placement. Sample each plug for cement curing time and tag and/or pressure test as requested by BLM PET witness.
12. Mix cement plugs to cover a minimum of 100ft plus 10ft for every 1,000ft to the bottom of the plug, rounding the number of necessary sacks up to the nearest 5 sacks. Never use less than 25sx.
13. Class C neat cement plugs(s) will be necessary. For any plug that requires a tag or pressure test a minimum WOC time of 4 hours is recommended. Isolation plugs of Class "C" neat to be mixed 14.8#/gal, 1.32 ft³/sx, 6.3gal/sx water.
14. Minimum requirement for mud placed between plugs is 25 sacks of saltwater gel per 100 barrels in 9 lb/gal brine.

15. Set the balanced plug from 5020, WOC, and tag the plug with tbg at 4950 or above.
16. Find the csg leak, establish an injection rate, and squeeze cmt through a packer leaving the plug top 50' to 100' above the leak. Close the tubing valve and hold 9 lb/gal displacement fluid in place until the plug sets up. Tag the plug with tbg.
17. Perf at 1100, establish an injection rate, and squeeze cmt through a packer leaving the plug top in the 50' to 100' above the 8 5/8" shoe at 1025. Close the tubing valve and hold 9 lb/gal displacement fluid in place until the plug sets up. Tag the plug with tbg.
18. Perf at 100, establish an injection rate, and squeeze cmt to the surface.
19. File subsequent sundry Form 3160-5 within 30 days of workover procedures. Include (dated daily) descriptions of the well work, i.e. procedure descriptions and setting depths of each plug in the subsequent sundry.

Reclamation Objectives and Procedures

In Reply Refer To: 1310

Reclamation Objective: At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as needed. This will apply to well pads, facilities, and access roads. Barricade all access road(s) at the starting point. If reserve pits have not been adequately reclaimed due to salts or other contaminants, propose a plan for BLM approval to provide restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations should have included adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
2. For locations and/or access roads not having an approved plan, or an inadequate plan for surface reclamation the operator must submit a proposal describing the procedures for reclamation. The appropriate time for submittal would be when filing the Notice of

Intent, or with the Subsequent Sundry Report of Abandonment on Form 3160-5. The final reclamation goal is to be completed within 6 months of wellbore abandonment.

3. With an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It may be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives.
4. Upon reclamation conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a BLM specialist to inspect the location to verify work was completed as per approved plans.
5. The BLM approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been tentatively reestablished. If the objectives have not been met BLM will be notify the operator of the required corrective actions.
6. It is the responsibility of the operator to monitor these locations and/or access roads until such time the full BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the full BLM objectives have been met, submit a Final Abandonment Notice (FAN) Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
7. At this time a BLM specialist will again inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability for the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos
Supervisory Environmental Protection Specialist
575-234-5909, 575-361-2648 (Cell)

Robertson, Jeffery
Natural Resource Specialist
575-234-2230, 575-706-1920 (Cell)

Trishia Bad Bear
Natural Resource Specialist
575-393-3612, 575-390-2258 (Cell)

Vance Wolf
Natural Resource Specialist
575-234-5979

Jesse Bassett
Natural Resource Specialist
575-234-5913, 575-499-5114 (Cell)

Brooke Wilson
Natural Resource Specialist
575-234-6237

Paul Murphy
Natural Resource Specialist
757-234-5975, 575-885-9264 (Cell)

Henryetta Price
Environmental Protection Specialist
575-234-5951, 575-706-2780 (Cell)

Arthur Arias
Environmental Protection Specialist
575-234-6230, 575-499-3378 (Cell)

Shelly Tucker
Environmental Protection Specialist
575-234-5905, 575-361-0084 (Cell)