

Submit 3 Copies to Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.
30-005-10580

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

CATO SAN ANDRES UNIT

8. Well Number 50

9. OGRID Number 183718

10. Pool name or Wildcat
CATO SAN ANDRES - 10540

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
United Heritage New Mexico Corp.

3. Address of Operator
200 LORAIN, Suite 400, MIDLAND, TX 79701

4. Well Location

Unit Letter: J 1980' feet from the SOUTH line and 1,980' feet from the EAST line
Section 11 Township 8-S Range 30-E NMPM CHAVES County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
4,168' - RDB,

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____

Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 1) RIH to 3,419' & Set a CIBP. Spot a 35' Cmt Plug. WOC & Tag.
- 2) Free Point 4-1/2" Csg.
- 3) Chemical Cut 4-1/2" Csg & POOH & Salvage 4-1/2" Prod. Csg.
- 4) Spot a 100' Plug across 4-1/2" Csg Stub (50' Below & Above Stub). WOC & Tag.
- 5) Pmp 9.5 - 10 ppg Mud between Plugs.
- 6) Spot a 100' Plug f/ 1,544' - 1,444'.
- 7) Pmp 9.5 - 10 ppg Mud between Plugs.
- 8) Spot a 100' Plug f/ 407' - 507'. (Surf. Csg Shoe Plug). WOC & Tag.
- 9) Spot Cmt f/ 50' to Surf.
- 10) Cut Off Well Head & Cap below 3' & Install a Dry Hole Marker.
- 11) Remove all Rig Anchors.

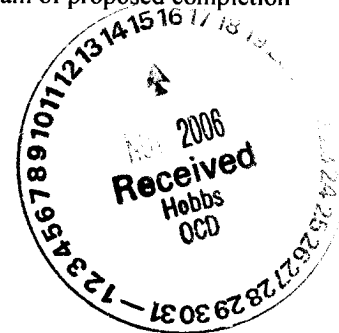

THE OIL CONSERVATION DIVISION MUST
BE NOTIFIED 24 HOURS PRIOR TO THE
BEGINNING OF PLUGGING OPERATIONS.

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE: Jesse K. Lawson TITLE: Petroleum Engineer DATE: November 7, 2006

Type or print name Jesse K. Lawson E-mail address: jklawson@lothian.us Telephone No. 432-686-2618

For State Use Only

APPROVED BY: Gary W. Wink OIL FIELD REPRESENTATIVE II / STAFF MANAGER DATE: NOV 17 2006
Conditions of Approval (if any):