

Form 3160-5
(August 1999)UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENTMonth - Year
APR - 5 2007
OCD - ARTESIA, NMFORM APPROVED
OMB No. 1004-0175
Expires November 30, 2000**SUNDRY NOTICES AND REPORTS ON WELLS**
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.**SUBMIT IN TRIPLICATE - Other instructions on reverse side**

1. Type of Well ☐ Oil Well ☒ Gas Well ☐ Other		5. Lease Serial No. NM90588
2. Name of Operator Pogo Producing Company		6. If Indian, Allottee or Tribe Name
3a. Address P.O. Box 10340	3b. Phone No. (include area code) 432-617-0208	7. If Unit or CA/Agreement, Name and/or No.
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 480 NL & 330 FWL Sec. 18, T-22-S. R-32-E		8. Well Name and No. Livingston Ridge 3 18 Fed
		9. API Well No. 3002532324
		10. Field and Pool, or Exploratory Area Undes E. Livingston Ridge
		11. County or Parish, State Eddy, County, NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
☒ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off
☐ Subsequent Report	☐ Alter Casing	☐ Fracture Treat	☐ Reclamation	☐ Well Integrity
☐ Final Abandonment Notice	☐ Casing Repair	☐ New Construction	☐ Recomplete	☐ Other
	☐ Change Plans	☒ Plug and Abandon	☐ Temporarily Abandon	
	☐ Convert to Injection	☐ Plug Back	☐ Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

1. Tag C.I.B.P. @ 7708'.
 2. Cap C.I.B.P. w/25 sx cement.
 3. DV Tool 6,155'
 4. Spot a 75 sx Plug from 6740'-6100', Tag.
 5. Spot a 35 sx Plug @ 5460 - 5410'.
 6. Spot a 45 sx Plug 4478'-4350'.
 7. Cut 5 1/2" Csg. @ Free Point.
 8. Spot 55 sx Plug in & out of 5 1/2" Csg. Stub., Tag.
 9. Spot 35 sx Plug 3100'-3000', Tag.
 10. Spot 45 sx Plug 2650'-2200'
 11. Spot a 75 sx Plug from 950'-700', Tag.
 12. Spot a 30 sx Plug at Surface & install Dry Hole Marker.
- Note: Spot all Plugs w/ 10# Salt Gel Mud.

APPROVED

APR 30 2007

LES BABYAK
PETROLEUM ENGINEER

14. I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

Howard Boatright Title Agent

Signature *H Boatright* Date 3/28/07

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title


Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

GWW


SEE ATTACHED FOR
CONDITIONS OF APPROVAL

Before PPA

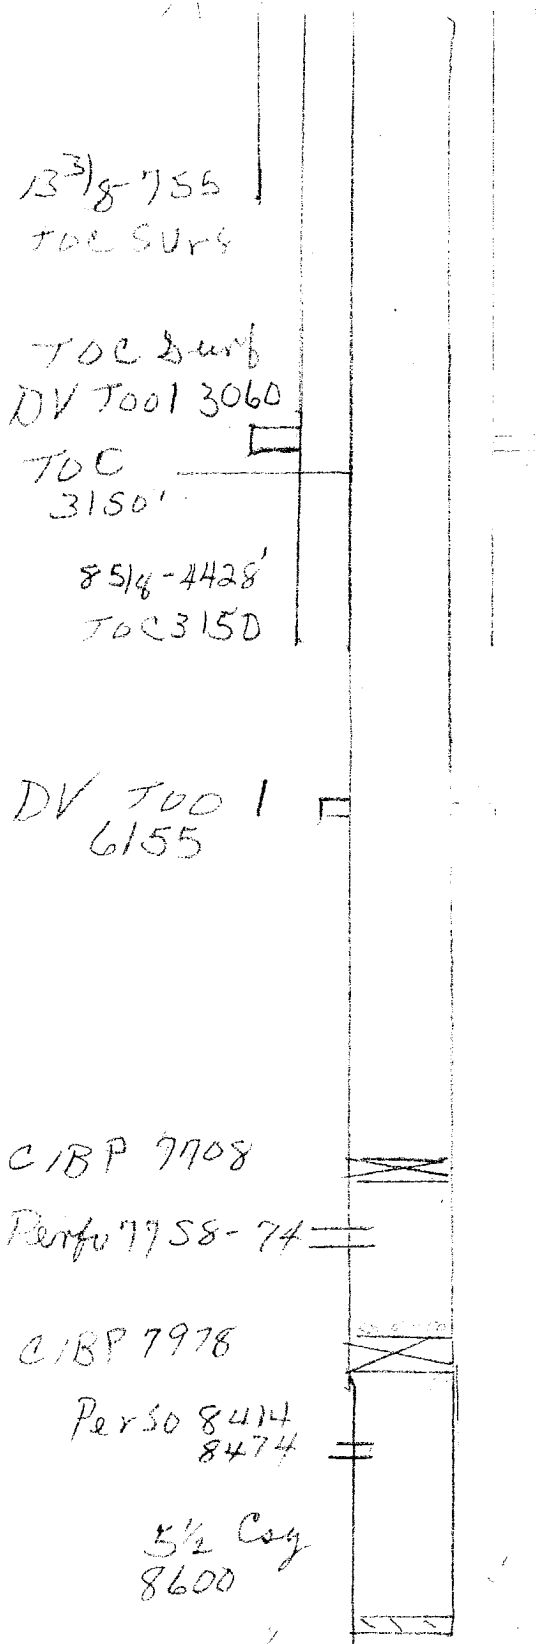

After PPA

Dry Hole Marker

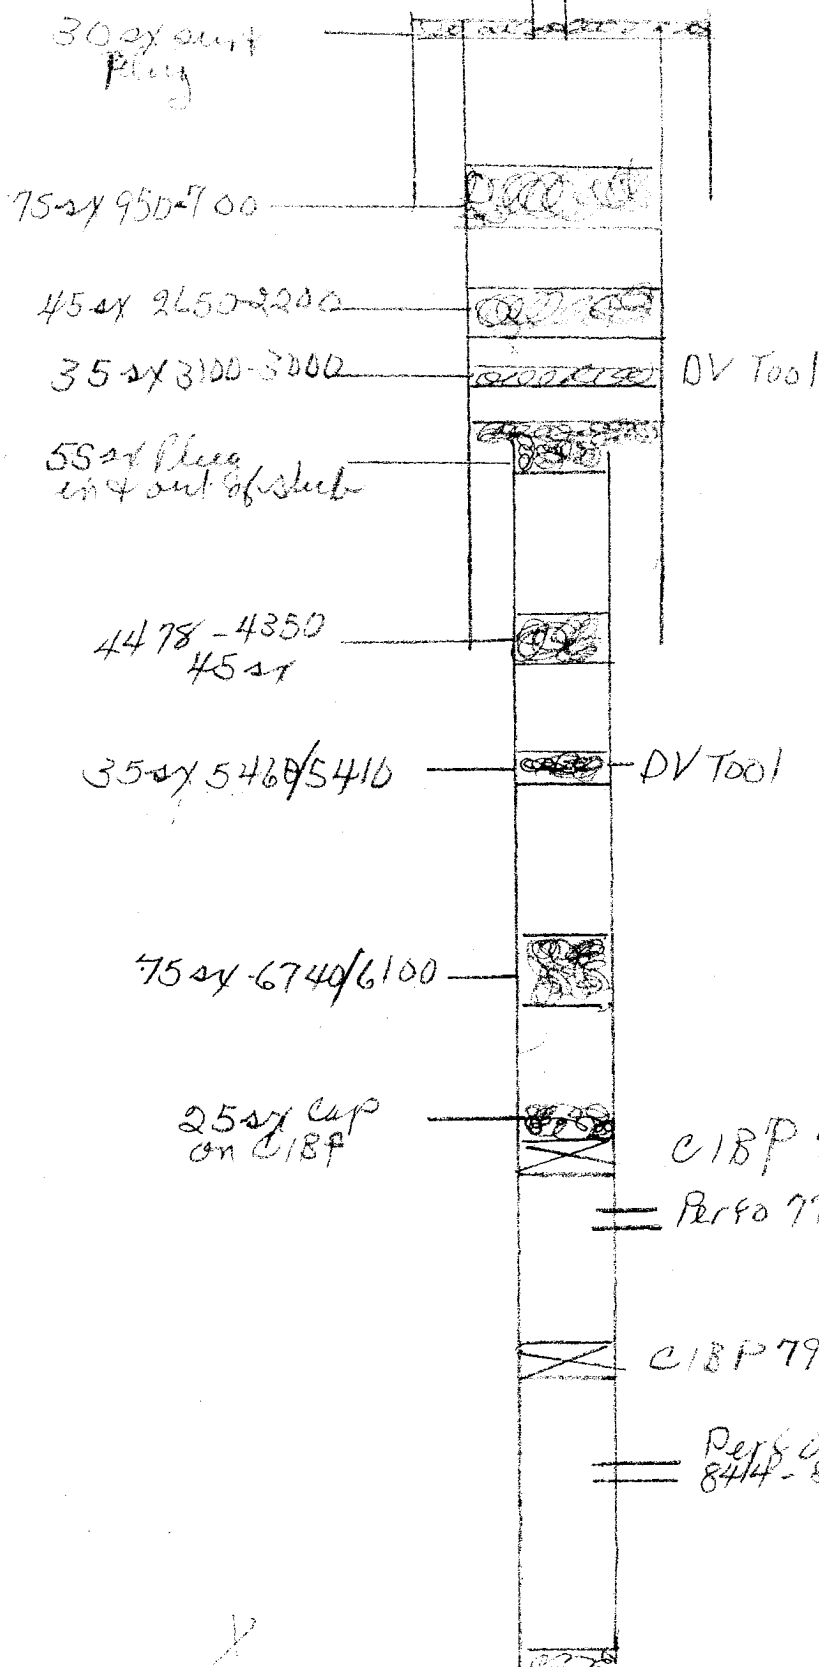

CURRENT WELLBORE DIAGRAM

LEASE: LR 18 FEDERAL	WELL: #3	FIELD: LIVINGSTON RIDGE	API: 30-025-32324
LOC: 480' FNL & 330' FWL	SEC: 18	TNSHP: 22S	ID NO: 377
RANGE: 32E	GL: 3632.4'	CTY/ST: EDDY/NM	SPUD: 12/5/1993
CURRENT STATUS: T/A'D	KB: 13.5'	DF: 3644.9'	TD DATE: 12/18/1993

